

**Originator:** ASIC/ Steven Ye

# 3-Axis Single Chip Magnetic Sensor QMC6310



The QMC6310 is a three-axis magnetic sensor, which integrates magnetic sensors and signal condition ASIC into one silicon chip. This Land Grid Array package (LGA) is targeted for applications such as e-compass, map rotation, gaming and personal navigation in mobile and wearable devices.

The QMC6310 is based on state-of-the-art, high resolution, magneto-resistive technology. Along with the custom-designed 16-bit ADC ASIC, it offers the advantages of low noise, high accuracy, low power consumption, offset cancellation and temperature compensations. QMC6310 enables 1° to 2° compass heading accuracy. The I²C serial bus allows for easy interface.





The QMC6310 is in a 1.2x1.2x0.53mm<sup>3</sup> surface mount 8-pin LGA package.

# **FEATURES**


- 3-Axis Magneto-Resistive Sensors in a 1.2x1.2x0.5 3mm³ LGA, Guaranteed to Operate Over an Extended Temperature Range of -40 °C to +85 °C.
- ▶ 16 Bit ADC With Low Noise AMR Sensors Achieves 2 milli-Gauss Field Resolution
- Wide Magnetic Field Range (±30 Gauss)
- ▶ Temperature Compensated Data Output
- ▶ I<sup>2</sup>C Interface with Standard and Fast Modes
- ▶ Built-In Self-Test
- Wide Range Operation Voltage (2.5V to 3.6V) and Low Power Consumption (35μA)
- ▶ Lead Free Package Construction
- ▶ Software and Algorithm Support Available

# **BENEFIT**

- Small Size for Highly Integrated Products. Signals Have Been Digitized and Calibrated.
- Enables 1° To 2° Degree Compass Heading Accuracy, Allows for Pedestrian Navigation and LBS Applications
- Maximizes Sensor's Full Dynamic Range and Resolution
- Automatically Maintains Sensor's Sensitivity Under Wide Operating Temperature Range
- High-Speed Interfaces for Fast Data Communications.
   Maximum 1.5KHz Data Output Rate
- Enables Low-Cost Functionality Test After Assembly in Production
- Compatible with Battery Powered Applications
- RoHS Compliance
- Compassing Heading, Hard Iron, Soft Iron, and Auto Calibration Libraries Available

# **CONTENTS**

CO	NTENTS		3
1	INTERNA	AL SCHEMATIC DIAGRAM	4
	1.1	Internal Schematic Diagram	4
2	SPECIFIC	CATIONS AND I/O CHARACTERISTICS	5
	2.1	Product Specifications	5
	2.2	Absolute Maximum Ratings	6
	2.3	I/O Characteristics	6
3	PACKAC	GE PIN CONFIGURATIONS	6
	3.1	Package 3-D View	6
	3.2	Package Outlines	7
4	<b>EXTERN</b>	IAL CONNECTION	8
	4.1	Recommended External Connection	8
	4.2	Mounting Considerations	8
	4.3	Layout Considerations	9
5	BASIC D	EVICE OPERATION	9
	5.1	Anisotropic Magneto-Resistive Sensors	9
	5.2	Power Management	9
	5.3	Power On/Off Time	10
	5.4	Communication Bus Interface I <sup>2</sup> C and Its Addresses	11
	5.5	Internal Clock	11
	5.6	Temperature Compensation	11
6	MODES	OF OPERATION	11
	6.1	Modes Transition	11
	6.2	Description of Modes	12
7	APPLICA	ATION EXAMPLES	12
	7.1	Normal Mode Setup Example	12
	7.2	Continuous Mode Setup Example	
	7.3	Self-test Example	12
	7.4	Suspend Mode Example	
	7.5	Measurement Example	
	7.6	Soft Reset Example	
8	I <sup>2</sup> C COM	MUNICATION PROTOCOL	13
	8.1	I <sup>2</sup> C Timings	
	8.2	I <sup>2</sup> C R/W Operation	
9	REGISTE	ERS	
	9.1	Register Map	
	9.2		15

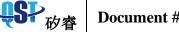

# Rev: A

# 1 **INTERNAL SCHEMATIC DIAGRAM**

# 1.1 **Internal Schematic Diagram**

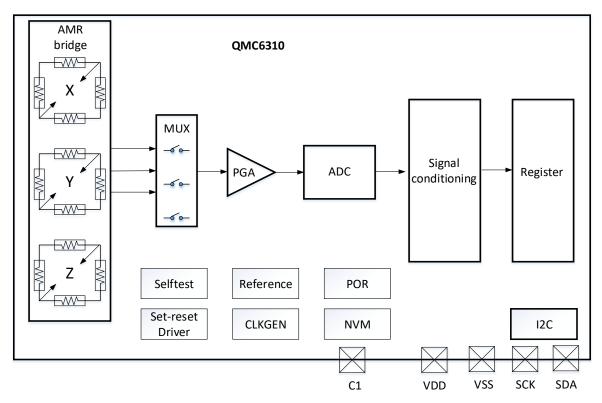


Figure 1. Block Diagram

**Table 1. Block Function** 

Block	Function
AMR bridge	3-axis magnetic sensor
MUX	Multiplexer for sensor channels
PGA	Programmable gain amplifier for sensor signals
ADC	Analog-to-Digital converter
Signal conditioning	Digital blocks for magnetic signal calibration and compensations
I <sup>2</sup> C	Interface logic data I/O
NVM	Non-volatile memory
Register	Internal register
Selftest	Internal driver to generate self-test stimulus
Set-reset Driver	Internal driver to initialize magnetic sensor
Reference	Voltage/current reference for internal biasing
CLKGEN.	Internal oscillator for internal operation
POR	Power on reset



Rev: A

# 2 **SPECIFICATIONS AND I/O CHARACTERISTICS**

# 2.1 **Product Specifications**

able 2. Specification Parameter	Conditions	<u> </u>	Min	Тур	Max	Unit	
Supply Voltage	VDD		2.5	. , , ,	3.6	V	
Suspend Mode Current		Total Current on VDD		22		μA	
	Low power	ODR=10Hz		35/78		uA	
Normal Mode	Low power and high	ODR=50Hz		85/310			
Current [1]	power mode	ODR=100Hz		150/600		u/A	
	power mede	ODR=200Hz		280/1180			
Continuous Mode Current	Maximum ODF	R: 1500Hz		2200		uA	
Sensor Field Range	Full Scale		-30		+30	Gauss	
	Field Range =	±30G		1000		LSB/G	
0	Field Range =		2500		LSB/G		
Sensitivity [2]	Field Range =		3750		LSB/G		
	Field Range =		15000		LSB/G		
Linearity	Linearity Field Range = ±300 Happlied= ±15G			0.5		%FS	
Hysteresis	3 sweeps acro	ss ±30G		0.03		%FS	
Offset				±10		mG	
Sensitivity Tempco	Ta = -40°C~85°C			±0.05		%/°C	
Digital Resolution	Field Range =	±30G		1.0		mGauss	
Field Resolution	Standard	X/Y axis		2		— mGauss	
Ticia resolution	deviation Z axis			3		moduss	
X-Y-Z Orthogonality	Sensitivity Directions			90±1		Degree	
Operating Temperature			-40		85	°C	
ESD	HBM		4000			V	
L3D	CDM		1000			v	

Note [1]: The Normal Mode Current differs at different OSR1 setting. The value of low power mode is measured at OSR1=1 setting, and the value of high power mode is measured at OSR1=8.

Note [2]: Sensitivity is calibrated at zero field; it is slightly decreased at high fields.



Rev: A

# **Absolute Maximum Ratings** 2.2

Table 3. Absolute Maximum Ratings (Tested at 25°C except stated otherwise.)

Parameter	MIN.	MAX.	Units
VDD	-0.3	5.4	V
Storage Temperature	-40	125	°C
Exposed to Magnetic Field (all directions)		50000	Gauss
Reflow Classification	MSL 1, 260 °C F	Peak Temperature	1

## 2.3 I/O Characteristics

Table 4. I/O Characteristics (VDDIO=3.3V)

Symbol	Parameter(Units)	Minimum	Typical	Maximum
VIH	High Level Input Voltage(V)	0.7*VDDIO		
VIL	Low Level Input Voltage(V)			0.3*VDDIO
VHYS	Hysteresis of Schmitt Trigger Input(V)	0.1		
lı∟	Input Leakage, ALL Inputs(uA)	-10		10
Voн	High Level output Voltage(V)	0.8*VDDIO		
VOL	Low Level output Voltage(V)			0.2*VDDIO

# 3 **PACKAGE PIN CONFIGURATIONS**

## 3.1 Package 3-D View

Arrow indicates direction of magnetic field that generates a positive output reading in normal measurement configuration.

< QMC6310 >

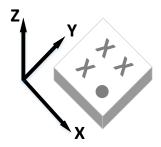


Figure 2. Package 3-D View

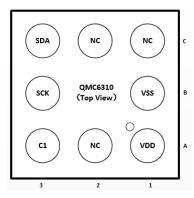


Figure 3. Package Top View



Rev: A

**Table 5. Pin Configurations** 

PIN	PIN	I/O	TYPE	Function
No.	NAME			
A1	VDD		Power	Supply Power
A2	NC		NC	Not connected
A3	C1		CMOS	Reservoir capacitor connection
B1	VSS		VSS	Ground
B3	SCK		CMOS	I2C clk
C1	NC		NC	Not connected
C2	NC		NC	Not connected
C3	SDA	I/O	CMOS	I2C data


# 3.2 **Package Outlines**


# 3.2.1 Package Type

LGA 8-pin


# Package Size: 3.2.2

1.2mm (Length)\*1.2mm (Width)\*0.53mm (Height)

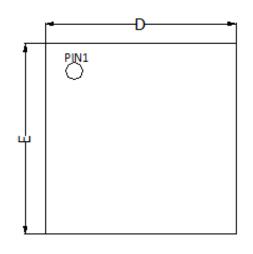

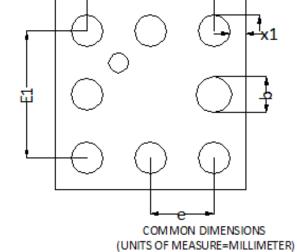

D1

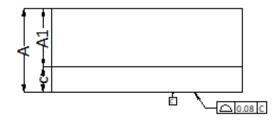

SYMBOL	MIN.	NOM.	MAX.		
Α	0.47	0.53	0.59		
A1		0.37			
0	0.13	0.16	0.19		
D	1.15	1.20	1.25		
D1	0.80 BSC				
E	1.15	1.20	1.25		
E1	0.80 BSC				
e	0.40 BSC				
b	0.15	0.20	0.25		
x1	0.10 REF				
у1	0.10 REF				

Figure 4. Package Size

The information contained herein is the exclusive property of QST, and shall not be distributed,
reproduced, or disclosed in whole or in part without prior written permission of QST.



Rev: A

#### 3.2.3 Marking:

Tracking code: X<sub>1</sub>X<sub>2</sub>X<sub>3</sub>

X<sub>1</sub>= Series code, to distinguish 6310 series with the different I2C address

"U" for QMC6310U, "N" for QMC6310N

X<sub>2</sub>X<sub>3</sub>= Package Lot •= Pin1 Identifier

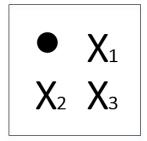


Figure 5. Chip Marking

# **EXTERNAL CONNECTION**

#### 4.1 **Recommended External Connection**

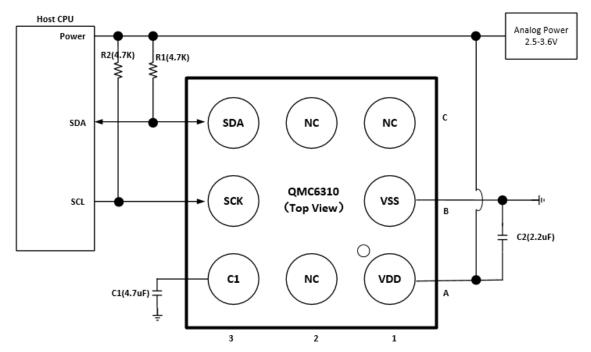


Figure 6. External Connection

Note: R1/R2 selection guide: 2.7Kohm for a short I2C bus length (less than 10 cm), and 4.7Kohm for a bus length less than 5 cm.

# 4.2 **Mounting Considerations**

The following is the recommend printed circuit board (PCB) footprint for the QMC6310. Due to the fine pitch of the pads, the footprint should be properly centered in the PCB.



Rev: A

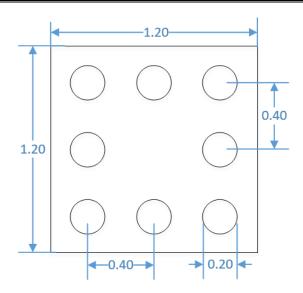


Figure 7. QMC6310 PCB footprint

## 4.3 **Layout Considerations**

Besides keeping all components that may contain ferrous materials (nickel, etc.) away from the sensor on both sides of the PCB, it is also recommended that there is no conducting copper line under/near the sensor in any of the PCB layers.

#### 4.3.1 Solder Paste

A 4-mil stencil and 100% paste coverage is recommended for the electrical contact pads.

#### 4.3.2 **Reflow Assembly**

This device is classified as MSL 1 with 260°C peak reflow temperature. Reference IPC/JEDEC standard J-STD-033 for additional information.

No special reflow profile is required for QMC6310, which is compatible with lead eutectic and lead-free solder paste reflow profiles. QST recommends adopting solder paste manufacturer's guidelines. Hand soldering is not recommended.

#### **External Capacitors** 4.3.3

The external capacitors C1 should be ceramic type with low ESR characteristics. The exact ESR value is not critical, but values less than 200 milli-ohms are recommended. Reservoir capacitor C1 is nominally 4.7 µF in capacitance. Low ESR characteristics may not be in many small SMT ceramic capacitors (0402), so be prepared to up-size the capacitors (0201) to gain low ESR characteristics.

## 5 **BASIC DEVICE OPERATION**

## 5.1 **Anisotropic Magneto-Resistive Sensors**

The QMC6310 magneto-resistive sensor circuit consists of tri-axial sensors and application specific support circuits to measure magnetic fields. With a DC power supply is applied to the sensor two terminals, the sensor converts any incident magnetic field in the sensitive axis directions to a differential voltage output.

The device has an offset cancellation function to eliminate sensor and ASIC offsets. It also applies a self-aligned magnetic field to restore magnetic state before each measurement to ensure high accuracy. Because of these features, the QMC6310 doesn't need to calibrate every time in most of application situations. It may need to be calibrated once in a new system or a system changes a new battery.

# 5.2 **Power Management**

The information contained herein is the exclusive property of QST, and shall not be distributed, reproduced, or disclosed in whole or in part without prior written permission of QST.



Rev: A

There are only one power supply pins to the device. VDD provides power for all the internal analog and digital functional blocks and I/O.

When the device is powered on, all registers are reset by POR (Power-On-Reset), then the device transits to the suspend mode and waits for further commands.

Table 6 provides references for two power states.

**Table 6: Power States** 


Power State	VDD	Power State description
1	0V	Device Off, No Power Consumption
2	2.5V~3.6V	Device On, Enters Suspend Mode after POR, waiting
		for further commands

#### 5.3 **Power On/Off Time**

After the device is powered on, some time periods are required for the device fully functional. The external power supply requires a time period for voltage to ramp up (PSUP), it is typically 50 milli-second. However, it isn't controlled by the device. The Power-On-Reset time period (PORT) includes time to reset all the logics, load values in NVM to proper registers, enter the standby mode and get ready for analogy measurements. The power on/off time related to the device is in Table 7.

Table 7. Time Required for Power On/Off

able 7. Time required for 1 ower On/On							
Parameter	Symbol	Condition	Min.	Тур.	Max.	Unit	
POR	PORT	Time Period After VDD at			250	uS	
Completion		Operating Voltage to Ready for					
Time		I <sup>2</sup> C Command					
Power off	SDV	Voltage that Device			0.2	V	
Voltage		Considered to be Power					
-		Down.					
Power on	PINT	Time Period Required for	100			uS	
Interval		Voltage Lower Than SDV to					
		Enable Next POR					

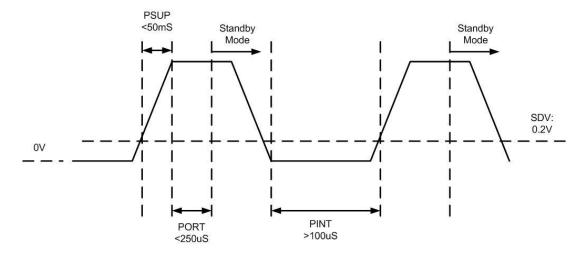

Power On/Off Timing

Figure 8. Power On/Off Timing

The information contained herein is the exclusive property of QST, and shall not be distributed,
reproduced, or disclosed in whole or in part without prior written permission of QST.



Rev: A

#### 5.4 Communication Bus Interface I<sup>2</sup>C and Its Addresses

This device will be connected to a serial interface bus as a slave device under the control of a master device, such as the processor. Control of this device is carried out via I2C.

This device is compliant with I<sup>2</sup>C Bus Specification. As an I<sup>2</sup>C compatible device, this device has a 7-bit serial address and supports I<sup>2</sup>C protocols. This device supports standard and fast speed modes, 100kHz and 400kHz, respectively. External pull-up resistors are required to support all these modes.

There are two I<sup>2</sup>C address available for QMC6310 series. The value is 1CH for QMC6310U and 3CH for QMC6310N.

If more I2C address options are required, please contact factory.

#### Internal Clock 5.5

The device has an internal clock for internal digital logic functions and timing management. This clock is not available to external usage.

# 5.6 **Temperature Compensation**

The Device has built-in Temperature compensation function. The compensated magnetic sensor data is placed in the Output Data Registers automatically.

#### MODES OF OPERATION 6

#### 6.1 **Modes Transition**

The device has three different modes, controlled by register (0x0A), mode bits Mode<1:0>. The main purpose of these modes is for power management. The modes can be transited from one to another, as shown below, through I<sup>2</sup>C commands of changing mode bits. The default mode is Suspend Mode.

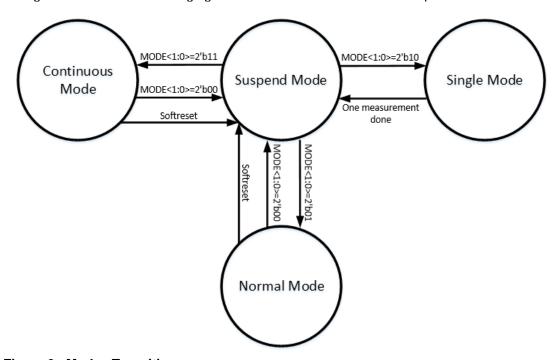


Figure 9. Modes Transition



6.2 **Description of Modes** 

#### 6.2.1 **Normal Mode**

During the Normal mode (MODE bits= 2'b01), the magnetic sensor continuously makes measurements and places measured data in data output registers. The field range register is controlled by RNG<1:0> in register 0BH and data output rate is controlled by ODR<1:0> in register 0AH. They should be set up properly for your applications in the normal mode.

#### Single Mode 6.2.2

During the Single Mode (MODE bits=2'b10), the whole chip runs only once and enter in the suspend mode after 1 measurement is finished.

#### 6.2.3 **Continuous Mode**

During the Continuous Mode (MODE bits=2'b11), the whole chip runs all the time without sleep time, so the maximum ODR can be got at this mode. The self-test function can only be enabled in Continuous Mode and enters in Suspend Mode after the data is updated.

#### 6.2.4 **Suspend Mode**

Suspend mode is the default magnetometer state upon POR and soft reset. Only few function blocks are activated in this mode which keeps power consumption as low as possible. In this state, register values are hold on by a lower power LDO, I2C interface is active and all register read and write are allowed. There is no magnetometer measurement in this Mode.

#### 7 APPLICATION EXAMPLES

# **Normal Mode Setup Example**

- ♦ Write Register 29H by 0x06 (Define the sign for X Y and Z axis)
- ♦ Write Register 0BH by 0x08 (Define Set/Reset mode, with Set/Reset On, Field Range 8Guass)
- ♦ Write Register 0AH by 0xCD (set normal mode, set ODR=200Hz)

#### 7.2 **Continuous Mode Setup Example**

- ♦ Write Register 29H by 0x06 (Define the sign for X Y and Z axis)
- Write Register 0BH by 0x08 (Define Set/Reset mode, with Set/Reset On, Field Range 8Guass)
- ♦ Write Register 0AH by 0xC3 (set continuous mode)

#### 7.3 **Self-test Example**

- ♦ Write Register 29H by 0x06 (Define the sign for X Y and Z axis)
- ♦ Write Register 0AH by 0x03 (set continuous mode)
- ♦ Check status register 09H[0],"1" means ready
- ♦ Read data Register 01H ~ 06H, recording as datax1/datay1/dataz1
- ♦ Write Register 0BH by 0x40(enter self-test function)
- ♦ Waiting 5 millisecond until measurement ends
- ♦ Read data Register 01H ~ 06H, recording as datax2/datay2/dataz2
- ♦ Calculate the delta (datax1-datax2), (datay1-datay2), (dataz1-dataz2)

#### 7.4 Suspend Mode Example

♦ Write Register 0AH by 0x00

## 7.5 **Measurement Example**

- ♦ Check status register 09H[0],"1" means ready
- ♦ Read data register 01H ~ 06H

#### 7.6 **Soft Reset Example**

Rev: A



Rev: A

♦ Write Register 0BH by 0x80

## I<sup>2</sup>C COMMUNICATION PROTOCOL 8

# 8.1 I<sup>2</sup>C Timings

Below table and graph describe the I<sup>2</sup>C communication protocol times

Table 8 I2C Timings

Parameter	Symbol	Condition	Min.	Тур.	Max.	Unit
SCL Clock	f <sub>scl</sub>		0		400	kHz
SCL Low Period	t <sub>low</sub>		1			μS
SCL High Period	t <sub>high</sub>		1			μS
SDA Setup Time	t <sub>sudat</sub>		0.1			μS
SDA Hold Time	t <sub>hddat</sub>		0		0.9	μS
Start Hold Time	t <sub>hdsta</sub>		0.6			μS
Start Setup Time	t <sub>susta</sub>		0.6			μS
Stop Setup Time	t <sub>susto</sub>		0.6			μS
New Transmission Time	t <sub>buf</sub>		1.3			μS
Rise Time	t <sub>r</sub>				0.3	μS
Fall Time	t <sub>f</sub>				0.3	μS

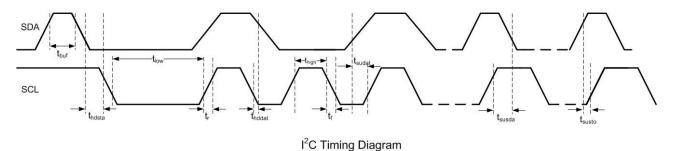


Figure 10. I<sup>2</sup>C Timing Diagram

# 8.2 I<sup>2</sup>C R/W Operation

#### 8.2.1 **Abbreviation**

Table 9. Abbreviation

SACK	Acknowledged by slave
MACK	Acknowledged by master
NACK	Not acknowledged by master
RW	Read/Write

#### 8.2.2 Start/Stop/Ack

START: Data transmission begins with a high to transition on SDA while SCL is held high. Once I2C transmission starts, the bus is considered busy.

STOP: STOP condition is a low to high transition on SDA line while SCL is held high.

ACK: Each byte of data transferred must be acknowledged. The transmitter must release the SDA line during the acknowledge pulse while the receiver must then pull the SDA line low so that it remains stable low during the high period of the acknowledge clock cycle.

The information contained herein is the exclusive property of QST, and shall not be distributed,
reproduced, or disclosed in whole or in part without prior written permission of QST.



Rev: A

NACK: If the receiver doesn't pull down the SDA line during the high period of the acknowledge clock cycle, it's recognized as NACK by the transmitter.

#### I<sup>2</sup>C Write 8.2.3

I<sup>2</sup>C write sequence begins with start condition generated by master followed by 7 bits slave address and a write bit (R/W=0). The slave sends an acknowledge bit (ACK=0) and releases the bus. The master sends the one-byte register address. The slave again acknowledges the transmission and waits for 8 bits data which shall be written to the specified register address. After the slave acknowledges the data byte, the master generates a stop signal and terminates the writing protocol.

Table 10. I<sup>2</sup>C Write for QMC6310U

ST	Slave Address	R W	,S	R	egis	ter (0x0		dres	SS		S				Data 0x03				Ş	S-	
ART	0 0 1 1 1 0 0	0	ACK	0 0	0	0	1	0	1	0	ACK	0	0	0 (	) (	0	1	1	ACK	ГОР	

Table 11. I2C Write for QMC6310N

S	Slave Address	R W	S	Regis	ter Add (0x0A)	dress	ပ္		Data (0x03	)		ပွ	S
FART	0 1 1 1 1 0 0	0	ACK	0 0 0	0 1	0 1 0		0 0	0 0 0	0 1	1	ACK	ТОР

#### 8.2.4 I2C Read

I<sup>2</sup>C read sequence consists of a one-byte I<sup>2</sup>C write phase followed by the I<sup>2</sup>C read phase. A start condition must be generated between two phases. The I2C write phase addresses the slave and sends the register address to be read. After slave acknowledges the transmission, the master generates again a start condition and sends the slave address together with a read bit (R/W=1). Then master releases the bus and waits for the data bytes to be read out from slave. After each data byte, the master has to generate an acknowledge bit (ACK = 0) to enable further data transfer. A NACK from the master stops the data being transferred from the slave. The slave releases the bus so that the master can generate a STOP condition and terminate the transmission.

Table 12. I2C Read for QMC6310U

ST		SI	ave	Ac	ddre	ress R Register Address (0x00)					SA								
START	0	0	1	1	1	0	0	0	ĆK	0	0	0	0	0	0	0	0	CK	
ST		SI	ave	Ac	ddre	ess		R W	SA				Da (0x	ata 80)				NAO	ST
START	0	0	1	1	1	0	0	1	\CK	1	0	0	0	0	0	0	0	\CK	-ОР

Table 13. I2C Read for QMC6310N

	•••	. •		•						•									
ST		SI	ave	e Ac	ddre	ess		R W	SA		Re	egis	ter (0x	Ad (00	dre	SS		/S	
START	0	1	1	1	1	0	0	0	ĆK	0	0	0	0	0	0	0	0	Š	
ST		SI	ave	Ac	ddre	ess		R W	4S				Da (0x	ata 80)				NA	ST
START	0	1	1	1	1	0	0	1	Ć.	1	0	0	0	0	0	0	0	Š	ТОР



Rev: A

# 9 REGISTERS

# 9.1 **Register Map**

The table below provides a list of the 8-bit registers embedded in the device and their respective function and addresses

Table 14. Register Map

Addr.	7	6	5	4	3	2	1	0	Access			
00H	CHIPID[7	7:0]							Read only			
01H	Data Out	put X LSE	Register	XOUT[7:	0]				Read only			
02H	Data Out	put X MSI	B Register	XOUT[1	5:8]				Read only			
03H	Data Out	Data Output Y LSB Register YOUT[7:0]										
04H	Data Out	Data Output Y MSB Register YOUT[15:8]										
05H	Data Out	Data Output Z LSB Register ZOUT[7:0]										
06H	Data Out	Data Output Z MSB Register ZOUT[15:8]										
09H			RF	U			OVFL	DRD	Read only			
								Υ				
0AH	OSR2<1	OSR2<1:0> OSR1<1:0> ODR<1:0> MODE<1:0										
0BH	SOFT_	SET	Read/Write									
	RST	:1:0>										

## 9.2 **Register Definition**

#### 9.2.1 **Output Data Register**

Register 00H stores the chip ID. The default value is 80H.

Registers 01H ~ 06H store the measurement data from each axis magnetic sensor in each working mode. In the normal mode, the output data is refreshed periodically based on the data update rate ODR setup in control registers 0AH. The data stays the same, regardless of reading status through I2C, until new data replaces them. Each axis has 16-bit data width in 2's complement, i.e., MSB of 02H/04H/06H indicates the sign of each axis. The output data of each channel saturates at -32768 and 32767.

Table 15. Output Data Register

I GDIO I OI	Output E	Jaia og.	0.0.					
Addr.	7	6	5	4	3	2	1	0
00H	CHIPID[7	7:0]						
01H	Data Out	tput X LSE	3 Register	XOUT[7:	:0]			
02H	Data Out	tput X MS	B Register	XOUT[1	5:8]			
03H	Data Out	tput Y LSE	3 Register	YOUT[7:	:0]			
04H	Data Out	tput Y MS	B Register	YOUT[1	5:8]			
05H	Data Out	tput Z LSE	3 Register	ZOUT[7:	0]			
06H	Data Out	tput Z MS	B Register	ZOUT[15	5:8]			

#### 9.2.2 **Status Register**

There is one status register located in address 09H.

Register 09H has two bits indicating for status flags, the rest are reserved for factory use. The status registers are read only bits.

Table 16 Status Register 1

	Otatao							
Addr.	7	6	5	4	3	2	1	0
09H							OVFL	DRDY

Data Ready Register (DRDY), it is set when all three-axis data is ready and loaded to the output data registers in each mode. It is reset to "0" by reading the status register through I2C commands

The information contained herein is the exclusive property of QST, and shall not be distributed,
reproduced, or disclosed in whole or in part without prior written permission of OST.



Rev: A

DRDY: "0": no new data, "1": new data is ready

OVFL bit set high when either axis code output exceeds the range of [-30000,30000] LSB and reset to "0" after this bit is read.

OVFL: "0": no data overflow occurs. "1": data overflow occurs

#### 9.2.3 **Control Registers**

Two 8-bits registers are used to control the device configurations.

Control register 1 is located in address 0AH, it sets the operational modes (MODE) and over sampling rate (OSR). Control register 2 is located in address 0BH. It controls soft reset, self-test and set/reset mode.

Two bits of MODE registers can transfer mode of operations in the device, the four modes are Suspend Mode, Normal mode, Single Mode and Continuous Mode. The default mode after Power-On-Reset (POR) is Suspend Mode, Suspend Mode should be added in the middle of mode shifting between Continuous Mode, Single Mode and Normal Mode.

The Output data rate is controlled by ODR registers. Four data update frequencies can be selected: 10Hz, 50Hz, 100Hz or 200Hz.

Over sample Rate (OSR1) registers are used to control bandwidth of an internal digital filter. Larger OSR value leads to smaller filter bandwidth, less in-band noise and higher power consumption. It could be used to reach a good balance between noise and power. Four over sample ratios can be selected, 8,4,2 or 1.

Another filter is added for better noise performance; the depth can be adjusted through OSR2.

Table 17. Control Register 1

Addr	7	6	5	4		3	2	1		0
0AH	OSR2	2<1:0>	OSR1<1	:0>		ODR<	:1:0>	MOI	DE<1	:0>
Reg.	Definition	n	00		01		10		11	
Mode	Mode Co	ontrol	Suspend	t	Nor	mal	Single		Continuous	
					Mode				Mod	de
ODR	Output Data		10Hz		50H	lz	100Hz		200	Hz
	Rate									
OSR1	Over	sample	8		4		2		1	
	Ratio1									
OSR2	Down sampling		1		2		4		8	
	rate									

Set/Reset Mode can be control by the register SET/RESET MODE. There are 3 modes for selection: SET AND RESET ON, SET ONLY ON and SET AND RESET OFF. In SET ONLY ON or SET AND RESET OFF mode, the offset is not renewed during measuring.

Field ranges of the magnetic sensor can be selected through the register RNG. The full-scale range is determined by the application environments. The lowest field range has the highest sensitivity, therefore, higher resolution.

Self-test function is added for verification of the signal-chain. When the function is enabled through the bit SELF TEST, an inner-built current is generated and an additional signal is added to the sensor, generating a difference in the 3 axis' value. User should record the value before and after the self-test and compare with threshold value.

Soft Reset can be done by changing the register SOFT\_RST. Soft reset can be invoked at any time of any mode.

Table 18. Control Register 2

Addr.	7	6	5	4	3	2	1	0
0BH	SOFT_RST	SELF_TEST	-	•	RNG<1:0>		SET/RESE	1

The information contained herein is the exclusive property of QST, and shall not be distributed, reproduced, or disclosed in whole or in part without prior written permission of QST.

16 / 18



				MODE<1:0>	
Reg.	Definition	00	01	10	11
SET/RESET	Set and reset mode	Set and reset	Set only on	Set and reset	Set and reset
MODE	ctrl	on		off	off
RNG	Full Range	30Guass	12Guass	8Guass	2Guass
SELF_TEST	Self_test	1: self_test enable, auto clear after the data is updated			
SOFT_RST	Soft reset	1: Soft reset, restore default value of all registers, 0: no reset			

Rev: A



ORDERING INFORMATION

Ordering Number	Operating Temperature	Package	Packaging
QMC6310U-TR	-40°C ~ 85°C	LGA8	Tape and Reel: 5k pieces/reel
QMC6310N-TR	-40°C ~ 85°C	LGA8	Tape and Reel: 5k pieces/reel



# Caution

This part is sensitive to damage by electrostatic discharge. Use ESD precautionary procedures when touching, removing or inserting.

**CAUTION: ESDS CAT. 1B** 

# **FIND OUT MORE**

For more information on QST's Magnetic Sensors contact us at 86-21-69517300.

The application circuits herein constitute typical usage and interface of QST product. QST does not provide warranty or assume liability of customer-designed circuits derived from this description or depiction.

QST reserves the right to make changes to improve reliability, function or design. QST does not assume any liability arising out of the application or use of any product or circuit described herein; neither does it convey any license under its patent rights nor the rights of others.

U.S. Patents 4,441,072, 4,533,872, 4,569,742, 4,681,812, 4,847,584 and 6,529,114 apply to the technology described.

China Patents 201210563667.3, 201210563956.3, 201210563952.5, 201210563687.0, 201310403912.9, 201410027189.3, 201410027240.0, 201410027085.2 and 201410085278.3 apply to the technology described.

The information contained herein is the exclusive property of QST, and shall not be distributed, reproduced, or disclosed in whole or in part without prior written permission of QST.

18 / 18

Rev: A