

Form 1 : Part Number Accountability

Rev. Date: 15 FEB 16



초도품 검사 기록서 (AS 9102)

First Article Inspection Report (AS 9102)

Attachment #1 for Form 1

Drawing Revision Status

FAI Part Number: F573 52689 001 00

FAI Report Number: QPI39022

Eng Doc. No.	SHT No. / Data Type	Rev. No.	ECN No.	Eff. From	Eff. To
F57352689	ECN	B ✓		K0001	K9999
F57352689	01	B ✓		K0001	K9999
F57352689	SCH	B ✓		K0001	K9999
F5735268900100	CATPRODUCT	B ✓		K0001	K9999



28 JUN 2016




28 JUN 2016

초도품 검사 기록서 (AS 9102)
First Article Inspection Report (AS 9102)

AS 9102 Rev B

Form 2 : Product Accountability Raw Material, Specifications and Special Process(s), Functional Testing

1. Part Number F573 52689 001 00	2. Part Name SPIGOT FWD ASSY SHRK	3. Serial Number K0001	4. FAIR Number QPI39022		
5. Material or Process Name	6. Specification Number	7. Code	8. Supplier	9. Customer Approval Verification	10. Certificate of Conformance Number
Identification & Marking of Aircraft Items Design Rules and Process Codes	ABD0003	N/A	NDT ENG, CHANG WON, KOREA	N/A	N/A
Installation of Bushes Shrink and press fit	AIPI 01-02-019	N/A	NDT ENG, CHANG WON, KOREA	YES	W/O: 16919079
MACHINING METALS BY MECHANICAL ACTION	AIPI 03-11-001	N/A	NDT ENG, CHANG WON, KOREA	YES	W/O: 16919079
SEALING OF AIRCRAFT STRUCTURE	AIPI 05-05-001	N/A	NDT ENG, CHANG WON, KOREA	YES	W/O: 16919079
Permanent marking with ink	AIPI 08-03-002	N/A	NDT ENG, CHANG WON, KOREA	YES	W/O: 16919079
Cleaning with Liquid non Aqueous Agents	AIPI 09-01-002	N/A	NDT ENG, CHANG WON, KOREA	YES	W/O: 16919079
11. Functional Test Procedure Number		12. Acceptance report number, if applicable			
13. Comments N/A					
14. Signature G.R.PARK		  		15. Date 2 8 JUN 2016	
				2 8 JUN 2016	



초도품 검사 기록서 (AS 9102)
First Article Inspection Report (AS 9102)


Sheet 1 of 2

AS 9102 Rev B

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) F573 52689 001 00 (Balloon Drawing F573 52689_B)				2. Part Name SPIGOT FWD ASSY SHRK		3. Serial Number K0001	4. FAIR Number QPI39022
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed/Qualified Tooling	11. Nonconformance Number	14. Additional data/Comments
(1)	1H1[Page:1]	Hole.	Ø31.940 / Ø31.965	Ø31.950			
(2)	1H2[Page:1]	Geometrical Tolerance.	PERP / 0.1 M A	ACCEPT	CMM Program: F573-52697-000_M_1.DMS REV:00		See Attached CMM Record Page 2~3 : PERP 1
(3)	1G2[Page:1]	Roughness.	RA 1.6	MAX RA 1.42			
(4)	1L3[Page:1]	Dimension.	(0.5)	0.05			
(5)	1Q9[Page:2]	Dimension.	26.0 ±0.5	26.10			
(6)	1P7[Page:2]	KC Number.	[ACTI-29-00-0307> SPIGOT AFT PIN SHRK POSITIONAL TOLERANCE	ACCEPT			
(7)	1R20[Page:4]	DWG Note.	FOR ALL GEMOTRIC SIZING REFER TO SOLID MODEL IS MASTER DATA. ALL DIMENSIONS STATED ARE DERIVED FROM THE MODEL AND ARE FOR INSPECTION PURPOSES ONLY. (GENERAL TOLERANCES STILL APPLY).	ACCEPT			
(8)	1Q21[Page:4]	Flag Note.	INSTALLATION OF BUSHES, PINS, BEARING HOUSINGS AND SHAFTS SHRINK AND PRESS FIT, ACCORDING TO IAPS 01-02-019 METHOD B.	ACCEPT			
(9)	1Q20[Page:4]	DWG Note.	PERMANENT MARKING WITH INK TO AIPS 08- 03-002.	ACCEPT			
(10)	1P22[Page:4]	DWG Note.	REWORK OF PAINTS ON METALLIC AND NON- METALLIC STRUCTURAL PARTS TO AIPS 05- 02-011.	ACCEPT			
(11)	1P22[Page:4]	Flag Note.	BUSH ITEM 152 MUST NOT PROTRUDE BEYOND FACE OF SPIGOT FITTING ITEM 150/151, AFTER INSTALLATION.	ACCEPT			


Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) F573 52689 001 00 (Balloon Drawing F573 52689_B)				2. Part Name SPIGOT FWD ASSY SHRK		3. Serial Number K0001	4. FAIR Number QPI39022
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed/Qualified Tooling	11. Nonconformance Number	14. Additional data/Comments
(12)	1N19[Page:4]	DWG Note.	APPLY PROTECTIVE TREATMENT TN.A.007.1003-FA010 TO ALL MATING FACES ONLY, ALL NON-MATING FACES MUST BE LEFT FREE FROM TREATMENT.	ACCEPT			
(13)	1N22[Page:4]	Flag Note.	AREA SHOWN TO BE LEFT COMPLETELY FREE OF SEALANT, AREA TO BE SEALED AT SUBSEQUENT ASSEMBLY OPERATION.	ACCEPT			
(14)	1M20[Page:4]	Flag Note.	POST BUSH INSTALLATION, MACHINE BORE IN ACCORDANCE WITH AIPS 03-11-001 OR PRECISION GRINDING TO AIPS 03-11-002.	ACCEPT			
(15)	1M17[Page:4]	DWG Note.	DEBURRING AND MANUAL REWORK OF METALLIC COMPONENTS ACCORDING TO AIPS 03-11-003.	ACCEPT			
(16)	1R20[Page:4]	DWG Spec.	FOR ALL GEOMETRIC SIZING REFER TO SOLID MODEL IS MASTER DATA.	ACCEPT			
(17)	1B4[Page:1]	DWG Spec.	LIMITS NOT STATED: ABD0001-3	ACCEPT			
(18)	1B3[Page:1]	DWG Spec.	SURFACE FINISH: ABD0002	ACCEPT			
(19)	1B4[Page:1]	DWG Spec.	IDENTIFICATION MARKING: ABD0003	ACCEPT			
(20)	1B2[Page:1]	DWG Spec.	INTERCHANGEABLE PART: NO	ACCEPT			
12. Signature G.R.PARK   					13. Date 28 JUN 2016 28 JUN 2016		


SCALE 2:1

F57352689_A SHEET 01 Page 1 of 4

QPI39022 Attachment

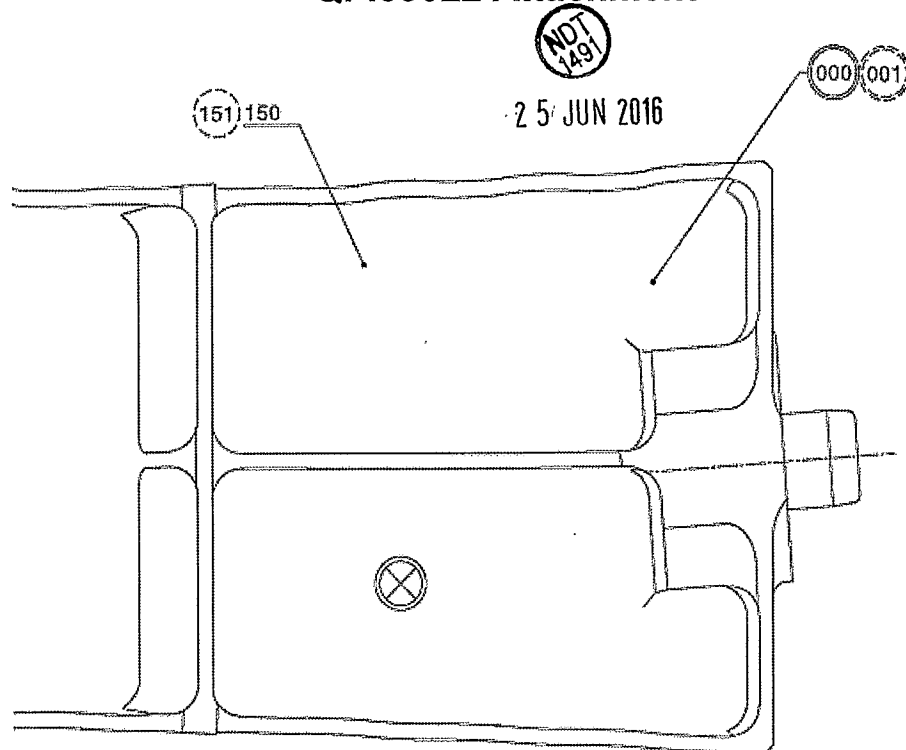

VIEW ON SPIGOT FWD ASSY SHRK
NG FORWARD ON EFFECT OF COORDINATE AXIS (ASSEMBLY) XZ PLANE

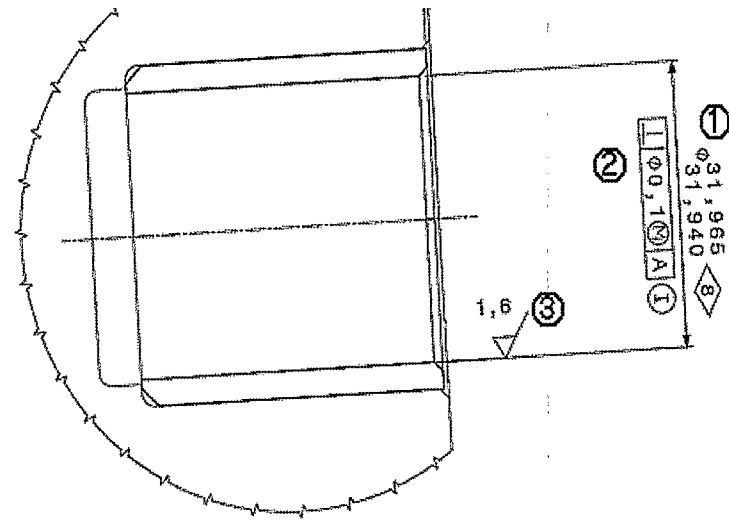

DETAIL B
NOT TO SCALE
FN SPIGOT FWD OMITTED FOR CLARITY

COMPONENT OF ICY PART

ALL DIMENSIONS IN MILLIMETRES
UNLESS OTHERWISE STATED



COMPUTER PRODUCED DRAWING USING CATIA V5. NO MANUAL ALTERATION
© AIRBUS OPERATIONS LTD (2016). All rights reserved. Confidential and proprietary document.
This document and all information contained herein is the sole property of AIRBUS
OPERATIONS LTD. No intellectual property rights are granted by the delivery of this
document or the disclosure of its content. This document shall not be reproduced or
transmitted in any form or by any means, electronic, mechanical, photocopying, recording,
or by any information storage or retrieval system, without the express written consent of AIRBUS OPERATIONS LTD.
This document and its content shall not be used for any purpose other than that for which
it is supplied. The statements made herein do not constitute an offer. They are based on
the mentioned assumptions and are expressed in good faith. Where the supporting grounds
for these statements are not shown, AIRBUS OPERATIONS LTD will be pleased to explain
the basis thereof.

TABLE 1


HOLE CODE TABLE	
CODING	DESCRIPTION
*	REF HOLE

16 LIMITS NOT STATED AB00001-3	17 SURFACE FINISH AB00002	AIRBUS
18 IDENTIFICATION MARKINGS AB00003	19 INTERCHANGEABLE PART DRAWING NO. 19	SCALE 1:1
DRN SEE ECV	CHKD SEE ECV	SYSTEM SEE ECV
D.O. ORIGIN 00	APPD SEE ECV	PROCESS SEE ECV
TITLE SPIGOT FWD ASSY SHRK		FIRST ANGLE PROJECTION
		SIZE A0
		F57352689
		SHEET 01



14 13 12 11 10 9 8 7 6 5 4 3 2 1

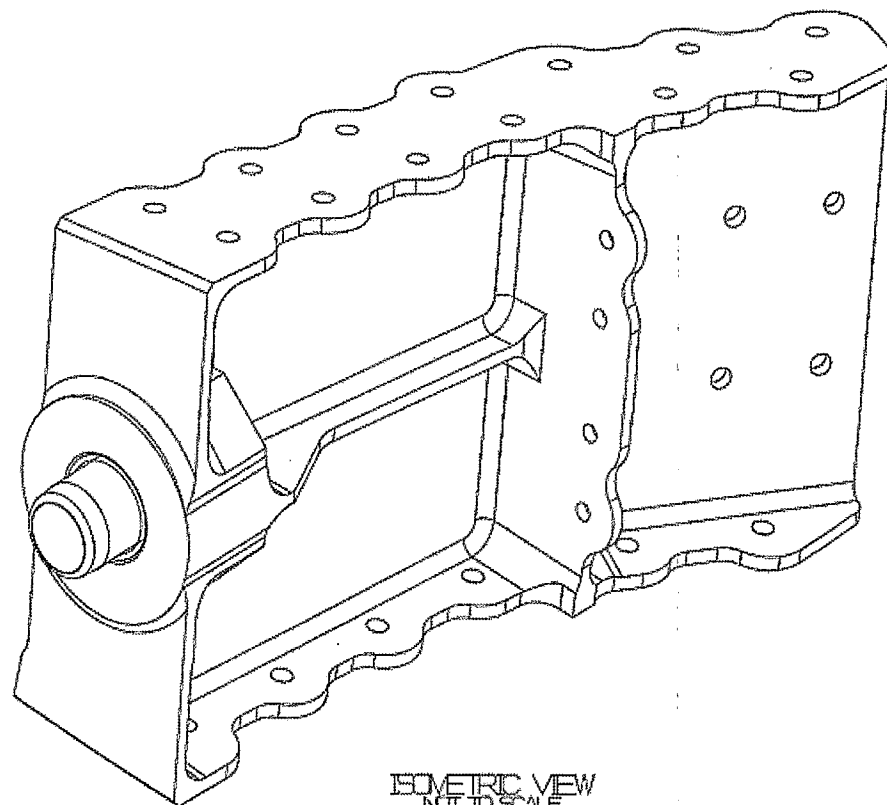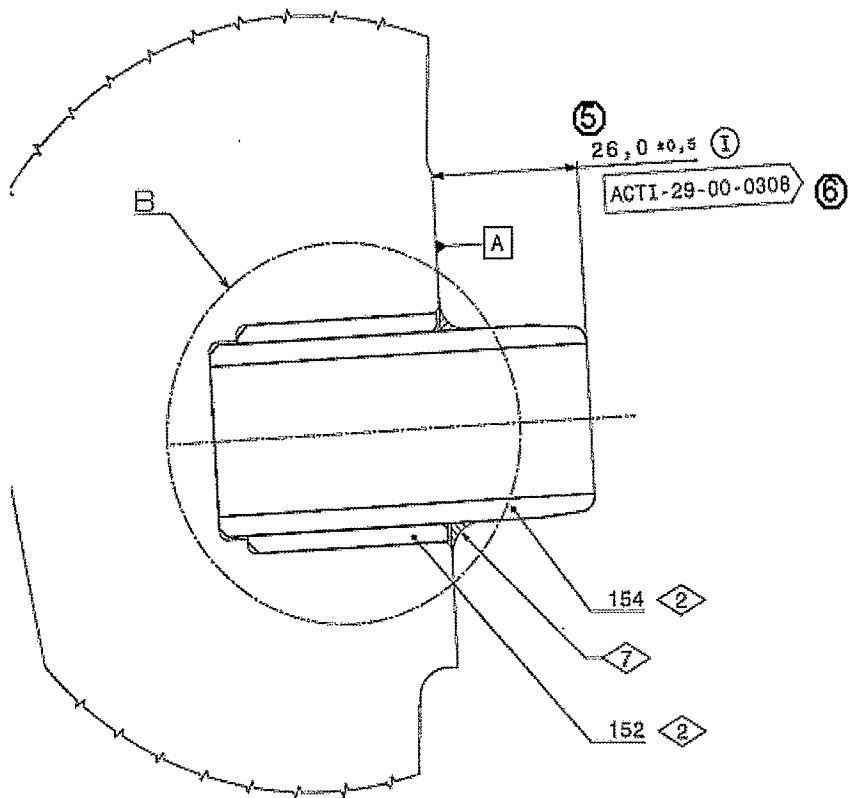

F57352689_A SHEET 01 Page 2 of 4

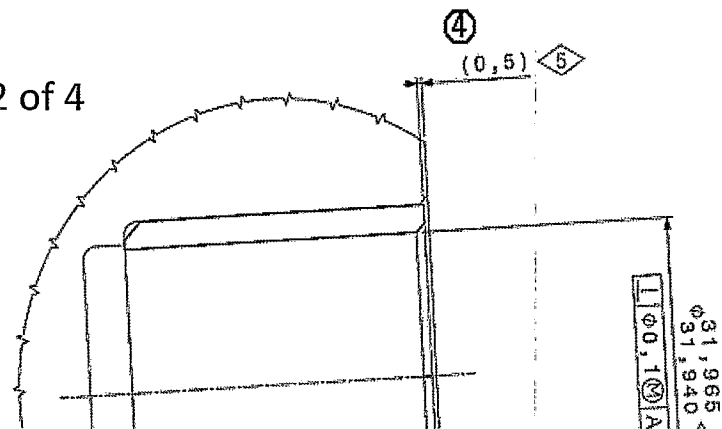

F57352689_A SHEET 01 Page 3 of 4

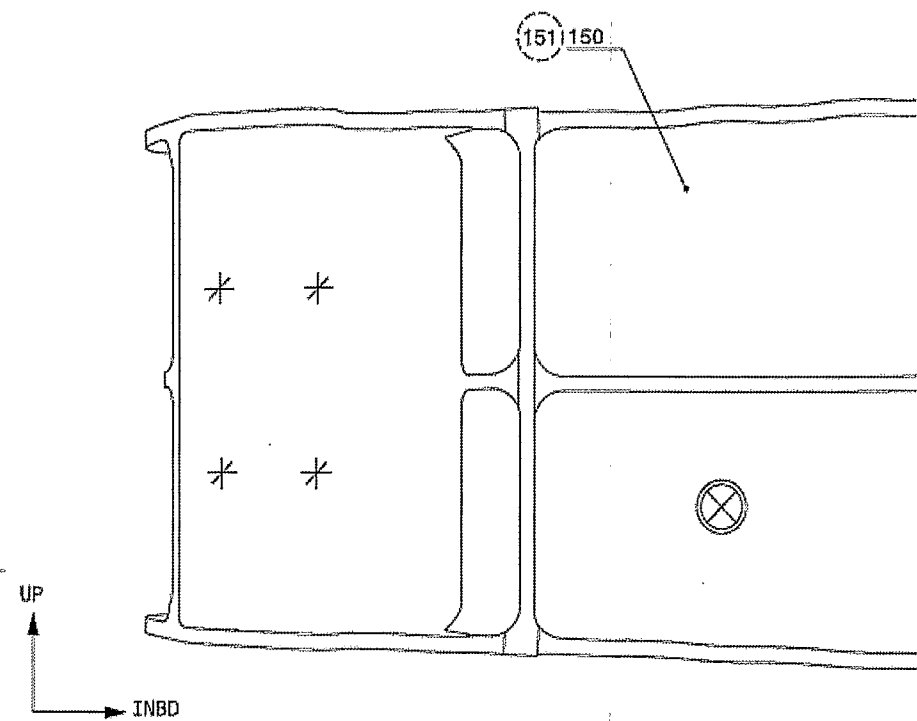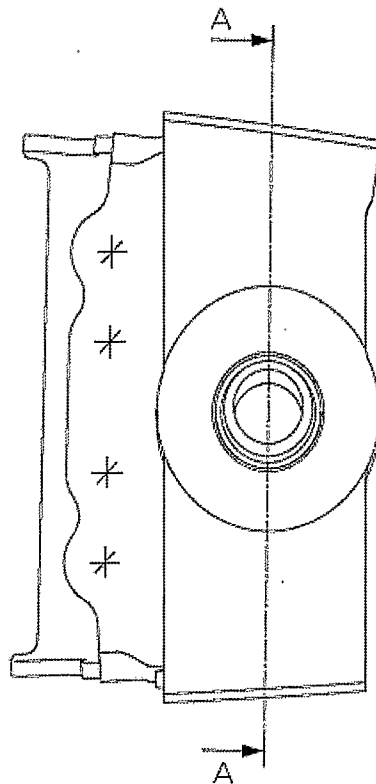

VIEW ON SPIGOT FWD ASSY SHRK
VIEW LOOKING FORWARD ON F57352689A WINGLET AXIS (ASSIGNED) XZ I


TABLE 2

KEY CHARACTERISTICS		
KC NUMBER	KC NAME	KC TOLERANCE
ACTI-29-00-0308	FWD SPIGOT PIN SHRK POSITIONAL TOLERANCE	SEE DRG LOCN 01P10

NOTES:

1. FOR ALL GEOMETRIC SIZING THE CATIA SOLID MODEL IS THE MASTER DATA.
ALL DIMENSIONS STATED ARE DERIVED FROM THE MODEL AND ARE FOR INSPECTION PURPOSES ONLY. (GENERAL TOLERANCES STILL APPLY). (7)
2. INSTALLATION OF BUSHES, PINS, BEARING HOUSINGS AND SHAFTS SHRINK AND PRESS FIT, ACCORDING TO AIPS 01-02-019 METHOD B. (8)
3. PERMANENT MARKING WITH INK TO AIPS 08-03-002. (9)
4. REWORK OF PAINTS ON METALLIC AND NON-METALLIC STRUCTURAL PARTS TO AIPS 05-02-011. (10)
5. BUSH ITEM 152 MUST NOT PROTRUDE BEYOND FACE OF SPIGOT FITTING ITEM 150/151, AFTER INSTALLATION. (11)
6. APPLY PROTECTIVE TREATMENT TN.A.007.10003-FA010 TO ALL MATING FACES ONLY, ALL NON-MATING FACES MUST BE LEFT FREE FROM TREATMENT. (12)
7. AREA SHOWN TO BE LEFT COMPLETELY FREE OF SEALANT, AREA TO BE SEALED AT SUBSEQUENT ASSEMBLY OPERATION. (13)
8. POST BUSH INSTALLATION, MACHINE BORE IN ACCORDANCE WITH AIPS 03-11-001 OR PRECISION GRINDING TO AIPS 03-11-002. (14)
9. DEBURRING AND MANUAL REWORK OF METALLIC COMPONENTS ACCORDING TO AIPS 03-11-003. (15)

F57352689_A SHEET 01 Page 4 of 4

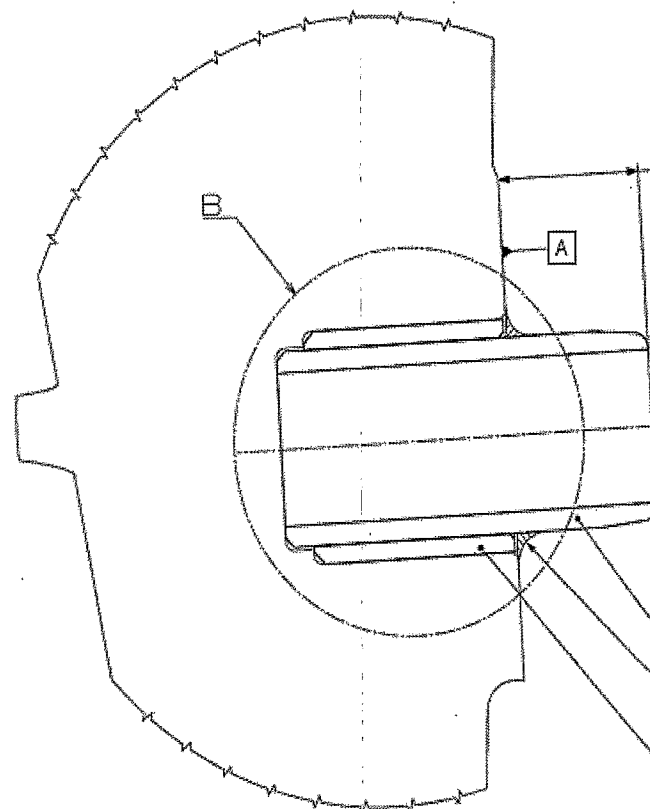

SECTION A-A
SCALE 2:1



HEXAGON METROLOGY

Op239022 Attachment A

NDT
0488

25 JUN 2016

DATE=2016-06-25
PART NAME : F573 52689 001 00
REV NUMBER : B
SER NUMBER : 16919077
STATS COUNT : 1

TIME=오후 4:58:31

1CMT A330 NEO Sharklet F573 52689 001 00 SPIGOT FWD SHLW ASSY CMM PROGRAM
PROG.NAME = F573-52689-001_M_1.DMS
PROG.REV. = 00
MBD(DWG).NO. = F5735268900000
MBD(DWG).REV. = B(B)
PART.NO. = F573 52689 001 00
SOURCE = F5735268900100.CATPart

===== START OF MANUAL PROGRAM MEASURING =====

INSP OF TARGET POINTS

DATUM_B_TARGET_POI - (B1-B3)

DIM LOC1= LOCATION OF POINT B1 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-76.0016	-76.0000	0.1270	0.1270	-0.0016	0.0000 #----
Y	22.9779	23.0000	0.1270	0.1270	-0.0221	0.0000 #----
Z	-0.0321	0.0000	0.1270	0.1270	-0.0321	0.0000 #----

DIM LOC2= LOCATION OF POINT B2 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-30.0144	-30.0000	0.1270	0.1270	-0.0144	0.0000 #----
Y	189.9766	190.0000	0.1270	0.1270	-0.0234	0.0000 #----
Z	0.0911	0.0000	0.1270	0.1270	0.0911	0.0000 #----

DIM LOC3= LOCATION OF POINT B3 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	67.9815	68.0000	0.1270	0.1270	-0.0185	0.0000 #----
Y	69.9994	70.0000	0.1270	0.1270	-0.0006	0.0000 #----
Z	0.0402	0.0000	0.1270	0.1270	0.0402	0.0000 #----

INSP OF TARGET POINTS

DATUM_A_TARGET_POI - (A1-A2)

DIM LOC4= LOCATION OF POINT A1 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	24.5141	24.4936	0.1270	0.1270	0.0205	0.0000 #----
Y	0.0022	0.0000	0.1270	0.1270	0.0022	0.0000 #----
Z	0.0253	0.0000	0.1270	0.1270	0.0253	0.0000 #----

DIM LOC5= LOCATION OF POINT A2 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-22.4373	-22.4558	0.1270	0.1270	0.0185	0.0000 #----
Y	0.0589	0.0000	0.1270	0.1270	0.0589	0.0000 #----
Z	0.0217	0.0000	0.1270	0.1270	0.0217	0.0000 #----

INSP OF TARGET POINTS

DATUM_C_TARGET_POI - (C1)

DIM LOC6= LOCATION OF CIRCLE C1 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0016	0.0000	0.1270	0.1270	-0.0016	0.0000 #----
Y	0.9881	0.9941	0.1270	0.1270	-0.0060	0.0000 #----

PART NUMBER=F573 52689 001 00 DATE=2016-06-25 TIME=오후 4:58:31
Z -0.2203 -0.1249 0.1270 0.1270 -0.0954 0.0000 #-----

PAGE#-2

INSP OF DATUM_B PLANE ANGLRTY(ANG/0.2 A)(PNT001-PNT004)

DIM LOC7= LOCATION OF POINT PNT001 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0203	0.0000	0.1000	0.1000	0.0203	0.0000 #----
Y	1.9357	1.9293	0.1000	0.1000	0.0063	0.0000 #----
Z	30.8615	30.8426	0.1000	0.1000	0.0189	0.0000 #----
T	-0.0051	0.0000	0.1000	0.1000	-0.0051	0.0000 #----

DIM LOC8= LOCATION OF POINT PNT002 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-32.3593	-32.3814	0.1000	0.1000	0.0221	0.0000 #----
Y	0.0609	0.0000	0.1000	0.1000	0.0609	0.0000 #----
Z	0.0152	0.0000	0.1000	0.1000	0.0152	0.0000 #----
T	-0.0598	0.0000	0.1000	0.1000	-0.0598	0.0000 #----

DIM LOC9= LOCATION OF POINT PNT003 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0126	0.0000	0.1000	0.1000	0.0125	0.0000 #----
Y	-1.8665	-1.9048	0.1000	0.1000	0.0384	0.0000 #----
Z	-30.4329	-30.4509	0.1000	0.1000	0.0179	0.0000 #----
T	-0.0372	0.0000	0.1000	0.1000	-0.0372	0.0000 #----

DIM LOC10= LOCATION OF POINT PNT004 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	31.2595	31.2476	0.1000	0.1000	0.0119	0.0000 #----
Y	-0.0126	0.0000	0.1000	0.1000	-0.0126	0.0000 #----
Z	0.0193	0.0000	0.1000	0.1000	0.0193	0.0000 #----
T	0.0138	0.0000	0.1000	0.1000	0.0138	0.0000 #----

DIM ANGLRTY1= ANGULARITY FROM PLANE PNT001-004 TO PLANE DATUM_B ANG=86.4206 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
M	0.0320	0.0000	0.2000	0.0000	0.0320	0.0000 #-----

INSP OF DATUM_C Ø31.940 TRUE POSITION(TRUP/Ø0.2 B) / PERPENDICULARITY(PER/Ø0.1 A) (DWG.ZONE 1F3)(C1-C1-1) 1F3)(C1-C1-1)

DIM LOC11= LOCATION OF CIRCLE C1 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0016	0.0000	0.1000	0.1000	-0.0016	0.0000 #----
Y	0.9881	0.9941	0.1000	0.1000	-0.0060	0.0000 #----
Z	-0.2203	-0.1249	0.1000	0.1000	-0.0954	0.0000 #-----

DIM LOC12= TRUE POSITION OF CIRCLE C1 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	BONUS	DEV	OUTTOL
X	-0.0016	0.0000				-0.0016	
Y	0.9881	0.9941				-0.0060	
Z	-0.2203	-0.1249				-0.0954	
DF	31.9523	31.9400	0.0250	0.0000		0.0123	0.0000 #----
TP		RFS	0.2000		0.0000	0.1911	0.0000 #-----

DIM LOC13= LOCATION OF CIRCLE C1-1 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0027	0.0000	0.1000	0.1000	0.0027	0.0000 #----
Y	36.4197	36.4249	0.1000	0.1000	-0.0052	0.0000 #----
Z	-2.4237	-2.3412	0.1000	0.1000	-0.0825	0.0000 #-----

DIM LOC14= TRUE POSITION OF CIRCLE C1-1 UNITS=MM

AX	MEAS	NOMINAL	+TOL	-TOL	BONUS	DEV	OUTTOL
X	0.0027	0.0000				0.0027	
Y	36.4197	36.4249				-0.0052	
Z	-2.4237	-2.3412				-0.0825	
DF	31.9438	31.9400	0.0250	0.0000		0.0038	0.0000 #----
TP		RFS	0.2000		0.0000	0.1654	0.0000 #-----

DIM PERP1= PERPENDICULARITY OF LINE C1_C1-1,RFS TO PLANE DATUM_A,RFS EXTENDLENGTH=0.0000 UNITS

PART NUMBER=F573 52689 001 00 DATE=2016-06-25 TIME=오후 4:58:31 PAGE#=3

=MM=MM

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
M	0.0338	0.0000	0.1000	0.0000	0.0338	0.0000 --#----(2)

=====> END OF AUTO PROGRAM MEASURING <=====

END OF MEASUREMENT FOR

PN=F573 52689 001 00 DRG=B SN=16919077
TOTAL # OF MEAS =46 # OUT OF TOL =0 # OF HOURS =00:05:02