
DRAWING LIST

ITEM	QTY	DRAWING NUMBER	DESCRIPTION
1	1	S1101MFD1538	TFP ARRAY BRACKET
2	1	S1101MFA1539	TFP ARRAY COVER ASSEMBLY
3	1	S1101MFT1537-01	ID LABEL
4	1	S1101MFT1537-XX	PART AND SERIAL NUMBER LABEL

COMMERCIAL PARTS LIST


ITEM	QTY	PART NUMBER	DESCRIPTION
C1	2	MS9390-090	PIN, STRAIGHT, HEADLESS, DOWEL, CRES STANDARD, .09375 X .375LG
C2	1	MS51830CA102	MINIATURE INSERT FOR .112-40 UNJC-3A IN. FASTENER
C3	A/R	1838 B/A GREEN	3M SCOTCH WELD EPOXY ADHESIVE
C4	A/R	CG NICALON	14 MICROMETER SILICON-CARBIDE-OXYGEN FIBER, COI CERAMICS
C5	A/R	49550	LOCTITE 495 SUPER BONDER INSTANT ADHESIVE

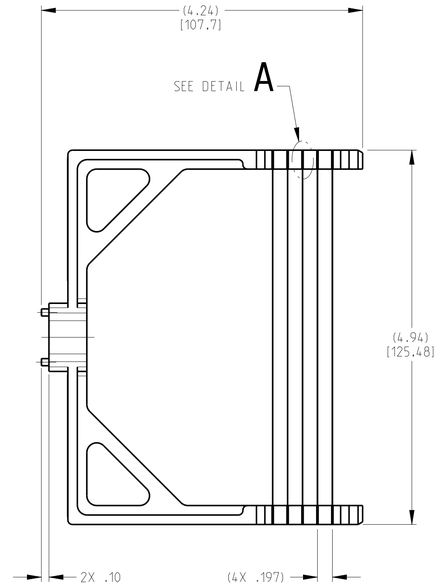


NOTE: TFP ARRAY COVER ASSEMBLY
NOT SHOWN FOR CLARITY


NOTES:

1. MATERIAL AND PROCESS CERTIFICATION REQUIRED PER QUALITY LEVEL SPECIFIED IN WORK ORDER/SOW.
2. ASSEMBLE PER APPROVED PROCESS PLAN FOR INITIAL BUILD.
3. INSTALL THREADED INSERTS PER MS51835. VERIFY INSERT IS BELOW SURFACE BEFORE SETTING KEYS.
4. FIBER ATTACHMENT PROCEDURE (5X):
   A. REMOVE A SINGLE FIBER FROM ITEM C4. LAY FIBER IN POSTION.
   B. APPLY ADHESIVE ITEM C5 INTO FIRST FIBER GROOVE & LET CURE.
   C. APPLY .1±.02 GRAM TENSILE LOAD ON OPPOSITE END OF FIBER AND SET INTO GROOVE. APPLY ADHESIVE ITEM C5.
   D. LET CURE FOR 5 MINUTES MINIMUM. REMOVE LOAD AND TRIM FIBER TO LENGTH.
   E. APPLY EPOXY ITEM C3 TO COVER GROOVE AND FIBER CONTACT AREAS.
5. CHEMICAL CONVERSION COAT ANY DAMAGED OR MACHINED AREAS ON ALUMINUM PARTS PER MIL-DTL-5541, TYPE I, CLASS 3 (GOLD COLOR).
6. CLEAN ALL SURFACES WITH ISOPROPYL ALCOHOL AND LET AIR DRY. WIPE WITH CLEAN COTTON SWABS AND/OR LINT-FREE CLOTH.
7. HANDLE WITH CLEAN, LINT-FREE GLOVES.
8. BEFORE STORAGE, PROTECT WITH CONTAMINATION BARRIER. USE CLEAN, NEW, TRANSPARENT POLYETHYLENE BAG FOR SMALL ITEMS OR 4 MIL THICK MINIMUM POLYETHYLENE SHEET AND SEAL. MARK PART NUMBER, A DASH, AND A SERIAL/LOT NUMBER AS SPECIFIED IN WORK ORDER/SOW, BY TAGGING PER SAE-AS478-35D.
9. APPLY LABEL TO CLEAN, DRY SURFACE IN LOCATION SHOWN.

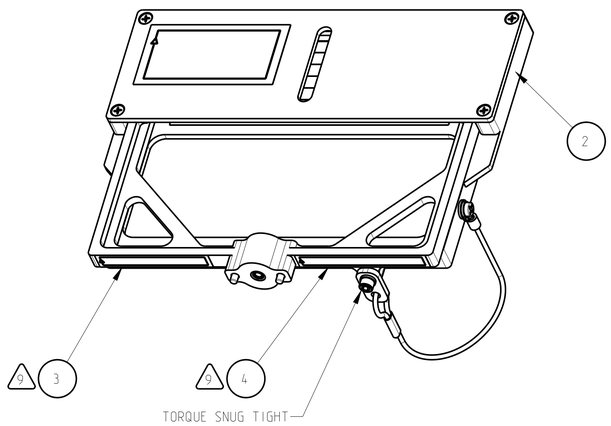

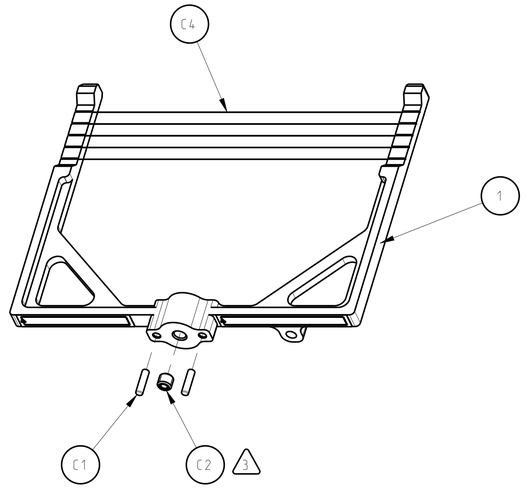

NOTE: TFP ARRAY COVER ASSEMBLY
NOT SHOWN FOR CLARITY

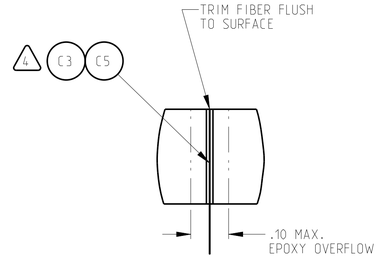

10X DETAIL A
SCALE 5/1

REV	DESCRIPTION	APPROVED
B	INCORPORATED ACME-ECO-514.	AK 11/07/16 LF 11/07/16 AD 11/07/16
A	INCORPORATED ACME-ECO-263	GF 01/30/14 KR 01/30/14 AD 01/30/14

REVISION HISTORY

S1101MFA0003			
NEXT ASSEMBLY			
UNLESS OTHERWISE SPECIFIED: 1. ALL DIMENSIONS ARE IN INCHES 2. BREAK EDGES .010-.020 3. INSIDE CORNERS R.02 MAX 4. LINEAR TOLERANCES: .X ± .03 .XX ± .01 .XXX ± .005 5. ANGULAR TOLERANCE ± .5°	THIS DRAWING IS UNDER CONFIGURATION CONTROL: DO NOT REVISE WITHOUT AN APPROVED ECO.		
	APPROVED:		
	PRIOR TO USE, CHECK WITH CONFIGURATION MANAGEMENT FOR ANY OUTSTANDING ECOS.		
	DESIGNER G.FEDEVICH 02/11/13	QUALITY D.SEELEY 02/14/13	
	REVIEWER I.FLOOR 02/12/13	MATERIALS M.WILKINSON 02/11/13	
	MECHANICAL A.DRAKE 02/11/13	PROJ LEAD B.BORDWSKI 02/21/13	
	ELECTRICAL T.GOBELI 02/19/13		
THIRD ANGLE PROJECTION	STRUCTURAL C.WERNER 02/20/13		
	SAFETY M.BORRELLI 02/11/13		
	DIMENSIONS AND TOLERANCING PER ASME Y14.5M-1994	CONTRACT NUMBER: NNC09BA02B PROJECT CODE: SPACE110	

ZIN TECHNOLOGIES
6745 ENGLE ROAD
AIRPORT EXECUTIVE PARK
CLEVELAND, OHIO 44130
(440) 625-2200
www.zin-tech.com

NATIONAL AERONAUTICS AND SPACE ADMINISTRATION
JOHN H. GLENN RESEARCH CENTER
LEWIS FIELD
CLEVELAND, OHIO

TITLE: TFP ARRAY ASSEMBLY

SIZE	CAGE CODE	DWG NO	REV
D	0SG68	S1101MFA1537	B

SCALE 1/1 & NOTED | INITIAL REL DATE 02/21/2013 | SHEET 1 OF 1

RELEASE LEVEL: RELEASED
MODEL: S1101MFA1537

PRO/E VERSION: Wildfire 5.0

REV B | SH 1 | DWG NO S1101MFA1537

ZIN_D_2012.frm