

Pathway Medtech, LLC.	CAPA Form	CAPA No.:	23-0008
-----------------------	-----------	-----------	---------


PHASE 1 - CAPA INVESTIGATION PLAN			
CAPA Investigation Plan Assigned to:	Jacqueline Kim	CAPA Investigation Plan Target Due Date:	03/28/2025
CAPA Investigation Plan: (Attach any supporting documents. If needed, complete and attach the SCAR Form, FM-0087)	- Review contract/quality agreement for current clients for established equipment traceability responsibilities - Review Equipment List - Audit current MPs and WIs for equipment not listed in equipment list - Audit Equipment - Audit manufacturing area for equipment not listed in equipment list - Audit equipment for labeling - CAL info - PM info - ES ID - Review IQ requirements & IQ records - Review current equipment IQ WI		
Phase 2 Target Due Date:	6/27/2025		
PHASE 1 - APPROVAL SIGNATURES			
CAPA Owner (Name/Title):	Amber O'Brien	Signature/Date:	27 Mar 2025
Executive Management (Name/Title):	Aaron Rogers	Signature/Date:	27 Mar 2025
Quality Assurance (Name/Title):	Larry Dacoron	Signature/Date:	27 Mar 2025
CAPA EXTENSION REQUEST (☒ N/A if not applicable)			
CAPA Extension Due Date:	N/A		
Justification for Extension:	N/A		
CAPA EXTENSION APPROVAL SIGNATURES (☒ N/A if not applicable)			
CAPA Owner (Name/Title):	N/A	Signature/Date:	N/A
Quality Assurance (Name/Title):	N/A	Signature/Date:	N/A

PHASE 2 - CAPA INVESTIGATION RESULTS & ROOT CAUSE ANALYSIS					
CAPA Investigation Results Assigned to:	Amber O'Brien	CAPA Investigation Results Target Due Date:	06/27/2025	CAPA Investigation Results Completion Date:	06/25/2025
CAPA Investigation Results: <i>(Describe the investigation and results that determined what cause (or will cause) the incident/problem to occur. Attach any supporting documents. If needed, complete and attach the SCAR Form, FM-0087)</i>		- Review contract/quality agreement for current clients for established equipment traceability responsibilities - Arga Medtech USA, Inc. - Pathway is responsible for maintenance and calibration of all equipment per QA-ARG-0001 Rev. A Section 7.9 - GuideStar Medical Devices - Pathway is responsible for maintenance and calibration of all equipment per QA-GMD-0001 Rev. A Section 7.2 - Mark 2 Medical - Pathway is responsible for maintenance and calibration of all equipment per QA-M2M-0001 Rev. A Section 7.2 - SILQ Technologies Corp. - Pathway is responsible for maintenance and calibration of all equipment per QA-SLQ-0001 Rev. A Section 7.2 - Adler Micro Medical - Pathway is responsible for maintenance and calibration of all equipment per QA-ADL-0001 Rev. A - SinglePass (Circa Scientific) - Pathway is responsible for maintenance and calibration of all equipment per QA-SPS-0001 Rev. A Section 3.8 - Neurgain Inc - Pathway is responsible for maintenance and calibration of all equipment per QA-NGN-0001 Rev. A Section 7.2 - Review Equipment List - Audit current MPs and WIs for equipment not listed in equipment list - SinglePass - MPs were missing reference to ES for certain equipment (ie. Digital temperature probe, Calipers, Torx drivers) - ES-0201-01 in MP-0015 not in log - ES-SPS-0115 to 117 were not in log - MP-SPS-0001 referenced "ES-SPS-XXXX" - Arga - WI-005, WI-003, WI-004, WI-006 & WI-001 Referenced equipment not in log (600150, 600243, 600282, etc.) - This equipment is currently in IQ to be released - Multiple work instructions reference a traveler for equipment information, but the router does not specify the equipment required (ie. WI-008) - Guidestar – All specified equipment were properly recorded - M2M – Does not specify Equipment - SILQ – All specified equipment were properly recorded - Adler – All specified equipment were properly recorded - Neurgain - MP-NGN-001 referenced equipment without numbers - Convergent – All specified equipment were properly recorded			

PHASE 2 - CAPA INVESTIGATION RESULTS & ROOT CAUSE ANALYSIS

3. Audit Equipment

- a. Audit manufacturing area for equipment not listed in equipment list
 - i. 47 pieces of equipment were discovered to not have any labeling. The equipment was pulled and quarantined
 - ii. 65 pieces of equipment were labeled, but not in the log
- b. Audit equipment for labeling
 - i. 2 pieces of equipment were marked as "Retired" in the log, and did not have "Eng only" labeling
 - ii. 1 piece of equipment was marked as "retired" in the log, and was actively being used

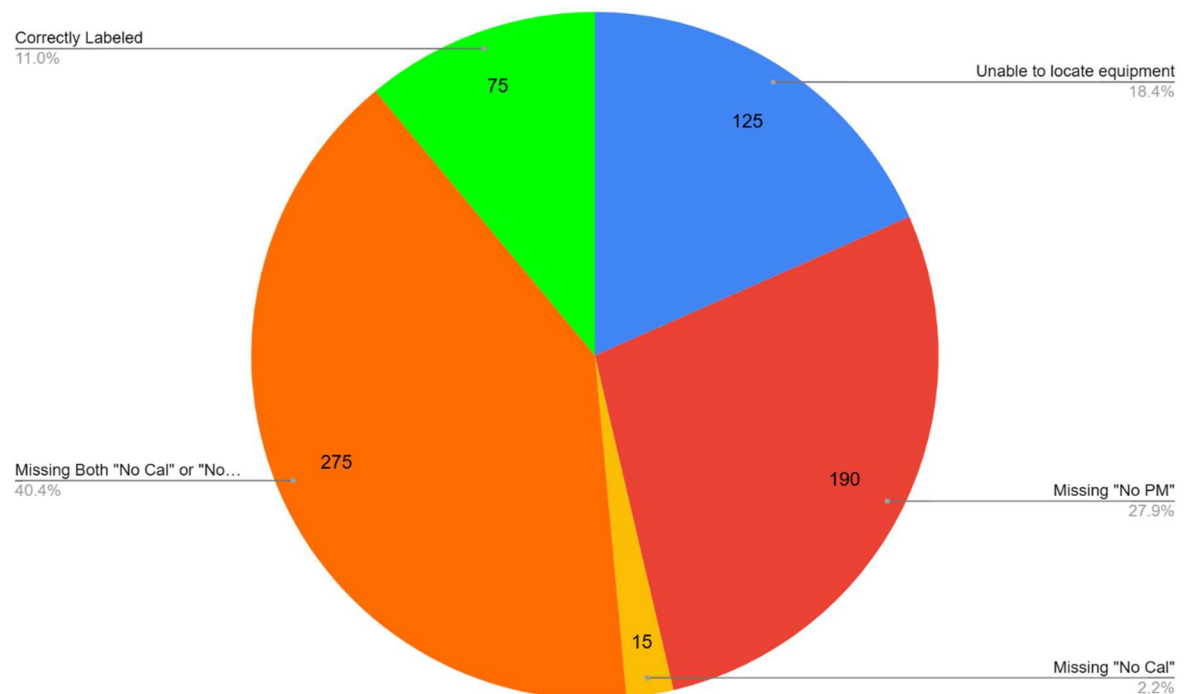
Figure 1: Label assessment of equipment at Pathway Medtech

c. Review IQ requirements & IQ records

- i. Of the approximate 800 pieces of equipment reviewed:

Figure 2: IQ assessment of equipment at Pathway Medtech

PHASE 2 - CAPA INVESTIGATION RESULTS & ROOT CAUSE ANALYSIS

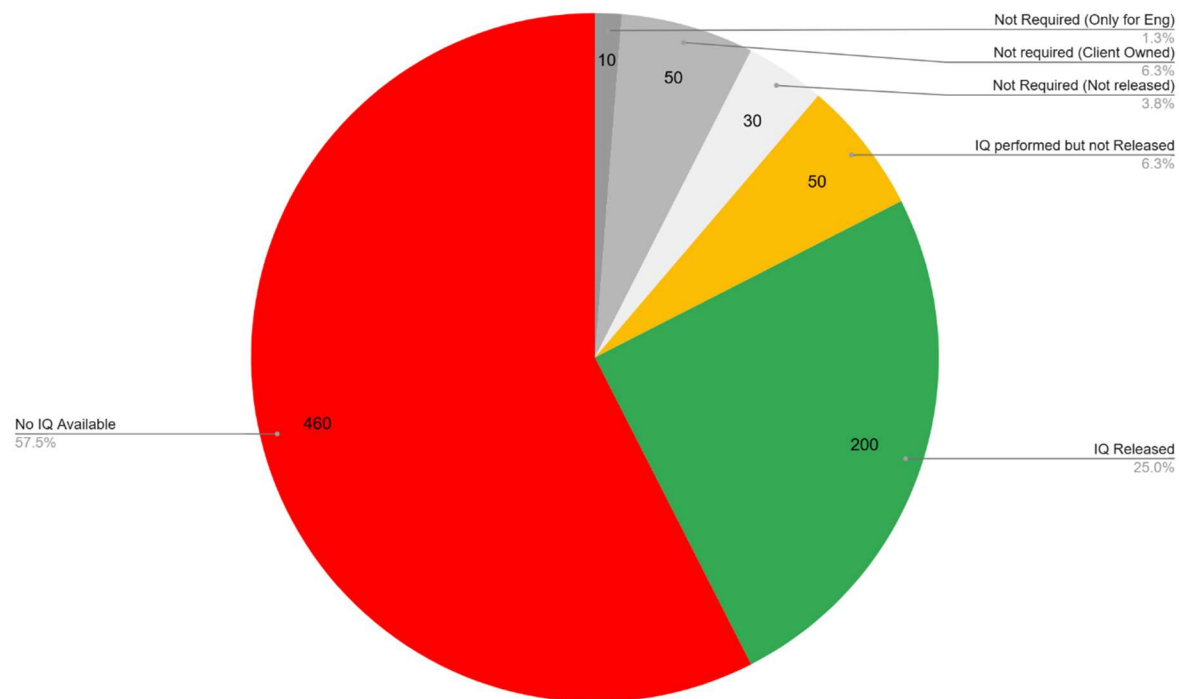

4. Review current equipment IQ WI
 - a. Instructions for IQ are defined in QP-012

Note:

1. Equipment coming from storage is not IQ'd/reviewed
2. Arga controls their own equipment calibration, but Pathway maintains internal records using Arga's calibration certificates

Impact / Risk Assessment: (Determine the impact/risk of the problem/incident or potential problem/incident on the product, processes, systems, documentation, etc. Determine the level of severity and probability of each risk using QP-004, Risk Assessment)

Loss of traceability for equipment may result in the use of non-calibrated equipment for verification testing. The inability to detect failures in verification testing may result in failures in the field. Currently, Pathway produces products that may cause severe patient harms upon failure. The probability of critical failure is low due to redundancies in testing, recording equipment & calibration information, and use of process qualification testing.

Deviations: (Were there any deviations from the Investigation Plan? If yes, provide justification. If no deviations, indicate "N/A")

N/A

Root Cause: (Describe the root cause(s) by performing the following and attaching any supporting documents. Attach any supporting documents. If needed, complete and attach the SCAR Form, FM-0087)

1. Problem: Equipment does not have proper labeling
 - a. Equipment was not labeled with PM/CAL
 - i. IQ does not require PM/CAL labeling if PM/CAL is required
 - ii. Personnel did not follow IQ steps to add "NO PM/NO CAL"

PHASE 2 - CAPA INVESTIGATION RESULTS & ROOT CAUSE ANALYSIS

- Identify the problem - Gather the data - Analyze the problem - Solve the problem Use 5 WHY Analysis, Fishbone Diagram, Pareto Analysis, 6M (Man, Method, Material, Machine, Measurement, Mother Nature).	1. Form was updated after initial IQ 2. No IQ was performed a. Equipment was added to log before IQ form was implemented, and IQ was not performed retroactively i. No action items created when new IQ form was released b. Equipment was not in log or not labeled i. Equipment was missing IQ 1. Failure of personnel to follow protocol ii. Equipment was brought into Pathway Medtech without Engineering/Quality knowledge 1. Equipment was assumed to be used for engineering only, but was not assessed or labeled c. Equipment was missing i. Equipment is moved throughout Pathway without updating the log ii. Equipment was removed from use without updating the log Recommend: Developing and training personnel to equipment protocols and retroactively performing IQ on pre-existing equipment
Root Cause Code(s): <i>(check all that apply)</i>	☐ Code 1 – Man – Inadequate Training ☒ Code 2 – Man – Procedure Not Used/Used Improperly/Step Omitted ☐ Code 3 – Man – Human Error ☐ Code 4 – Man – Lack of Qualification, Demonstrated Proficiency ☒ Code 5 – Method – Incomplete Procedure/Wrong/Ambiguous/Non-Existent ☐ Code 6 – Method – Manufacturing Process Controls ☐ Code 7 – Method – Validation/Verification Issue ☐ Code 8 – Material – Damaged/Contaminated ☐ Code 9 – Material – Invalid Testing ☐ Code 10 – Material – Testing not met ☐ Code 11 – Material – Expired/Damaged ☐ Code 12 – Material – Specification Incomplete/Wrong/Ambiguous ☐ Code 13 – Material – Device Biocompatibility ☐ Code 14 – Material – Material Compatibility ☐ Code 15 – Material – Visual Specification not met/Unusual characteristics ☐ Code 16 – Material – Incorrect Storage ☐ Code 17 – Machine – Defective Machine/Tool ☐ Code 18 – Machine – Machine/Tool Capacity ☐ Code 19 – Machine – Operational Failure ☐ Code 20 – Machine – Equipment Controls and Calibration ☐ Code 21 – Machine – Inadequate Maintenance ☐ Code 22 – Environmental Controls – Facilities/Utilities/Clean Room ☐ Code 23 – Environmental Controls – Temperature/Humidity ☐ Code 24 – Environmental Controls – Cleanliness/Particulate ☐ Code 25 – Environmental Controls – Microbial ☐ Code 26 – Other – Documentation Issue

PHASE 2 - CAPA INVESTIGATION RESULTS & ROOT CAUSE ANALYSIS			
		☐ Code 27 – Other – Labeling Issue ☐ Code 28 – Other – Manufacturing Issue ☐ Code 29 – Other – Supplier Issue ☐ Code 30 – Other – Design Issue: _____ ☐ Attachments	
Phase 3 Target Due Date:		07/11/2025	
PHASE 2 – APPROVAL SIGNATURES			
CAPA Owner (Name/Title):	Amber O'Brien	Signature/Date:	 Amber O'Brien (30-Jun-2025 11:43 PDT)
Executive Management (Name/Title):	Aaron Rogers	Signature/Date:	 Aaron Rogers (25-Jun-2025 15:03 PDT)
Quality Assurance (Name/Title):	Larry Dacoron	Signature/Date:	 Larry Dacoron (27-Jun-2025 11:48 PDT)
CAPA EXTENSION REQUEST (☒ N/A if not applicable)			
CAPA Extension Due Date:		N/A	
Justification for Extension:		N/A	
CAPA EXTENSION APPROVAL SIGNATURES (☒ N/A if not applicable)			
CAPA Owner (Name/Title):	N/A	Signature/Date:	N/A
Quality Assurance (Name/Title):	N/A	Signature/Date:	N/A

CAPA-23-0008 Phase 2

Final Audit Report

2025-06-30

Created:	2025-06-25 (Pacific Daylight Time)
By:	Jacqueline Kim (jkim@pathwaymedtech.com)
Status:	Approved
Transaction ID:	CBJCHBCAABAA2iFEA9tBf22BIVdUliaXVIIHi_edEdwB
Number of Documents:	1
Document page count:	6
Number of supporting files:	0
Supporting files page count:	0

"CAPA-23-0008 Phase 2" History

-  Document created by Jacqueline Kim (jkim@pathwaymedtech.com)
2025-06-25 - 2:40:20 PM PDT
-  Document emailed to Larry Dacoron (ldacoron@pathwaymedtech.com) for approval
2025-06-25 - 2:43:18 PM PDT
-  Document emailed to Aaron Rogers (arogers@pathwaymedtech.com) for approval
2025-06-25 - 2:43:18 PM PDT
-  Document emailed to Amber O'Brien (aobrien@pathwaymedtech.com) for approval
2025-06-25 - 2:43:18 PM PDT
-  Email viewed by Amber O'Brien (aobrien@pathwaymedtech.com)
2025-06-25 - 2:45:26 PM PDT
-  Email viewed by Aaron Rogers (arogers@pathwaymedtech.com)
2025-06-25 - 3:02:36 PM PDT
-  Aaron Rogers (arogers@pathwaymedtech.com) authenticated with Email OTP by verifying one-time code sent via email
2025-06-25 - 3:03:17 PM PDT
-  Agreement viewed by Aaron Rogers (arogers@pathwaymedtech.com)
2025-06-25 - 3:03:18 PM PDT

-  Aaron Rogers (arogers@pathwaymedtech.com) has agreed to the terms of use and to do business electronically with Pathway Medtech LLC
2025-06-25 - 3:03:58 PM PDT
-  Document approved by Aaron Rogers (arogers@pathwaymedtech.com)
Approval Date: 2025-06-25 - 3:03:58 PM PDT - Time Source: server
-  Larry Dacoron (ldacoron@pathwaymedtech.com) authenticated with Email OTP by verifying one-time code sent via email
2025-06-27 - 11:48:10 AM PDT
-  Agreement viewed by Larry Dacoron (ldacoron@pathwaymedtech.com)
2025-06-27 - 11:48:11 AM PDT
-  Larry Dacoron (ldacoron@pathwaymedtech.com) has agreed to the terms of use and to do business electronically with Pathway Medtech LLC
2025-06-27 - 11:48:36 AM PDT
-  Document approved by Larry Dacoron (ldacoron@pathwaymedtech.com)
Approval Date: 2025-06-27 - 11:48:36 AM PDT - Time Source: server
-  Amber O'Brien (aobrien@pathwaymedtech.com) authenticated with Email OTP by verifying one-time code sent via email
2025-06-30 - 11:42:06 AM PDT
-  Agreement viewed by Amber O'Brien (aobrien@pathwaymedtech.com)
2025-06-30 - 11:42:07 AM PDT
-  Amber O'Brien (aobrien@pathwaymedtech.com) has agreed to the terms of use and to do business electronically with Pathway Medtech LLC
2025-06-30 - 11:43:56 AM PDT
-  Document approved by Amber O'Brien (aobrien@pathwaymedtech.com)
Approval Date: 2025-06-30 - 11:43:56 AM PDT - Time Source: server
-  Agreement completed.
2025-06-30 - 11:43:56 AM PDT