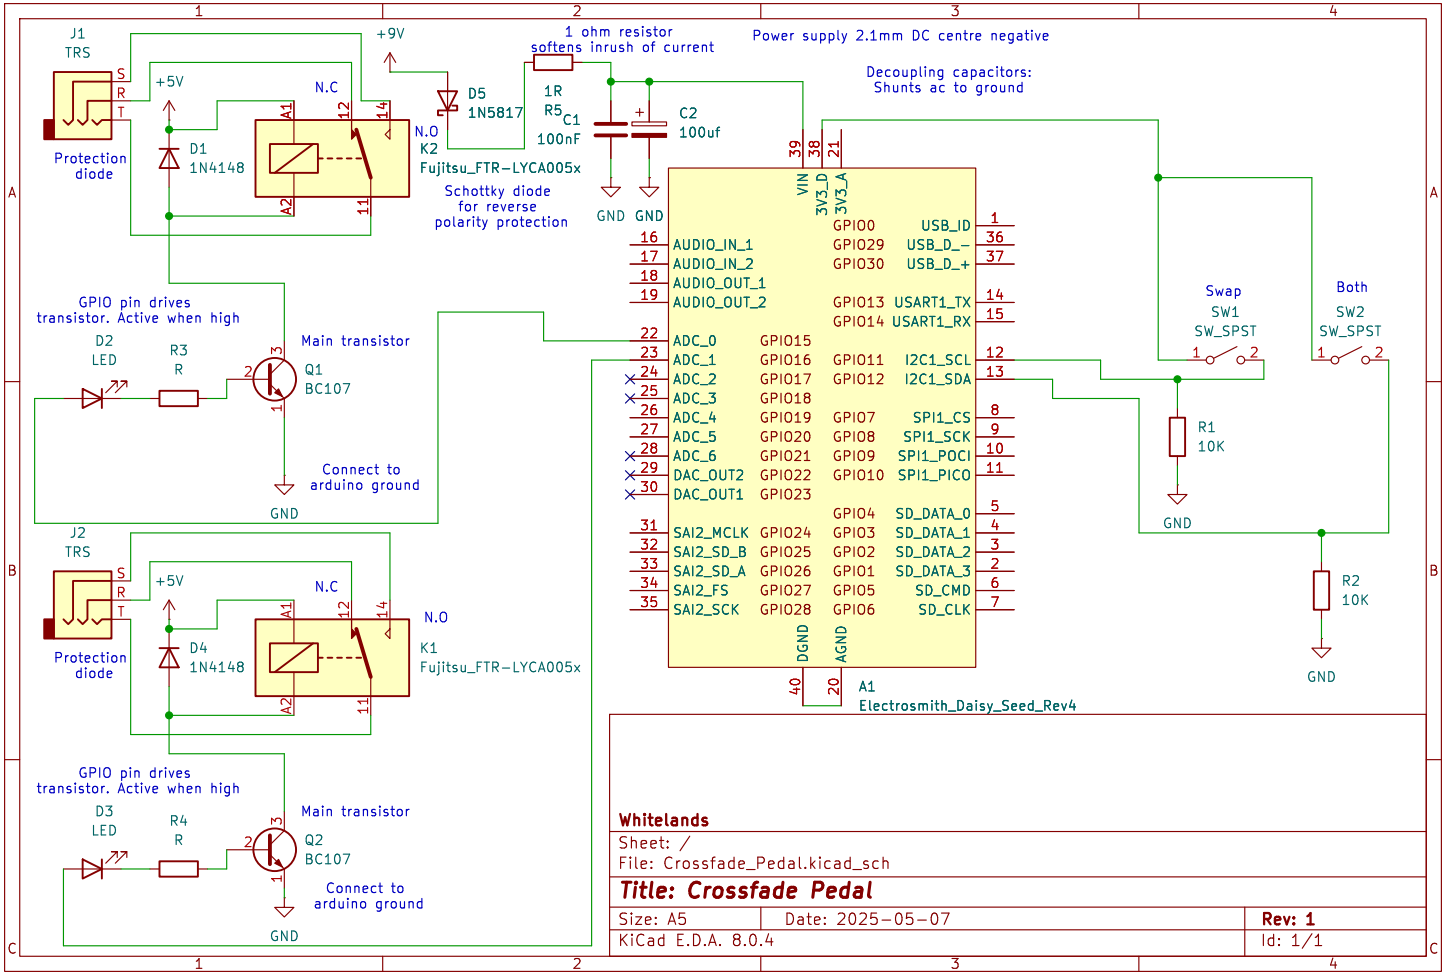

J1
TRS
S
R
T
+5V
N.C
D1
1N4148
A1
12
14
A2
11
Protection diode
+9V
D5
1N5817
N.O
K2
Fujitsu_FTR-LYCA005x
1 ohm resistor softens inrush of current
1R
R5
C1
100nF
C2
100uf
GND GND
Schottky diode for reverse polarity protection
Power supply 2.1mm DC centre negative
Decoupling capacitors: Shunts ac to ground
39
38
21
VIN
3V3_D
3V3_A
GPIO0
USB_ID
1
GPIO29
USB_D_-
36
GPIO30
USB_D_+
37
16
AUDIO_IN_1
17
AUDIO_IN_2
18
AUDIO_OUT_1
19
AUDIO_OUT_2
GPIO13
USART1_TX
14
GPIO14
USART1_RX
15
22
ADC_0
GPIO15
23
ADC_1
GPIO16
GPIO11
I2C1_SCL
12
24
ADC_2
GPIO17
GPIO12
I2C1_SDA
13
25
ADC_3
GPIO18
26
ADC_4
GPIO19
GPIO7
SPI1_CS
8
27
ADC_5
GPIO20
GPIO8
SPI1_SCK
9
28
ADC_6
GPIO21
GPIO9
SPI1_POCI
10
29
DAC_OUT2
GPIO22
GPIO10
SPI1_PICO
11
30
DAC_OUT1
GPIO23
GPIO4
SD_DATA_0
5
31
SAI2_MCLK
GPIO24
GPIO3
SD_DATA_1
4
32
SAI2_SD_B
GPIO25
GPIO2
SD_DATA_2
3
33
SAI2_SD_A
GPIO26
GPIO1
SD_DATA_3
2
34
SAI2_FS
GPIO27
GPIO5
SD_CMD
6
35
SAI2_SCK
GPIO28
GPIO6
SD_CLK
7
DGND
AGND
40
20
A1
Electrosmith_Daisy_Seed_Rev4
Swap
SW1
SW_SPST
1
2
Both
SW2
SW_SPST
1
2
R1
10K
GND
R2
10K
GND
GPIO pin drives transistor. Active when high
D2
LED
R3
R
Main transistor
Q1
BC107
2
3
1
Connect to arduino ground
GND
J2
TRS
S
R
T
+5V
N.C
D4
1N4148
A1
12
14
A2
11
N.O
K1
Fujitsu_FTR-LYCA005x
Protection diode
GPIO pin drives transistor. Active when high
D3
LED
R4
R
Main transistor
Q2
BC107
2
3
1
Connect to arduino ground
GND
Whitelands
Sheet: /
File: Crossfade_Pedal.kicad_sch
Title: Crossfade Pedal
Size: A5
Date: 2025-05-07
Rev: 1
KiCad E.D.A. 8.0.4
Id: 1/1