Form 3160-5
(June 2019)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB
No. 1004-0137 Expires:
December 31, 2024

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.
NM15003

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE *- Other instructions on page 2*

7. If Unit of CA/Agreement, Name and/or No.

1. Type of Well
☑ Oil Well ☐ Gas Well ☐ Other

8. Well Name and No.
Government NBFD #1

2. Name of Operator
Permian Resources Operating LLC OGRID:372165

9. API Well No.
30-015-28841

3a. Address
300 N. Marienfeld St Ste 1000, Midland, TX 79701

3b. Phone No. *(include area code)*
281-540-9393

10. Field and Pool or Exploratory Area
Burton Flat Wolfcamp, North Burton Flat Morrow

4. Location of Well *(Footage, Sec., T.,R.,M., or Survey Description)*
Sec 11 T20S R28E 660 FSL & 330 FWL

11. Country or Parish, State
Eddy, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☑ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	☐ Well Integrity
☐ Subsequent Report	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other
	☐ Change Plans	☑ Plug and Abandon	☐ Temporarily Abandon	
☐ Final Abandonment Notice	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

JMR Services, LLC respectfully proposes the attached P&A NOI to plug this well on behalf of Permian Resources Operating, LLC.
Please see the attached proposed P&A NOI.

14. I hereby certify that the foregoing is true and correct. Name *(Printed/Typed)*
Kelton Woodard

Title Plugging Agent

Signature Kelton Woodard

Date 11/4/2025

THE SPACE FOR FEDERAL OR STATE OFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

P&A Proposed NOI
Permian Resources Operating LLC
Government NBFD #1
30-015-28841

1. Hold Pre job meeting, comply with all NMOCD, BLM and environmental regulations.
2. MIRU plugging spread
3. Kill well as necessary
4. Unseat pump and pull rods
5. ND wellhead, NUBOPE
6. POOH with 2 3/8" tubing.
7. RIH with workstring and tag cement at 11,167'.
8. Circulate wellbore with MLF.
9. Plug #1: (Morrow/Atoka/Strawn/Canyon) Spot 122 sxs class H cement from 10667' to 9805'. 50' Excess included.
10. POOH with workstring
11. RU Wireline and run GR to 9122'.
12. RIH with 5.5" CIBP to 9072' and set. POH with wireline.
13. Pressure test CIBP and Casing to 500 psi for 30 min.
14. CBL on file TOC 5.5" 7500'
15. Trip in hole and tag CIBP @ ~9072'
16. Plug #2: (Wolfcamp) Spot 20 sxs class H cmt from 9072' to 8972'.
17. Plug #3: (Spacer) Sqz 42 sxs (16 in/26out) class C cmt w/2% CaCl from 7000' to 6900'. WOC 4hrs. & Tag.
18. Plug #4: (Bone Springs) Sqz 42 sxs (16 in/26out) class C cmt w/2% CaCl from 4971' to 4871'. WOC 4hrs. & Tag.
19. Plug #5: (Delaware/Inter Shoe) Sqz 90 sxs(30in/60out) class C cmt w/2% CaCl from 3180' to 2950'. WOC 4hrs & Tag.
20. Plug #6: (Yates/BSalt) Sqz 131 sxs (56in/75out) class C cmt w/2% CaCl from 1022' to 553'. WOC 4hrs. & Tag.
21. Plug #7: (Surf Shoe/Surface) Circulate 114 sxs (49in/65out) class C cmt from 450' to 0'. Verify and Bubble test.
22. RD Plugging spread.
23. RU wellhead cutoff crew. Cutoff wellhead and anchors.
24. Install above ground P&A marker take pictures and attach to subsequent report.
25. RDMO
26. Plugging Operations Complete

Current WBD			
Author:	Shyanne @ JMR		
Well Name	Government NBFD	Well No.	#1
Field/Pool	Flat Wolfcamp/North Burton Flat I	API #:	30-015-28841
County	Eddy	Location:	Sec 11 T20S R28E
State	NM		660 FSL & 330 FWL
Spud Date		GL:	3265

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface	13.375		54.4	400	17 1/2	420	0
Intermediate	8.625		24/32	3,000	11	2,475	0
Production	5.5		17/20	12,375	7 7/8	700	7500/CBL

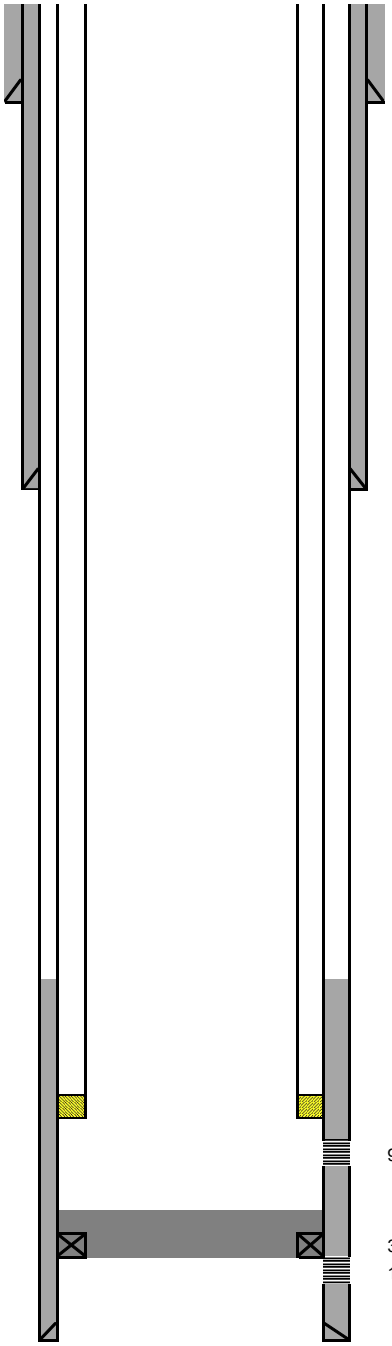

9122' -9226' Wolfcamp Perfs

35' cmt on top of pkr @ 11167'
11262' - 11270' Morrow Perfs

Proposed WBD			
Author:	Shyanne @ JMR		
Well Name	Government NBFD	Well No.	#1
Field/Pool	Flat Wolfcamp/North Burton Flat I	API #:	30-015-28841
County	Eddy	Location:	Sec 11 T20S R28E
State	NM		660 FSL & 330 FWL
Spud Date		GL:	3265

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface	13.375		54.4	400	17 1/2	420	0
Intermediate	8.625		24/32	3,000	11	2,475	0
Production	5.5		17/20	12,375	7 7/8	700	7500/CBL

Formation	Top
Bsalt	603
Yates	972
Delaware	3130
Bone Springs	4921
Wolfcamp	9080
Canyon	9855
Strawn	10072
Atoka	10394
Morrow	10617
Miss.	11670
Devonian	12173

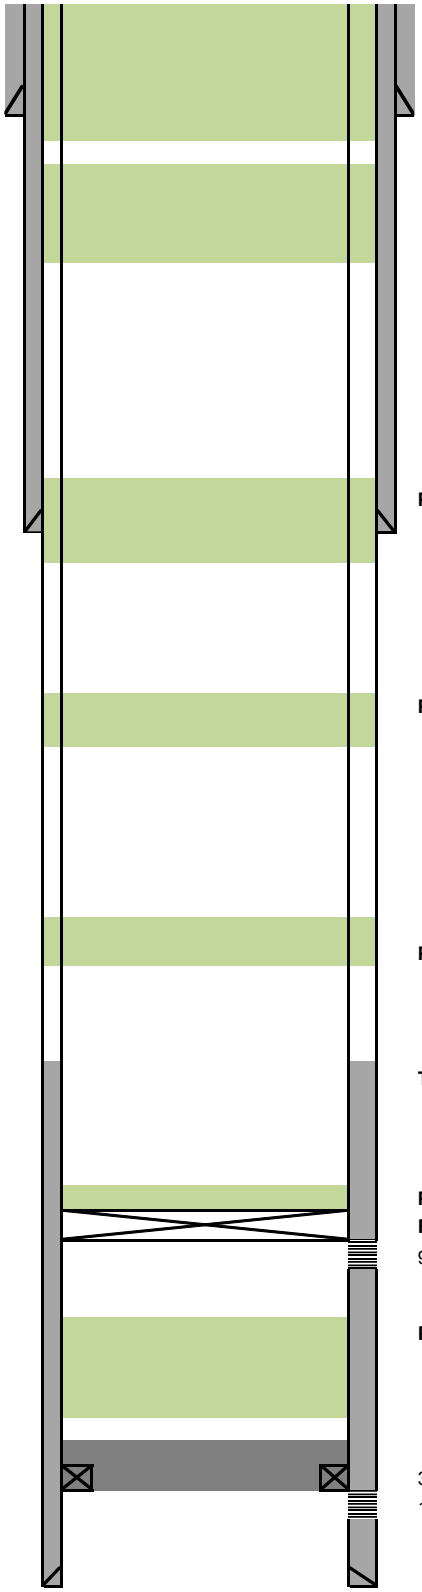

Plug #7: (Surf Shoe/Surface) Circulate 114 sxs (49in/65out) class C cmt from 450' to 0'. Verify and Bubble test.

Plug #6: (Yates/BSalt) Sqz 131 sxs (56in/75out) class C cmt w/2% CaCl from 1022' to 553'. WOC 4hrs. & Tag.

Plug #5: (Delaware/Inter Shoe) Sqz 90 sxs(30in/60out) class C cmt w/2% CaCl from 3180' to 2950'. WOC 4hrs & Tag.

Plug #4: (Bone Springs) Sqz 42 sxs (16 in/26out) class C cmt w/2% CaCl from 4971' to 4871'. WOC 4hrs. & Tag.

Plug #3: (Spacer) Sqz 42 sxs (16 in/26out) class C cmt w/2% CaCl from 7000' to 6900'. WOC 4hrs. & Tag.

TOC @ 7500' by CBL

Plug #2: (Wolfcamp) Spot 20 sxs class H cmt from 9072' to 8972'.
RIH with 5.5" CIBP to 9072' and set. POH with wireline.
9122' -9226' Wolfcamp Perfs

Plug #1: (Morrow/Atoka/Strawn/Canyon) Spot 122 sxs class H cement from 10667' to 9805'. 50' Excess included.

35' cmt on top of pkr @ 11167'
11262' - 11270' Morrow Perfs