

Technical Service Information

FORD A4LD BLOWING FLUID OUT THE BREATHER VENT

COMPLAINT: Blowing fluid out the breather vent.

CAUSE: One possible cause is governor rings leaking causing pressure to build up in the case blowing fluid out the

vent.

CORRECTION: Check governor bore (figure 1) for ring grooves, if ring grooves are present replace case or install a sleeve kit.

Also check governor rings for damage (figure 2) replace if necessary.

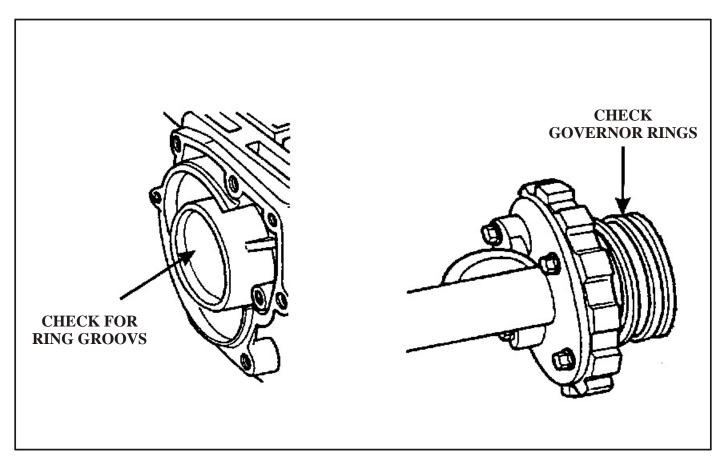


Figure 1