


Technical Service Information

MERCEDES 722.3 /.4 MODELS 107, 123 AND 126 COMPENSATING PIN FOR THE MODULATOR VALVE

We have illustrated the separator plate ID in Figure 1 for both the regular 722.3 valve body and the 722.4 which is the 190E plate. You will note that the "regular" six bolt pan plate has a large opening where as the 190E opening is split. The arrows point to the locations on the plate. The regular plate (722.1 722.2 722.3) has a late and early version. The early will NOT fit the late valve body but the late will fit the early. Note the difference. The late one has a square hole instead of the two orifices in the early. This is the position of the valve body screen

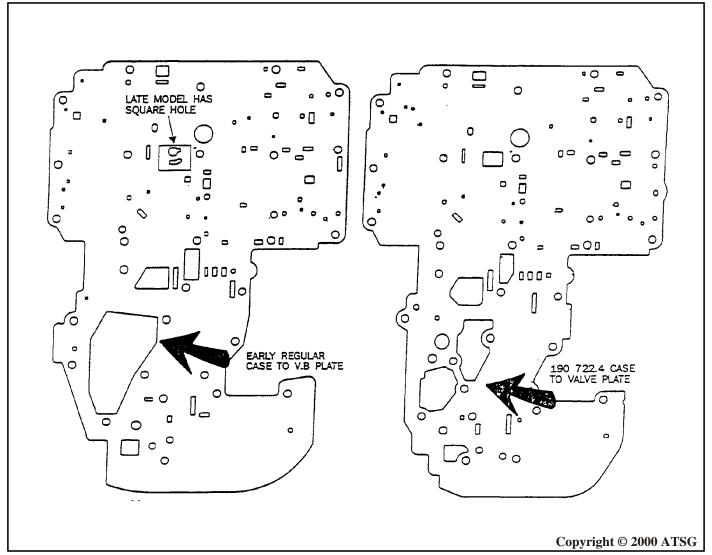

AUTOMATIC TRANSMISSION SERVICE GROUP