

Technical Service Information

THM 4T60-E 3RD GEAR STARTS, NO A/C, NO VOLTAGE TO "E" TERMINAL

COMPLAINT: Some 1995-1996 Buick Century and Oldsmobile Ciera vehicles, equipped with the 3.1L

engine, may exhibit a 3rd gear start condition and the air conditioner not working. Since the vehicle came into a transmission shop we immeadiately check for voltage at terminal "E" at the case connector, and find 0 volts. After inspecting the fuse block, you discover that there

are NO blown fuses.

CAUSE: The cause may be, a blown "*In-Line*" fuse behind the instrument panel as illustrated in

Figure 1, that also controls voltage to terminal "E" at the transaxle.

CORRECTION: Remove the glove compartment for access to the "In-Line" fuses, and replace the A/C fuse,

as shown in Figure 1.

Copyright © 2001 ATSG

02-18

Page 1 of 2



Technical Service Information

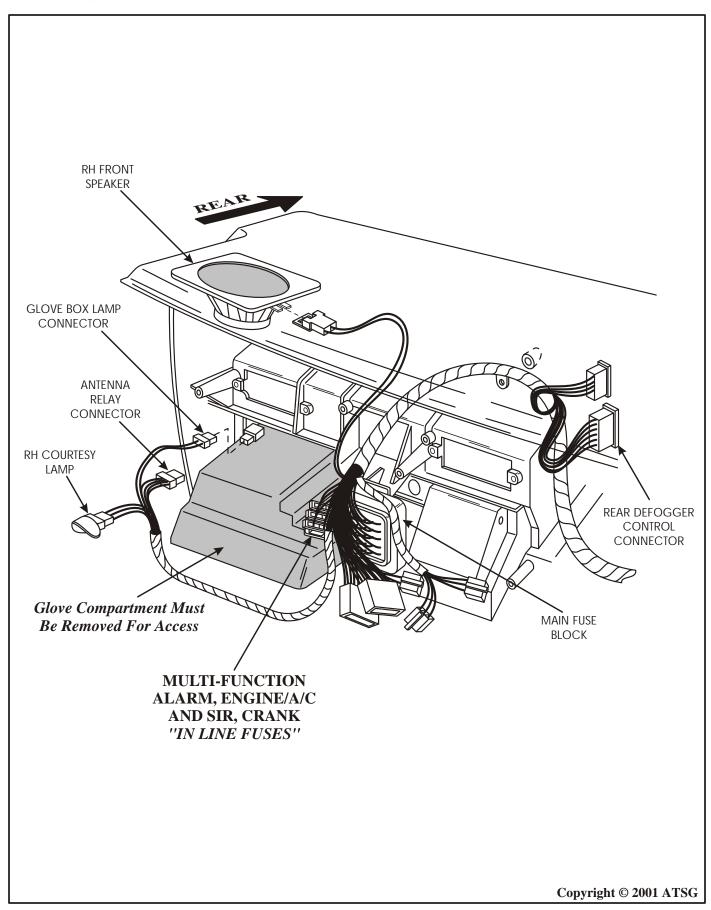


Figure 1

AUTOMATIC TRANSMISSION SERVICE GROUP