

# **Technical Service Information**

### THM 4L60-E/4L65-E AND THM 4L80-E NEW PRESSURE CONTROL SOLENOID

**CHANGE:** Beginning at the start of production for 2003 model 4L60-E and 4L65-E transmissions, and start of production for 2004 model 4L80-E transmissions, the Pressure Control Solenoid (PCS) was changed to a new design solenoid with a revised internal harness connector, as shown in Figure 1.

**REASON:** Eliminates mis-assembly concerns on the factory assembly line.

#### **PARTS AFFECTED:**

- (1) PRESSURE CONTROL SOLENOID Solenoid redesigned with a new design connector, as shown in Figure 1.
- (2) INTERNAL WIRE HARNESS Harness connector changed to accommodate the new solenoid connector, as shown in Figure 1.

#### **INTERCHANGEABILITY:**

Will interchange as long as the internal harness used is compatable with the solenoid.

#### **SERVICE INFORMATION:**

Pressure Control Solenoid (2003 Design)	24224905
4L60-E/4L65-E, Internal Wire Harness (2003 Design)	
4L80-E. Internal Wire Harness (2004 Design)	

Copyright © 2004 ATSG

04-37 Page 1 of 2



## **Technical Service Information**

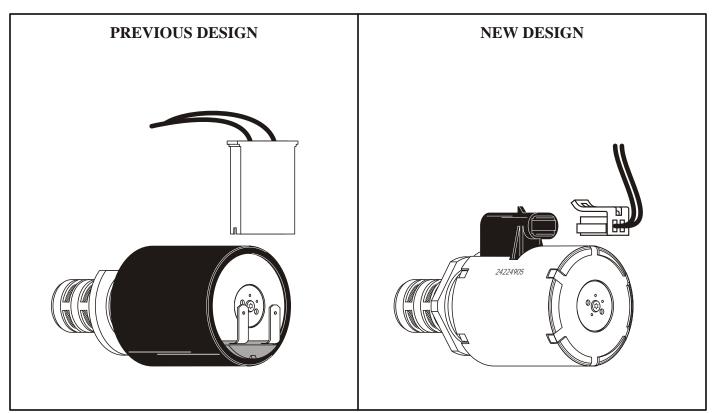


Figure 1

Copyright © 2004 ATSG

04-37 Page 2 of 2