

Technical Service Information


SUBARU 3 SPEED PREMATURE FORWARD CLUTCH FAILURE

COMPLAINT: Premature forward clutch failure, usually burnt in less than 1000 miles.

CAUSE: The cause may be a blown front pump gasket because of a defective gasket. Some gaskets

had the forward clutch passage cut improperly (See Figure 1).

CORRECTION: Install pump to case gasket with a properly cut forward clutch passage (See Figure 1).

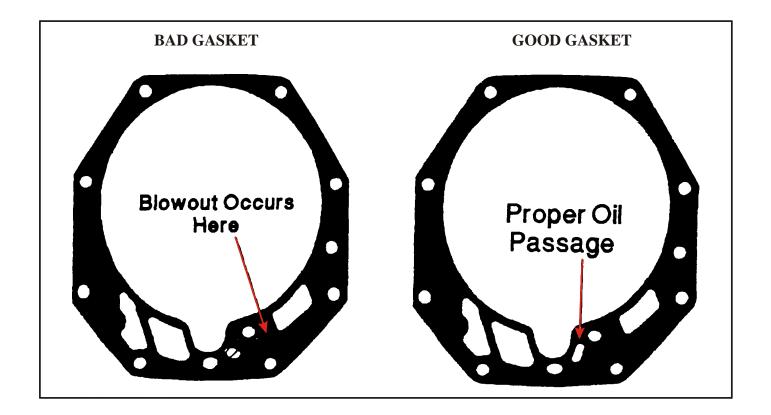

Copyright © 2000 ATSG