


## **Technical Service Information**

## THM 4L60 (700-R4) REVERSE INPUT HOUSING AVAILABILITY

Powertrain Division of G.M. has informed us that the Reverse Input Housing for the 1987 thru 1992 model 4L60 transmission, OHM part number 8663068, is no longer available. This is the Reverse Input Housing with the .095" orifice in the feed passage between the sealing rings, as shown in Figure 1.

All of the previous model Reverse Input Housings, 1982 thru 1992, have been replaced by the 1993 model housing, OEM part number 8681295. This is the Reverse Input Housing with the large square hole in the feed passage between the sealing rings, as shown in Figure 2.

Anytime that you order the previous model part numbers, it will automatically supercede to the 93 model Reverse Input Housing and no other changes are required. This will create a firmer garage shift into Reverse on 1987 thru 1992 models, but is not an objectionable concern. There is now only one Reverse Input Housing available for ALL models of the THM 4L60 (700-R4), OEM number 8681295, as shown in Figure 2.

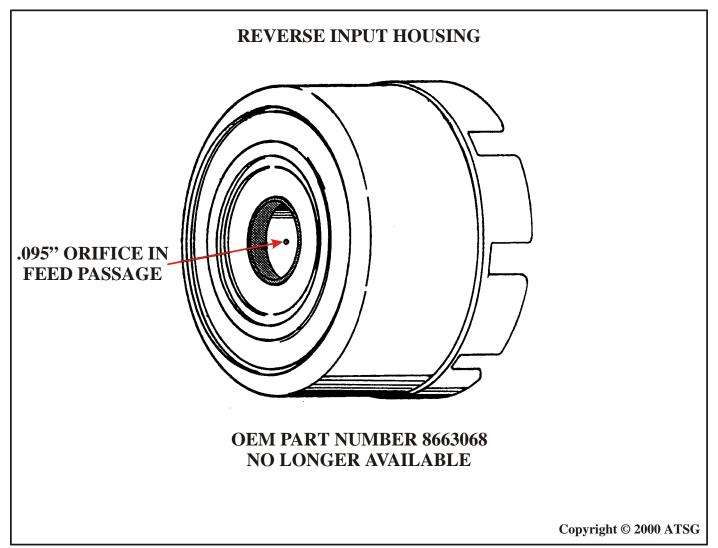



## **Technical Service Information**

