

## **Technical Service Information**

# HONDA/ACURA A/T CONTROL LEVER CHANGE FOR 2005 MDX MODELS

**COMPLAINT:** When purchasing a reman A/T it may be noticed during installation that the A/T Shift Control

Lever is different than what was removed from the vehicle.

CAUSE: Honda Canada Manufacturing changed the A/T control lever for the '05 MDX starting

with VIN 2HNYD18975H540748. (The control lever mounts on the transmission range

switch and connects to the shift cable.)

Refer to the diagram in Figure 1. Early '05 MDX models use a control lever with a pin made as part of the lever, whereas late '05 and later models use a separate pin that goes

through the lever. Both models use the same type spring clip/washer.

**CORRECTION:** Use the proper control lever for the vehicle you are working on.


#### **SERVICE INFORMATION:**

CONTROL LEVER EARLY 2005 (Honda P/N)	24412-RDK-010
CONTROL LEVER LATE 2005 & UP (Honda P/N)	54313-SJA-A81
CONTROL WIRE PIN 2005 & UP (Honda P/N)	54314-SJA-A81
SPRING CLIP WASHER EARLY AND LATE (Honda P/N)	90550-RDJ-000




### **Technical Service Information**

#### PREVIOUS STYLE - EARLY '05

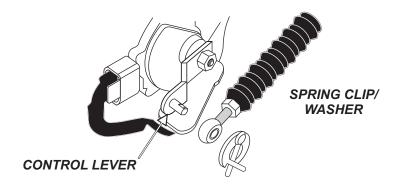

#### NEW STYLE - LATE '05, '06

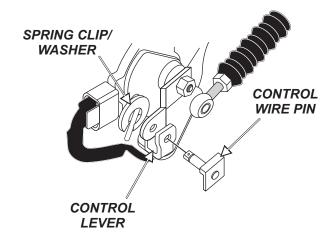

Copyright © 2012 ATSG

Figure 1