

## **Technical Service Information**

# FORD 5R55N AND 5R55W/S SOLENOID BODY GASKET IDENTIFICATION

**COMPLAINT:** Installing the wrong solenoid body gasket onto a 5R55W/S usually creates a no reverse

condition and the gaskets are almost identical, as shown in Figure 1.

CAUSE: Currently, most aftermarket gasket sources package the 5R55N gasket into the 5R55W/S

gasket pack by mistake. They are currently in the process of correcting this error.

**CORRECTION:** Ensure that you install the correct solenoid body gasket during overhaul or repair. Use the

illustrations in Figure 1 to identify the different solenoid blocks and the different solenoid

gaskets. Refer to Figure 2 for the proper assembly procedure.

SPECIAL NOTE:

None of the parts shown in Figure 1 will interchange with one another, nor will the solenoid packs correctly assembled interchange between the 5R55N and 5R55W/S.

Copyright © 2004 ATSG

04-32

Page 1 of 3



### **Technical Service Information**

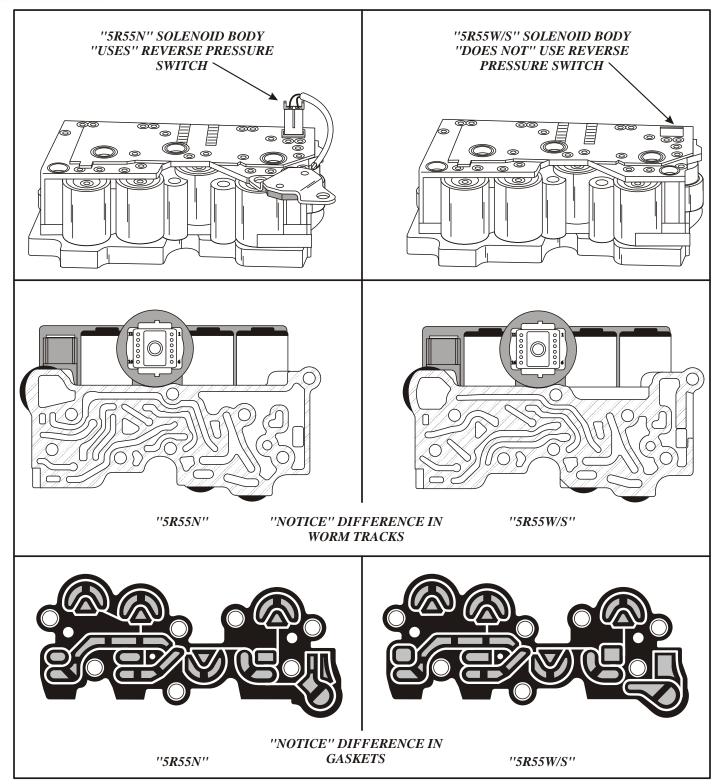


Figure 1


Copyright © 2004 ATSG

04-32 Page 2 of 3



### **Technical Service Information**

#### 5R55W/S SOLENOID BODY IS ILLUSTRATED

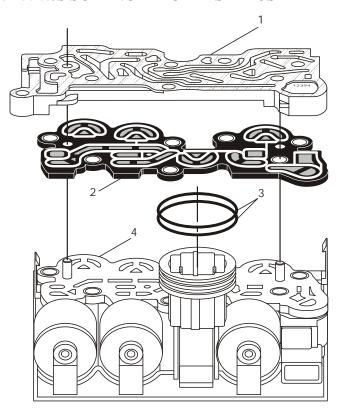

- 1. SOLENOID BODY WORM TRACK PLATE
- 2. SOLENOID BODY TO WORM TRACK PLATE GASKET
- 3. SOLENOID BODY TO CASE "O" RINGS (2 REQUIRED)
- 4. SOLENOID BODY ASSEMBLY

Copyright © 2004 ATSG

Figure 2

Copyright © 2004 ATSG

04-32 Page 3 of 3