

Technical Service Information

TOYOTA A140 NO REVERSE

COMPLAINT: Up shifts 1-2, 2-3,3-4 good but has no reverse.

CAUSE: Weld for sun gear in overdrive drum broken. Piston must be removed in order to be checked

properly

CORRECTION: Replace drum.

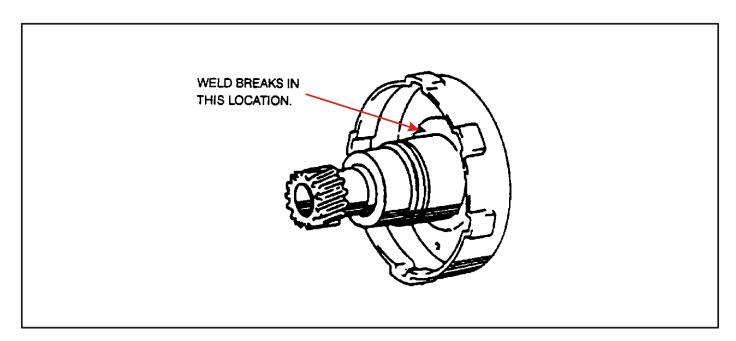


Figure 1