

Technical Service Information

THM 440-T4 REVISED THICKNESS "KOLINE" STEELS

The 2nd clutch steel plates in the 440-T4 are unique, in that they are black in color. They have a black coating on them called "Koline" plating, for shift pleasibility (See Figure 1).

The 2nd clutch steel plates CANNOT be tumbled as it will remove the "Koline" plating. If the "Koline" plating is worn from the steel plates, they must be replaced.

The thickness of the "Koline" plates were revised for the 1987 models, with the addition of the 6 plate clutch pack (See Figure 1).

Following are the proper OEM part numbers;

84-86 - 5 Plate "Koline" Steels	52309
1987 - 6 Plate "Koline" Steels	2006

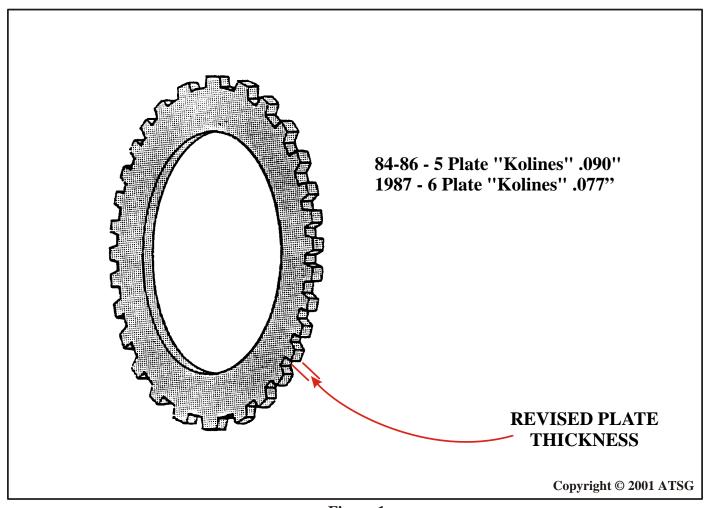


Figure 1