

## **Technical Service Information**

## THM 440-T4 BROKEN T.V. PLUNGER (PART NUMBERS)

The T.V. Plunger and Bushing Assembly are now available from OEM in a service package, so that buying a valve body is no longer necessary when the TV plunger is broken or cracked (See Figure 1). Refer to the following OEM part numbers as it IS a model sensitive part.

<u>YEAR</u> 1984	TRANSAXLE MODELS 4BC	PART NO. 8649730
1985	50B, 50Y	8649317 8649730 8646435 8649641
1986	6AAH, 6ACH, 6ADH, 6AFH, 6AMH, 6ANH, 6APH, 6ARH, 6ASH, 6ATH, 6AWH, 6AYH 6BAH, 6BBH, 6BCH, 6BDH, 6BLH, 6BMH, 6BSH, 6BTH, 6BYH 6BHH, 6BZH	8649641 8658704 8649730
1987	7ACH, 7ADH, 7AHH, 7ALH, 7ARH, 7HAH, 7HCH	8649641 8646435 8658704
1988	8AAH, 8ABH, 8AFH, 8AJH, 8ANH, 8ATH	8649641 8658704 8646435
1989	9AAH, 9ABH, 9ACH, 9ADH, 9AFH, 9AHH, 9AJH, 9ANH, 9ATH	8649641 8658704
1990	9YAH, 9YBH, 9YCH, 9YFH, 9YJH  OAAH, OABH, OAFH, OAJH, OANH, OATH  OBAH, OBDH, OBFH, OBHH, OBJH,  OBMH, OBPH, OBWH, OPAH  OCHH, OCJH, OLAH, OLMH, OLNH,  OYKH, OYLH	8649641 8658704 8646435



## **Technical Service Information**

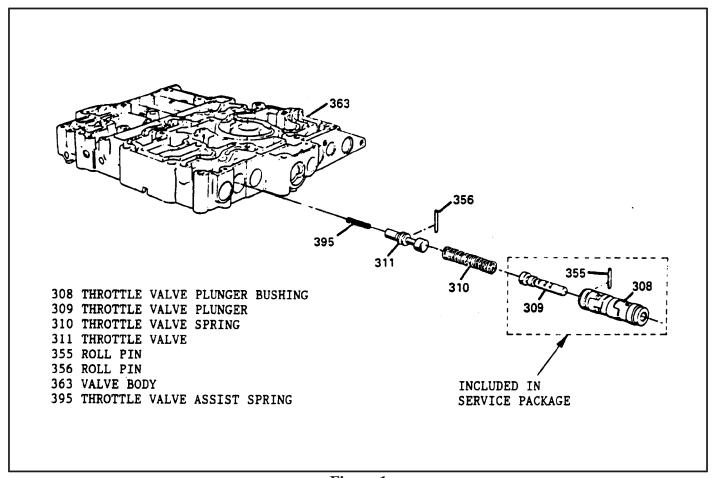


Figure 1