

# **Technical Service Information**

### FORD TAURUS/MECURY SABLE

#### MANUAL LEVER POSITION/DIGITAL RANGE SENSOR DIAGNOSIS

**COMPLAINT:** A 1999 Mercury Sable with 3.0 Liter engine and AX4N Transmission comes into the shop with codes P0708 and P1702 set along with shift scheduling problems. This would indicate a problem with the digital range sensor or its circuits. After installing a new range sensor, the same codes return as well as the shift complaints.

> At this time a wiring diagram was acquired at which time the technician discovered that this vehicle could be equipped with an Manual Lever Position or a Digital Transmission Range Sensor.

#### **CAUSE:**

Because the original sensor on this vehicle was a 12 pin configuration, it was replace with a 12 pin Digital Range Sensor. This immediately brought the above mentioned codes back because this vehicle requires and MLPS, not a DTRS. The newer (2nd design) MLPS has a 12 pin connector configuration exactly like the DTRS connector so they both appear to be the same component.

When the 12 pin DTRS was installed in this vehicle the PCM set the codes because a DTRS in this vehicle could never range correctly. The MLPS is a step down resistor style which indicates approximately 4.5 volts in park and drops as you move the selector lever towards low which will be about 0.75 volts. The DTRS produces a combination of circuits to the PCM that can be 5 or 1to 12 volts while others are grounded. This combination of voltage and grounded circuits tells the PCM where the gear selector lever has been positioned, Figure 1 illustrates the MLPS internal electrical structure and in Figure 2 the eight and twelve pin connector views can be seen as well as the MLPS ranging logic.

Figure 3 illustrates the DTRS internal electrical structure and in Figure 4 the twelve pin connector view can be seen as well as the DTRS ranging logic.

#### **CORRECTION:** Once the MLPS was installed, the codes were gone along with the shift complaints.

The way to deter mine which sensor is required other than checking the circuits for voltage is the Vehicle Identification Number. The break points using the 8TH VIN digit for engine type are as follows:

1998/1999 Taurus VIN "N" for SHO models and VIN "S" for all other models use the 12 pin

1998/1999 Taurus Vin "1" or "2" for Flex Fuel equipped vehicles and VIN "U" use the 12 pin

1998/1999 Sable VIN "S" use the 12 pin MLPS.

1998/1999 Sable VIN "U" use the 12 pin DTRS.

#### **SERVICE INFORMATION:**

12 Pin Manual Position Lever Sensor	F6DZ-7F293-A
12 Pin Digital Transmission Range Sensor	F8DZ-7F293-AD

()9-31Page 1 of 3



# **Technical Service Information**

#### MANUAL LEVER POSITION SENSOR

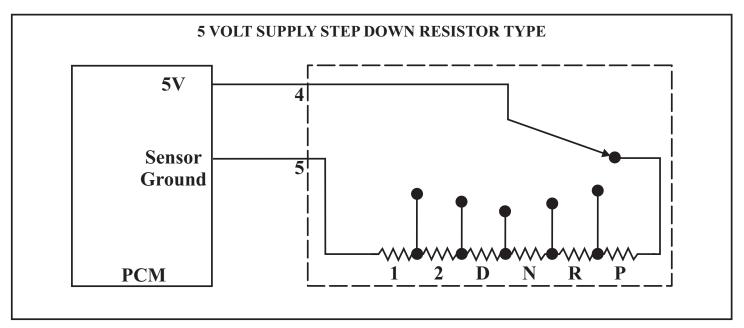


Figure 1

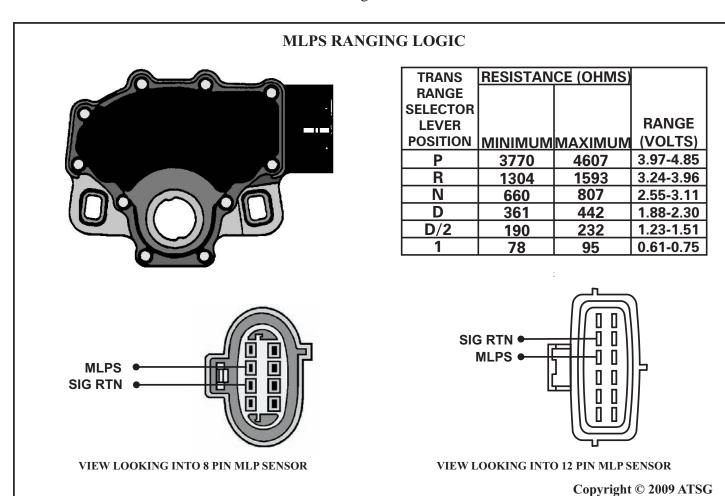


Figure 2
AUTOMATIC TRANSMISSION SERVICE GROUP



## **Technical Service Information**

#### DIGITAL TRANSMISSION RANGE SENSOR

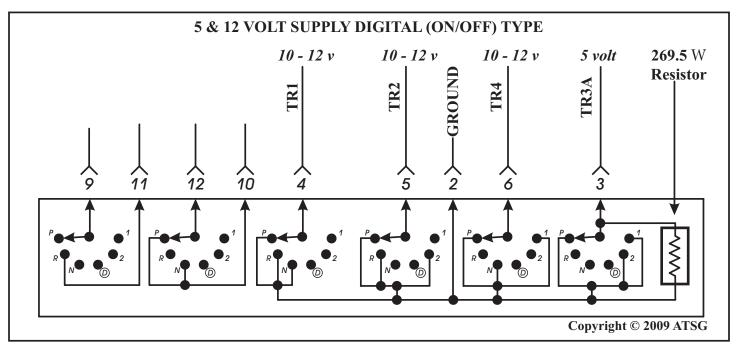


Figure 3

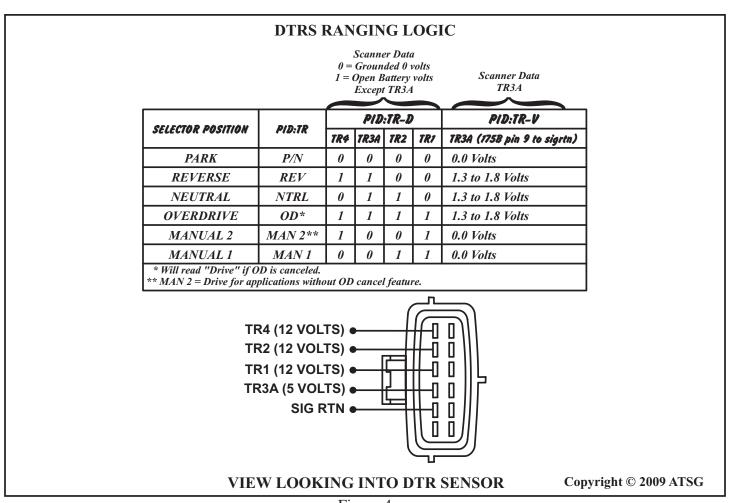


Figure 4