

Technical Service Information

THM 440-T4 **BACKS UP IN NEUTRAL**

COMPLAINT: Car moves in reverse with manual lever in neutral Engine lugs with transmission selector in

CAUSE: Could be a cross leak in the RNDI oil passage in the Case cover due to the use or installation

of the wrong Upper case cover gasket,

CORRECTION: In figure 1 we illustrate the early gasket which went with the Early case cover, the gasket in

figure 2 is the late gasket That goes with the new case cover, by mis-matching the late Style gasket with the early cover it allows park-reverse neutral Oil to apply the reverse band with the transmission selector In neutral, (keep in mind that the input clutch is applied in Neutral and park, bringing on the reverse band engages all the Components for reverse), the early gasket can be used with the -late cover, but the late will not fit the early, install the proper

gasket


Copyright © 2001 ATSG

86-48




Technical Service Information

EARLY 1985

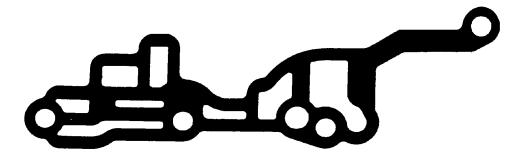

EARLY 1985

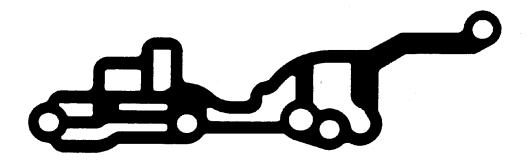

EARLY GASKET WILL FIT LATE UNIT BUT LATE GASKET WILL NOT RETRO FIT EARLY UNITS