

## **Technical Service Information**

## ACURA COMPUTER CONTROLLED 4 SPEED ERRATIC 4-2 DOWNSHIFTS

**COMPLAINT:** Good up shifts to fourth gear but drops to second gear unexpectedly.

**CAUSE:** Filter located in main portion of valve body damaged or restricted with foreign material

causing pressure loss to the shift solenoids.

**CORRECTION:** Clean or replace filter (see figure 1).

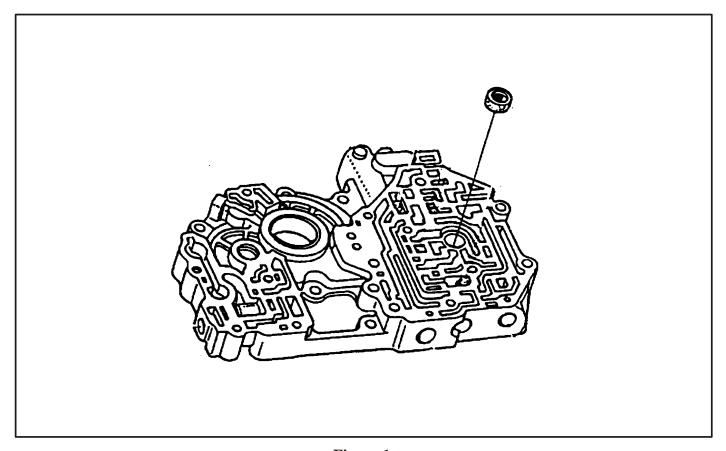


Figure 1

Copyright © 2000 ATSG