

## **Technical Service Information**

## TOYOTA A140 OVERDRIVE UNIT

Inside of each of the pinion pins in the overdrive unit is a plug to retain lube oil for the overdrive unit. These plugs are held in place by the No. 3 thrust washer (See Figure 1).

A loss of any of these plugs during the rebuilding or cleaning process will cause complete destruction of the entire overdrive unit. These plugs deserve your utmost attention.

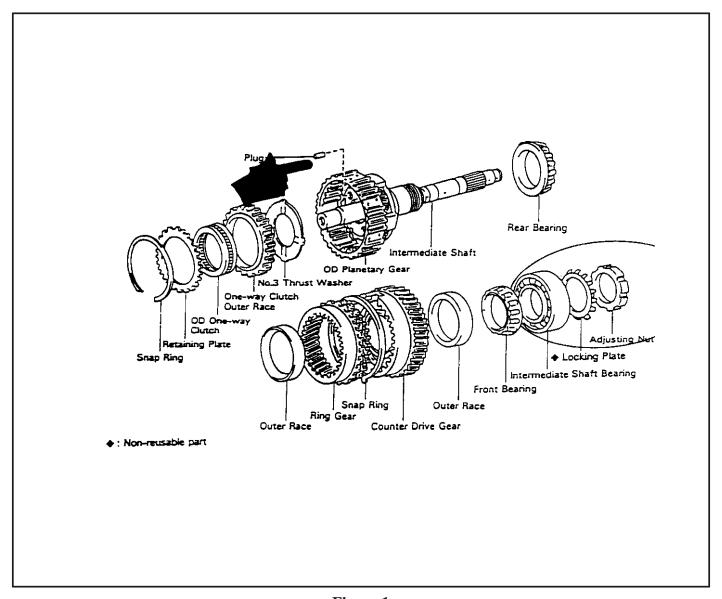


Figure 1

Copyright © 2000 ATSG