

Technical Service Information

THM 3T40 (125C) GOVERNOR SCREEN ADDED

The governor screen was added (1986 Julian Date 203) to the governor sleeve in the case, to minimize the possibility of sediment entering the governor assembly and preventing the governor balls from seating properly (See Figure 1).

A machining change was needed in the case to make room for the new governor screen, thus it will not retro-fit to previous models.

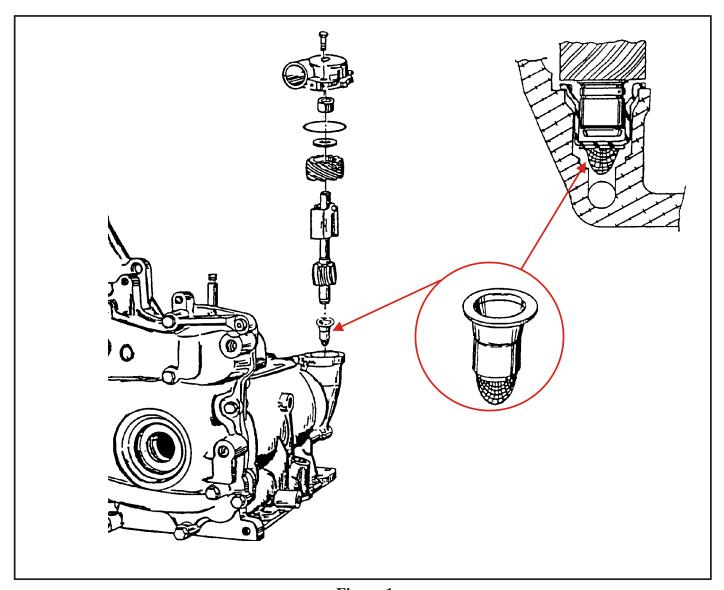


Figure 1