



FORD AXOD PUMP & VALVE BODY GASKET CHANGES


The pump to plate and the plate to valve body gaskets have been changed in 1987. The valve body to plate and the plate to chain cover have also been changed for 1987. The changes are illustrated in this bulletin. IMPORTANT- THE 1986 GASKETS WILL NOT FIT THE 1987 UNITS. NOR WILL THE 1987 GASKETS FIT THE 1986 UNITS. A MIS-MATCH OF THESE GASKETS CAN CAUSE A SLIP, A DELAYED ENGAGEMENT OR A 1-2 SLIDE BUMP.



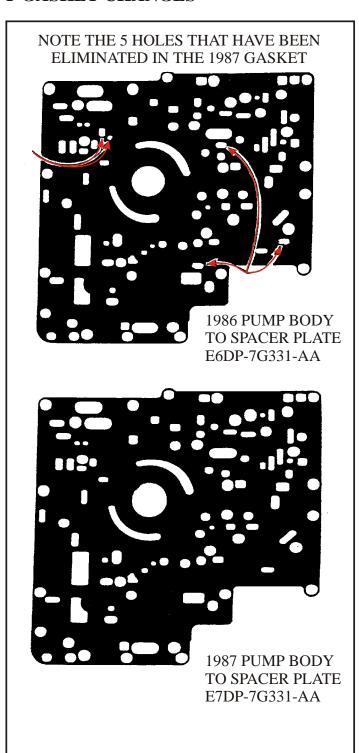


NOTE THE 5 HOLES THAT HAVE BEEN ELIMINATED IN THE 1987 GASKET

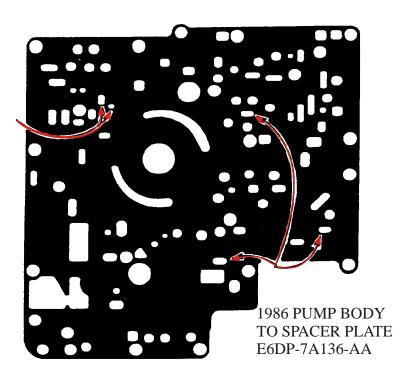

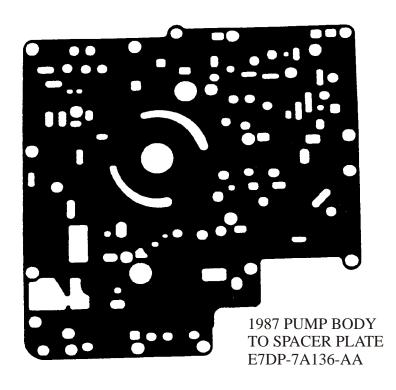




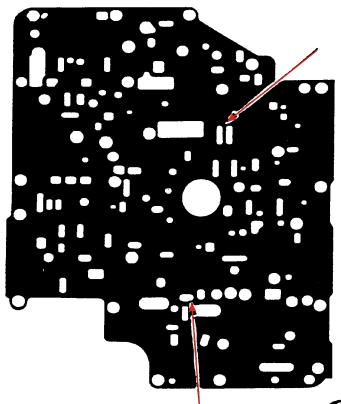


1986 VALVE BODY TO SPACER PLATE GASKET E6DP-7DIOO-AA NOTE: THESE THREE SLOTS ELIMINATED IN THE 1987 GASKET

1987 VALVE BODY TO SPACER PLATE GASKET E7DP-7DIOO-AA NOTE: THESE THREE HOLES ADDED TO THE 1987 GASKET

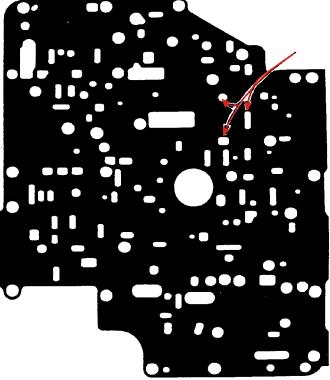



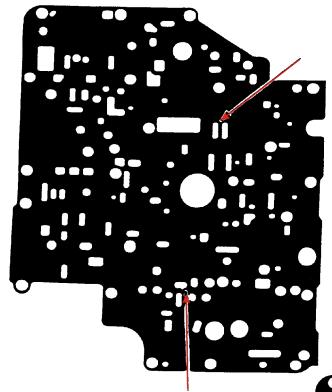

1986 SPACER PLATE TO CHAIN COVER E6DP-7C155-AA NOTE: THESE THREE SLOTS ELIMINATED IN 1987 GASKETS

1987 SPACER PLATE TO CHAIN COVER E7DP-7CI55-AA NOTE: THESE THREE HOLES ADDED TO THE 1987 GASKET

