



Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

1.0 Purpose:

To define the standard for identifying and grading tyres with visual imperfections.

2.0 Scope:

This off Standard Catalogue is applicable to all passenger car radial tyres produced at all plants of Apollo Tyres globally.

3.0 Responsibility:

Plant Quality Manager

4.0 References:

Not Applicable

5.0 Terms and Definitions:

OSC - Off Standard Catalogue

OE - Original Equipment

CC - Critical Characteristics

UF - Uniformity

SS - Serial Side (week code side)

NSS - Non Serial Side

6.0 Description:

General guidelines to use the OSC:

A "X" in one of the columns relates to the applicable grading for the specific imperfection.

"Replacement" grade includes tyres send to **all Replacement Markets including Exports**.




Any appearance flaw smaller than 3 x 3 mm with no depth is not regarded as an imperfection.

A location abbreviation together with date is a disposition until due date and treated as a normal "X".

Blister refers to air entrapment, Blow refers to undercure.

Action Code No.	Description of action codes	SOP code
1	Send as it is	Not Applicable
2	Probe / prick / Clean / Trim / Bend	
3	Wax / Paint	
4	Buff/ Grind	
5	Cure (hot rework)	
6	UF check	
7	Laser engrave sidewall code	
8	Re-apply barcode	
9	Store inner liner blister for 2 weeks and reinspect	
10	Test the tyre in the shearography machine	
11	X-ray test	

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

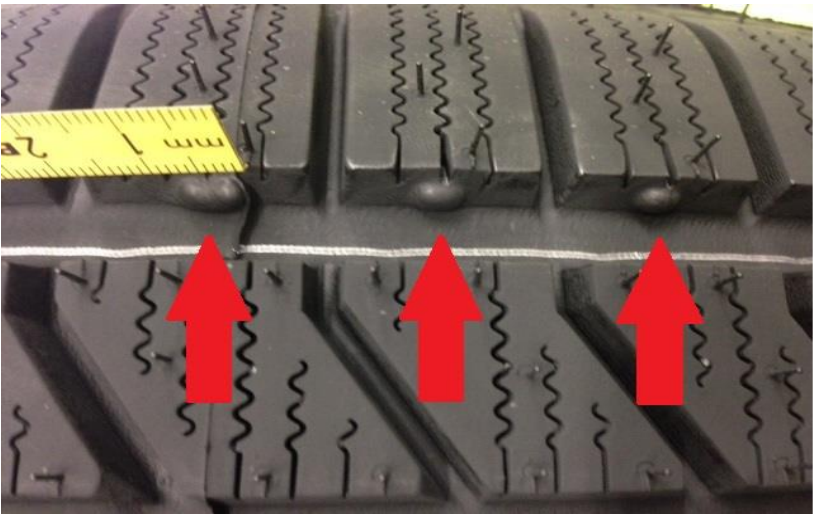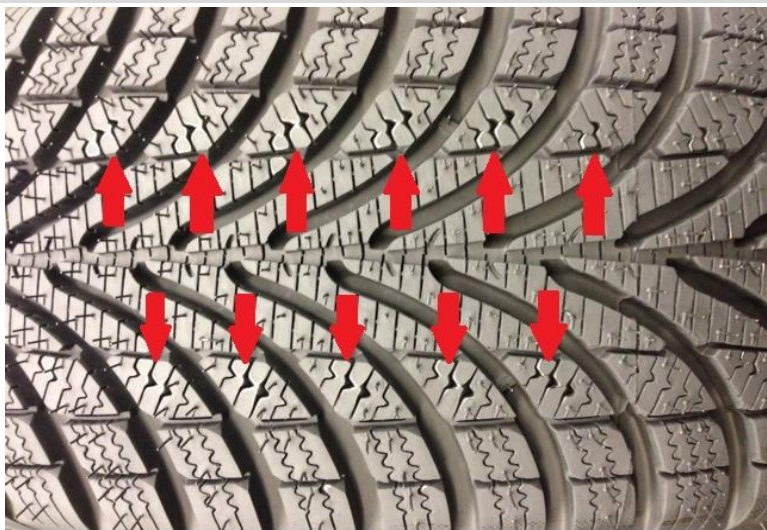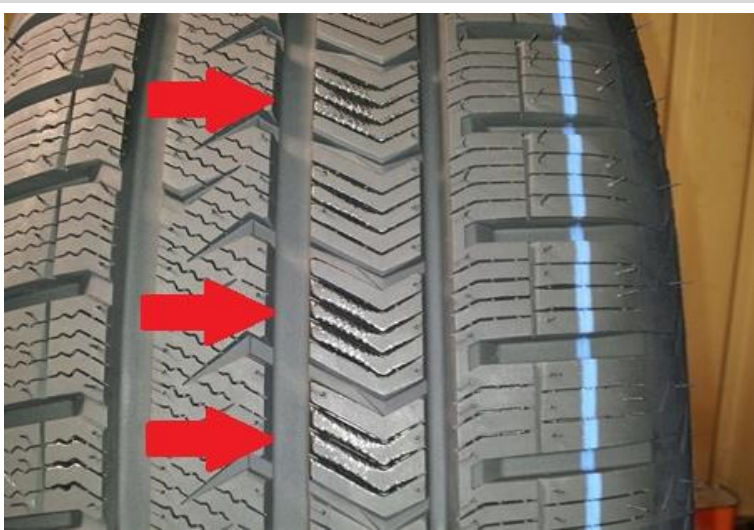
Condition	Description of condition	Action code	Classification		
101	Tread blisters	Action code	OE	Replacement	Scrap
	No blisters in tread	1	X	X	
	Air entrapment between tread and cap strip				X
	Air entrapment between tread and steel belt				X
	 				
102	Tread Lightness	Action code	OE	Replacement	Scrap
	Rounding of imperfection < 2 mm	1	X	X	
	Length of imperfection < 5 mm	1	X	X	
	Max. 2 imperfections in non-successive blocks	1	X	X	
	Max. 3 imperfections	3		X	
	More than above				X
	5 or more imperfections which are longer than 10mm and rounded 5 mm				X
	 				
103	Segment to segment flash (radial flash)	Action code	OE	Replacement	Scrap
	Thickness of flash < 0.5 mm	1	X	X	
	Height of flash < 0.5 mm	1	X	X	
	Height of flash between 0.5 mm and 1 mm	1		X	
	Height of flash between 1 mm and 15 mm	2		X	
	More than above				X
	*all flash that seals off a groove must be cut				
	 				

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

104	Two piece mold circumferential flash	Action code	OE	Replacement	Scrap
	Thickness of flash < 1 mm	1	X	X	
	Height of flash < 2 mm	1	X	X	
	Height of flash between 2 and 5 mm	2	X	X	
	More than above				X



105	Missing sipes in tread block	Action code	OE	Replacement	Scrap
	Missing sipes max. 4 (extra rubber / no groove)	1	X	X	
	Any successive sipes missing				X
	More than above				X

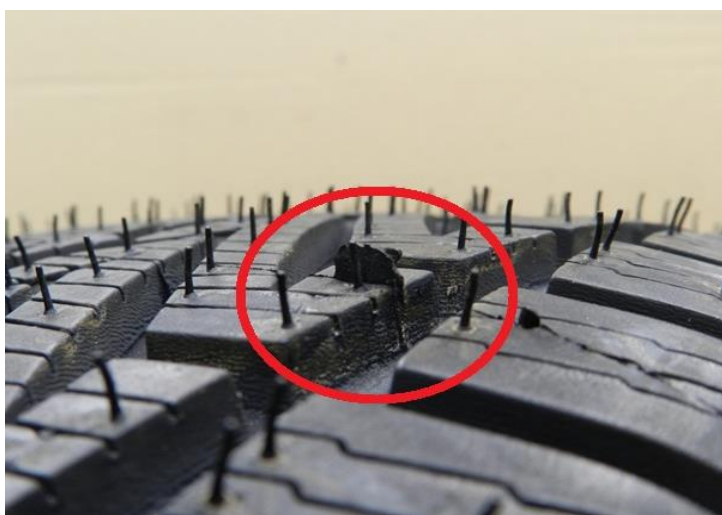

106	Tread ID line imperfections	Action code	OE	Replacement	Scrap
	Straight ID line over tread blocks	1	X	X	
	Straight ID line in design groove or groove with TWI	1		X	
	Waviness of ID line < 5 mm	1	X	X	
	Waviness of ID line < 10 mm	1		X	
	Waviness of ID line, more than 10mm	3		X	
	ID line up to 1/4 of circumference missing	1	X	X	
	ID line more than 1/4 of circumference missing	1		X	
	Staining up to 3 mm in diameter on up to 2 locations	1	X	X	
	Staining more than above	3		X	




Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal


107	Cord visible on tread	Action code	OE	Replacement	Scrap
	Cords can be felt but are not visible	1	X	X	
	Cord visible (rubberized or not)				X



108	Tread splice imperfections	Action code	OE	Replacement	Scrap
	Area of imperfection < 10 x 5 mm	4, 6		X	
	Depth of imperfection < 5 mm	4, 6		X	
	More than above				X

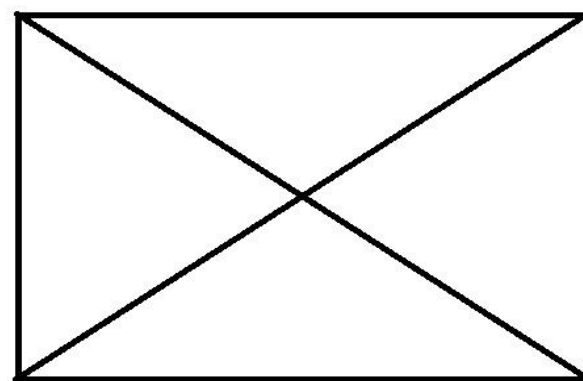

109	Tread Chipping	Action code	OE	Replacement	Scrap
	Length of imperfection < 3 mm	1	X	X	
	Depth of imperfection < 0.5 mm	1	X	X	
	Number of imperfection max. 4	1	X	X	
	Length of imperfection < 6 mm	1			X
	Depth of imperfection < 2 mm	1			X
	Number of imperfection max. 8	1			X
	More than above				X

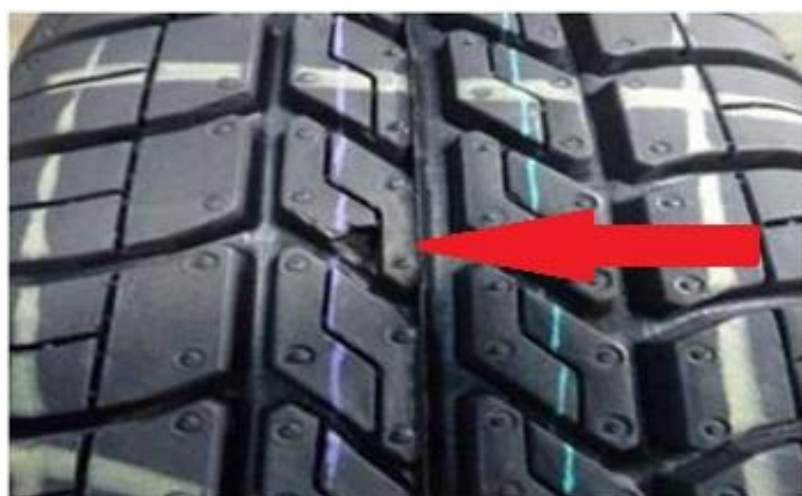


Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

110	Trimming imperfections	Action code	OE	Replacement	Scrap
	Height of all tread and shoulder ventings < 2 mm	1	X	X	
	Number of tread and shoulder ventings with height between 2 and 3 mm max. 5	1	X	X	
	Height of any tread or shoulder venting > 3 mm	2	X	X	
	Depth of imperfections due to trimming < 0.5 mm	4		X	
	Width of imperfections due to trimming < 5 mm	4		X	
	Number of imperfections due to trimming max. 3	4		X	
	Missing spring or micro venting insert	2	X	X	
	Edge of tread block damaged due to trimming				X
	More than above				X



111 *CC	Single belt	Action code	OE	Replacement	Scrap
	If single belt appears (Tyre is lighter and has less resistance when pushed on the tread in relation to a correct one)				X


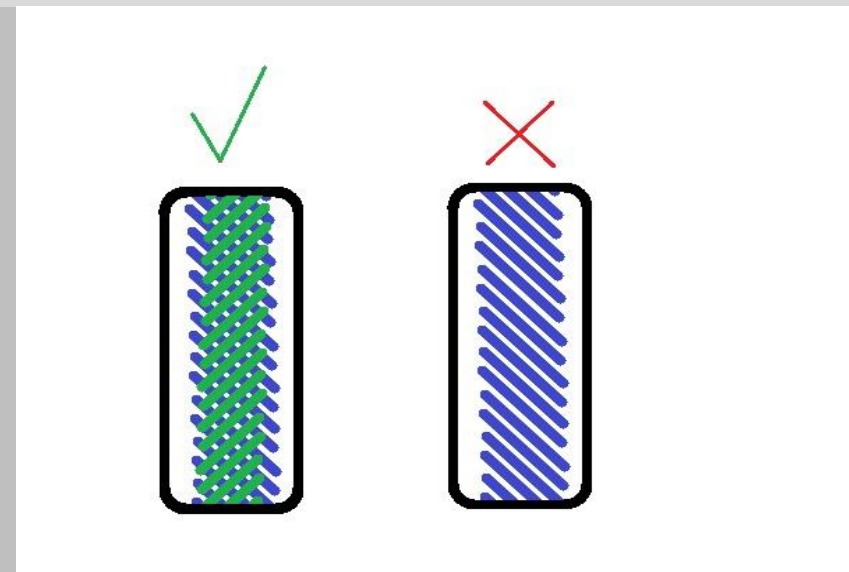


112 *CC	Parallel Belt	Action code	OE	Replacement	Scrap
	If parallel belt appears (Tyre looks flatter and has less resistance when pushed on the tread in relation to a correct one)				X





Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

113	Segment to segment radial step off	Action code	OE	Replacement	Scrap
	Radial step off > 0 mm				X

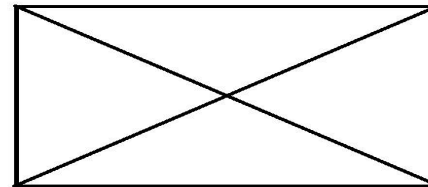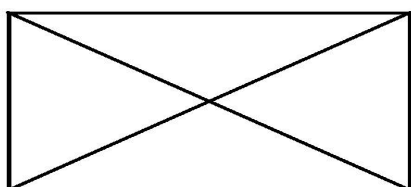


114	Segment to segment lateral step off	Action code	OE	Replacement	Scrap
	Lateral step off < 0.5 mm	1	X	X	
	More than above				X

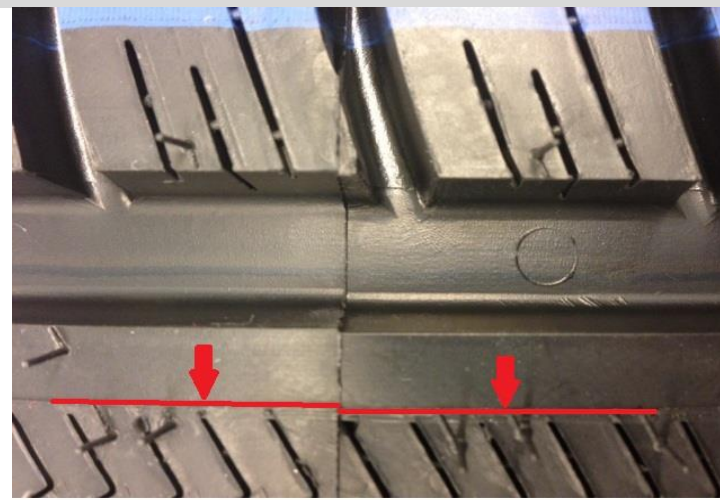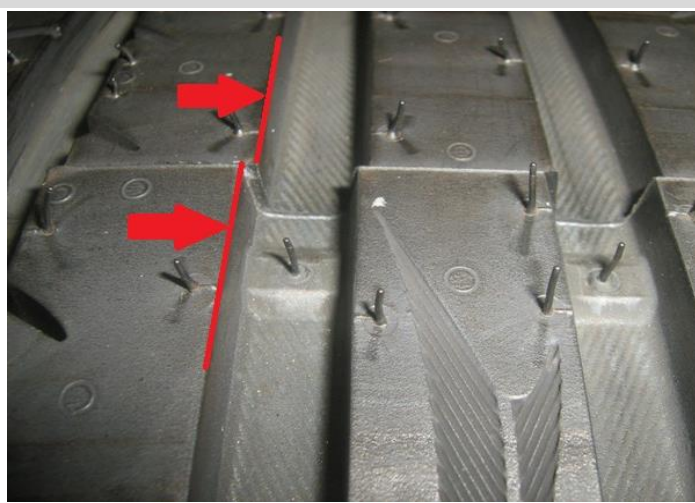

115	Mold step off in two piece mold	Action code	OE	Replacement	Scrap
	Step off < 0.5 mm	1	X	X	
	Step off between 0.5 and 1 mm	1		X	
	More than above				X



116	Package off	Action code	OE	Replacement	Scrap
	Section package off up to 1/2 circumferential				X
	If package off appears				X

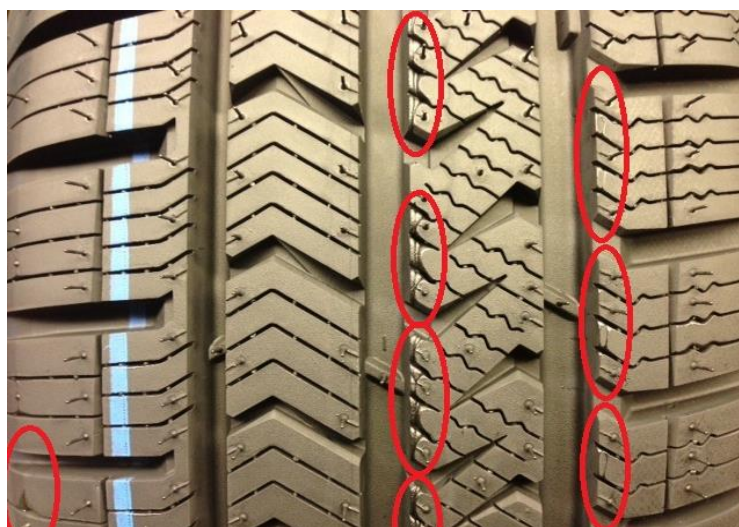

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

201	Shoulder blister	Action code	OE	Replacement	Scrap
	SOT construction: Location of complete blister <10mm from shoulder splice	2		X	
	SOT construction: Diameter of blister < 5 mm	2		X	
	SOT construction: If depth after rework < 1 mm	2		X	
	SOT construction: More than above				X
	If shoulder blister appears				X



202	Shoulder lightness/ crack	Action code	OE	Replacement	Scrap
	Depth of imperfection < 0.5 mm	3, 4		X	
	Separation between two layers				X
	More than above				X



203	Segment to SW flash (circumferential flash)	Action code	OE	Replacement	Scrap
	Thickness of flash < 1 mm	1	X	X	
	Height < 0.5 mm	1	X	X	
	Height between 0.5 mm and 10 mm	2	X	X	
	More than above				X



Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

204	Shoulder step off	Action code	OE	Replacement	Scrap
	Sectional width < 185 mm: step off < 1 mm	1	X	X	
	Sectional width 185mm and above: step off < 1.5 mm	1	X	X	
	More than above				X




207	Loose cord through shoulder	Action code	OE	Replacement	Scrap
	Loose cord (nylon or steel) through shoulder				X



301	Sidewall blister	Action code	OE	Replacement	Scrap
	Diameter of imperfection < 5 mm	1	X	X	
	Height of imperfection < 0.5 mm	1	X	X	
	Number of imperfections per side max. 1	1	X	X	
	More than above				X




302	Sidewall lightness	Action code	OE	Replacement	Scrap
	If faint shiny appearance with no depth	1	X	X	
	Depth of imperfection < 0.5 mm	4		X	
	Number of imperfections per side max. 2	4		X	
	Depth of imperfection between 0.5 and 1 mm				X
	If legal engraving is missing				X
	More than above				X

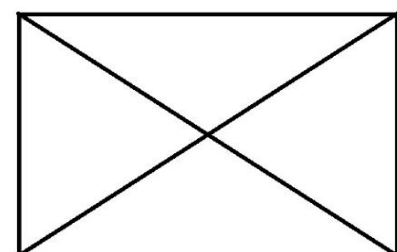

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal



303	Insert flash	Action code	OE	Replacement	Scrap
	Flash thickness < 0.5 mm	1	X	X	
	Flash height < 1 mm	1	X	X	
	More than above	2		X	

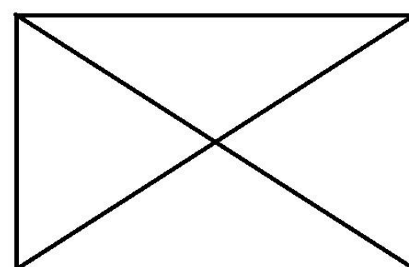


304	Insert misalignment	Action code	OE	Replacement	Scrap
	Misalignment < 0.5 mm	1	X	X	
	Misalignment between 0.5 and 2 mm	1		X	
	More than above				X



305	Wrong insert	Action code	OE	Replacement	Scrap
	Blank or incorrect insert	4, 7		X	

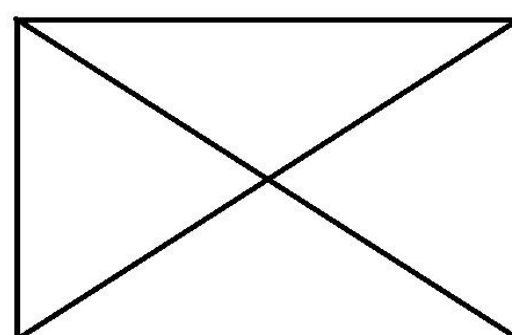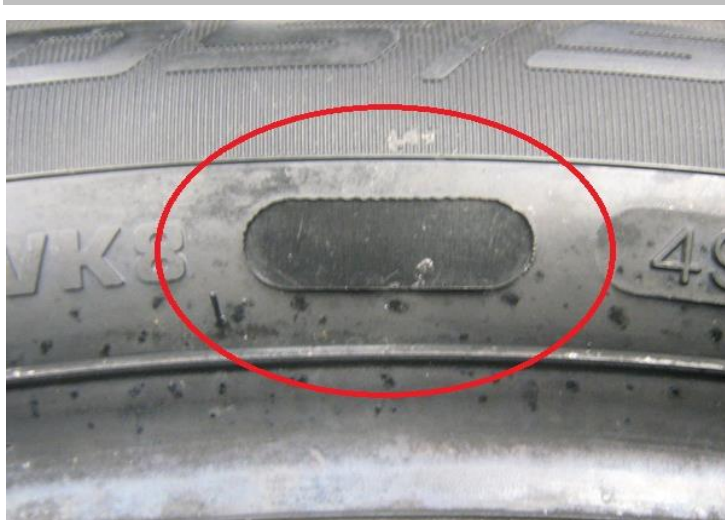


306	Missing insert	Action code	OE	Replacement	Scrap
	No insert in the cavity				X

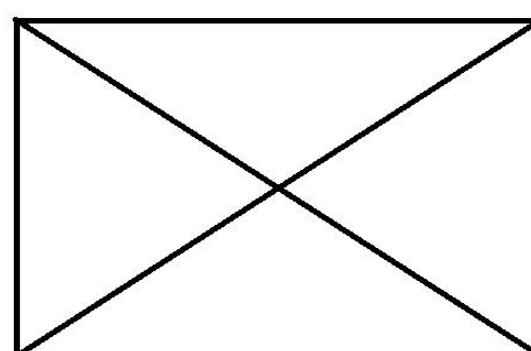


Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

308 *CC	Sidewall splice imperfections	Action code	OE	Replacement	Scrap
	Length of imperfection < 5 mm	4		X	
	Depth of imperfection < 0.5 mm	4		X	
	If legal engraving is missing	7			X
	More than above				X

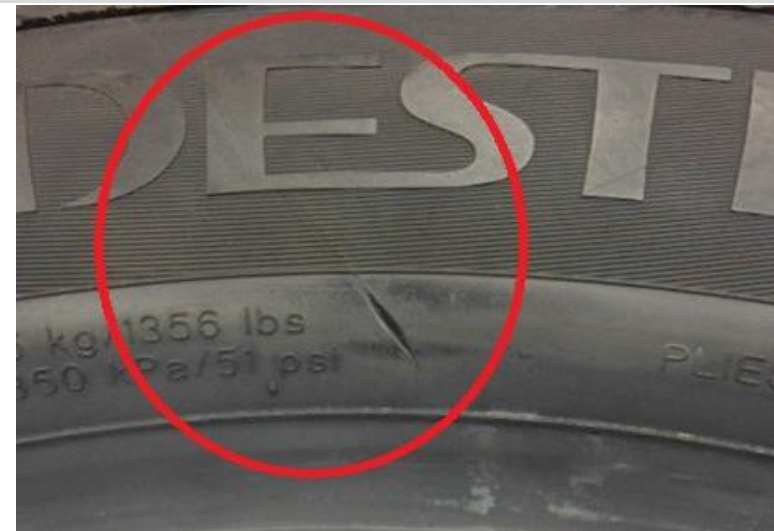

309	Pitted/ rough side wall	Action code	OE	Replacement	Scrap
	Surface of imperfection < 0.5 mm raised/depressed	1	X	X	
	Max. area of imperfections 25 x 25 mm	1	X	X	
	More than above				X

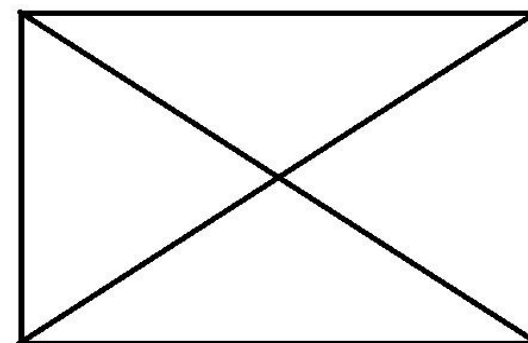


401	Bead blister	Action code	OE	Replacement	Scrap
	Blister diameter < 4 mm	2		X	
	Blister height max. 2 mm	2		X	
	Number of blister per bead < 5	2		X	
	Blister diameter < 8 mm				X
	Blister height max. 3 mm				X
	Number of blister per bead < 8				X
	Blister depth all the way to the ply cords				X
	More than above				X



Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal


402	Bead/ rim lightness	Action code	OE	Replacement	Scrap
	Length of imperfection < 10 mm	3, 4	X	X	
	Depth of imperfection < 1 mm	3, 4		X	
	Depth of imperfection < 2 mm	3, 4			
	More than above				X

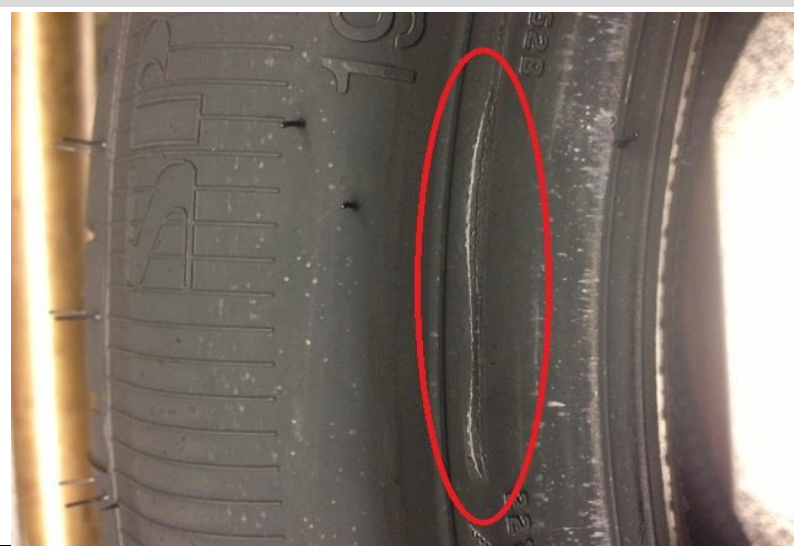





403	Mould and bead ring parting line flash	Action code	OE	Replacement	Scrap
	Flash thickness < 0.5 mm	1	X	X	
	Flash height < 1 mm	1	X	X	
	More than above	2		X	



404	Pinched bead/ toe flash	Action code	OE	Replacement	Scrap
	Height of bead flash < 1 mm (bladder groove excluded)	1	X		
	Height of bead flash < 5 mm	2		X	
	Height of bead flash < 10 mm				X
	More than above				X

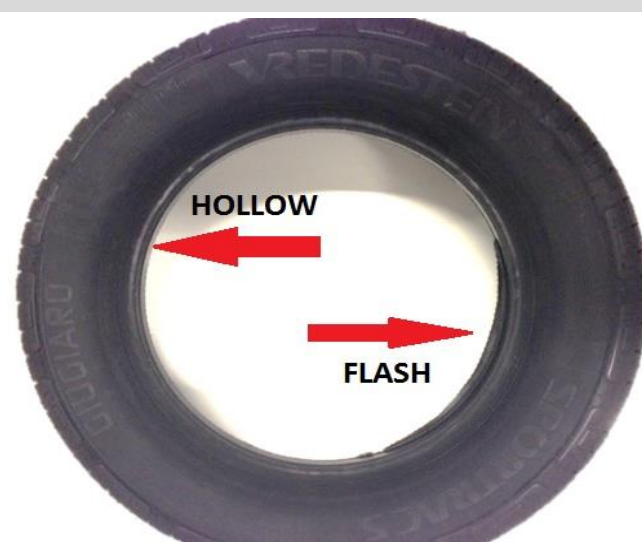


Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

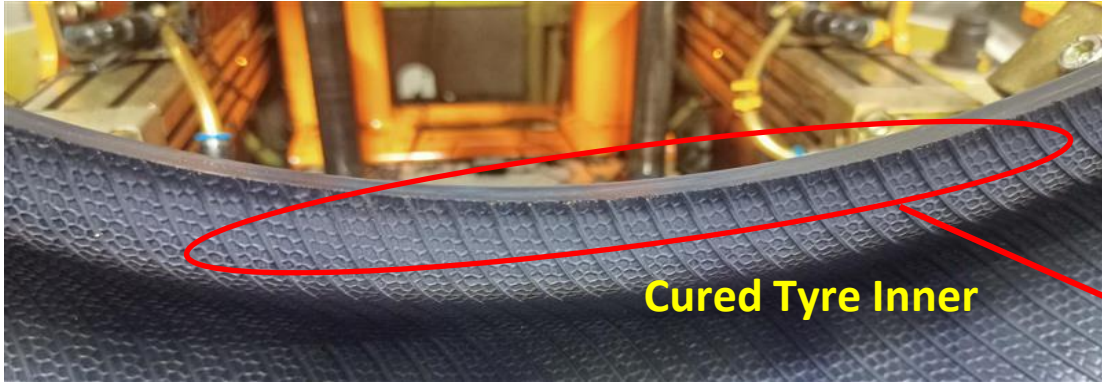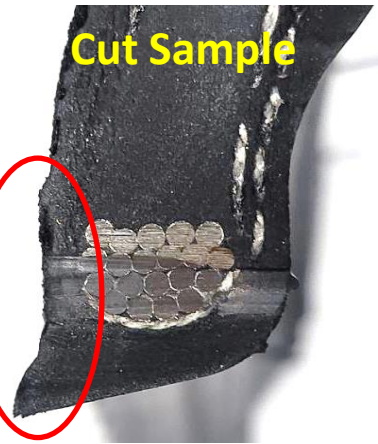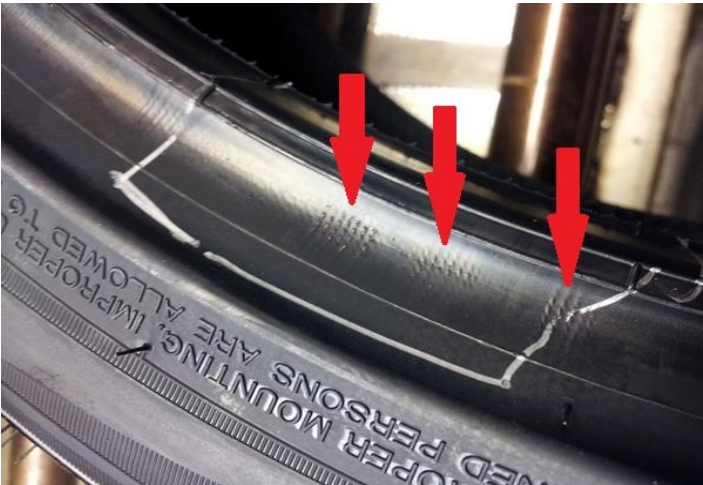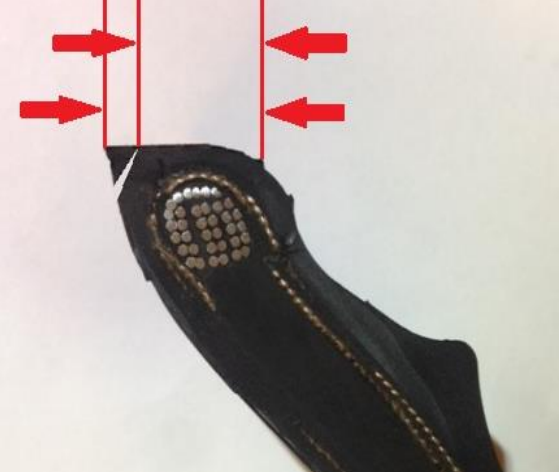
405	Hollow Bead Imperfection	Action code	OE	Replacement	Scrap
	Hollow (Concave surface / Indentation / Depression) at bead on inner liner side (near bead toe) at particular location or in full circumference	1			X
  Concave Surface / Indentation / Depression					
406	Bent bead	Action code	OE	Replacement	Scrap
	Deformation < 2 mm	2		X	
	Maximal number of bents per 2 per bead	2		X	
	More than above				X
 					
407	Bare cord in bead / bead cord visible	Action code	OE	Replacement	Scrap
	Cords can be felt but are not visible	1	X	X	
	Cords visible (rubberized or not)				X
 					
408	Toe crack / bead crack	Action code	OE	Replacement	Scrap
	Length of imperfection < 100 mm	1		X	
	Decrease in taper width < 2 mm	2		X	
	More than above				X
 					

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

409	Dent and pimple in bead ring	Action code	OE	Replacement	Scrap
	Size of imperfections < 5 x 5 x 0.5 mm	1	X	X	
	up to 3 imperfections	1		X	
	4 or 5 imperfections				X
	Number or size more than above				X

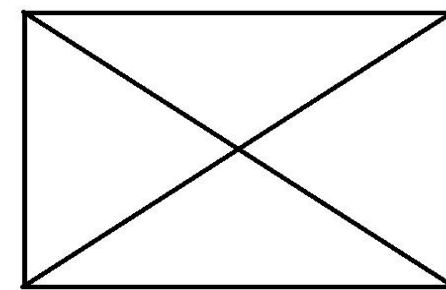

410	Bead step off	Action code	OE	Replacement	Scrap
	Step off < 1 mm	1	X	X	
	More than above				X

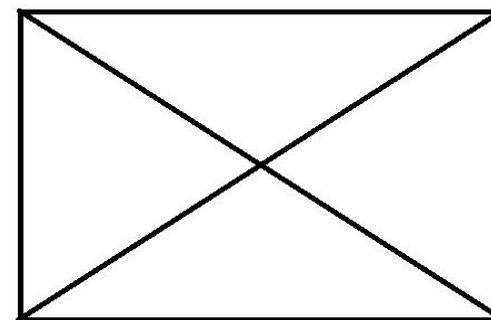







411	Trapped bead/ Loaded on bladder	Action code	OE	Replacement	Scrap
	In all cases				X



412	Barcode imperfections	Action code	OE	Replacement	Scrap
	Barcode is placed between taper and rim line	1	X	X	
	Length of material flow over barcode < 2 mm	1	X	X	
	Angle misplacement < 15 degrees	1		X	
	Folded barcode	8		X	
	More than above	8		X	




Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

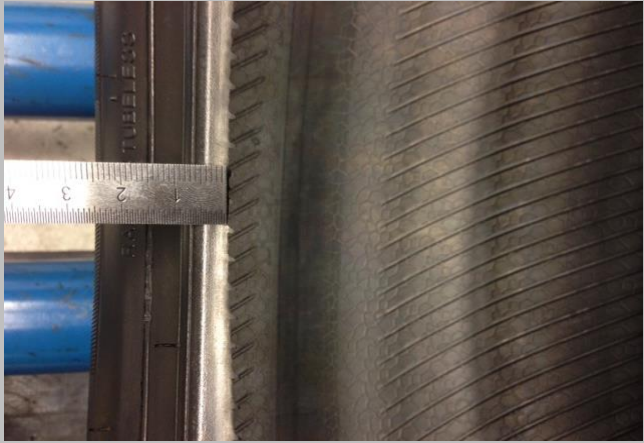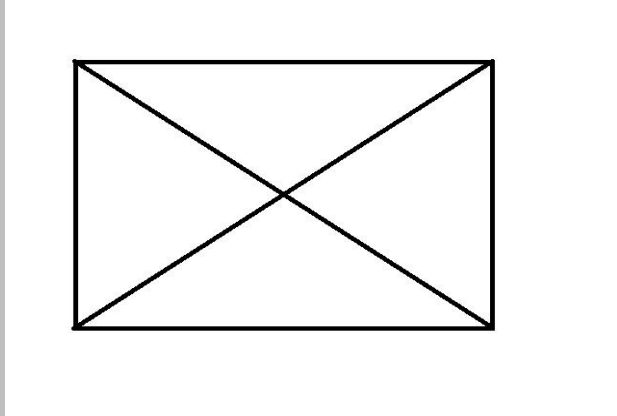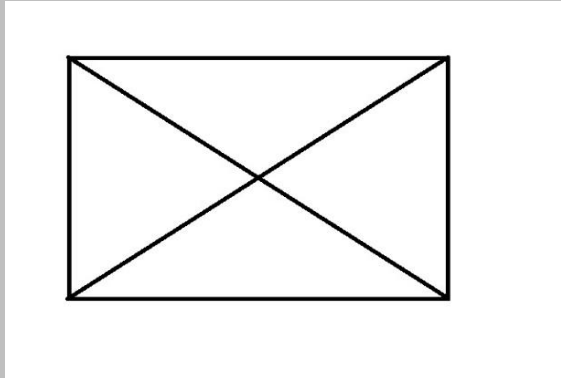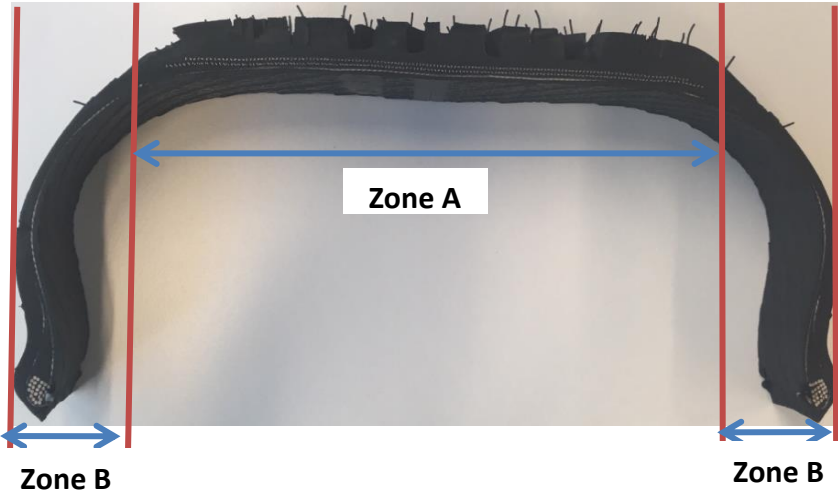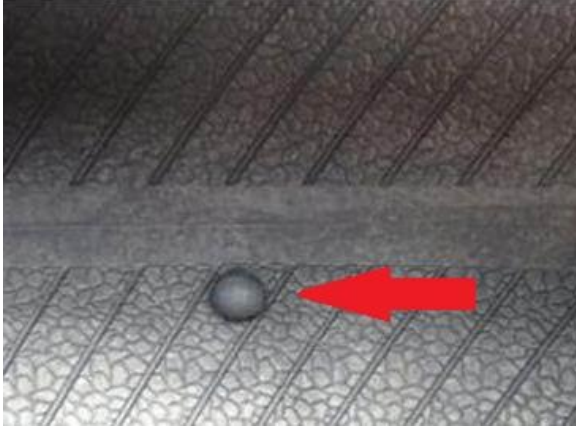
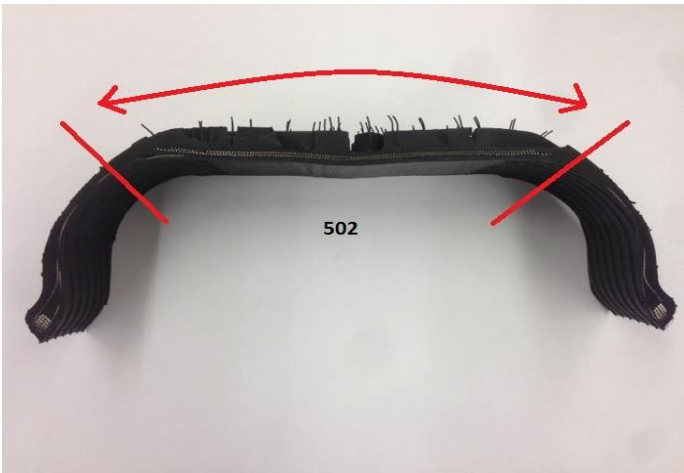
414	Narrow Bead	Action code	OE	Replacement	Scrap
	Difference in width of SS & NSS bead (Heel to Toe) < 2mm More than above  	1		X	X
415	Round Bead	Action code	OE	Replacement	Scrap
	Rounding of bead toe < 2 mm, no exposer / damage of cord More than above  	1		X	X
501	Inner liner blister	Action code	OE	Replacement	Scrap
	Zone B: Diameter of blister < 3 mm, height < 2 mm and number of blisters maximum 3 (All three conditions must be true) Zone B & A: Diameter of blister > 3 mm and < 15 mm or number of blisters > 3 and < 6 Zone B & A: Diameter of blister > 15 mm or number of blisters > 6   	1		X	
		5		X	
					X
502	Ply blister, shoulder and tread area	Action code	OE	Replacement	Scrap
	In all cases  				X

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

503	Ply blister, shoulder and tread area	Action code	OE	Replacement	Scrap
	In all cases				X

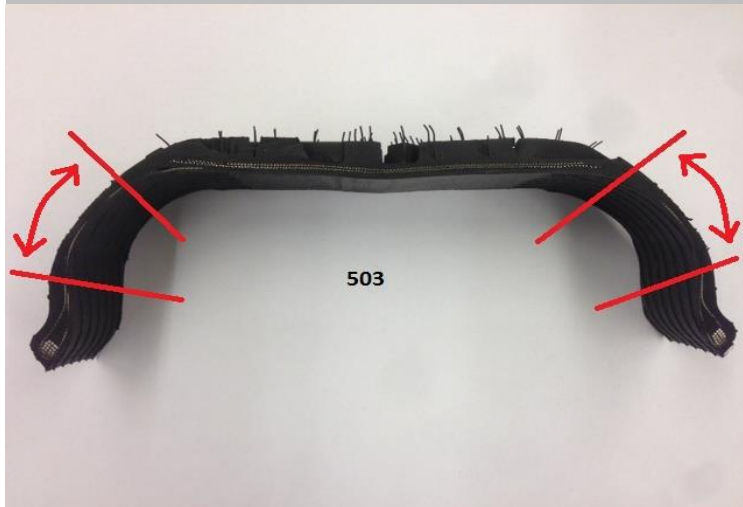


504	Ply blister, shoulder and tread area	Action code	OE	Replacement	Scrap
	In all cases				X

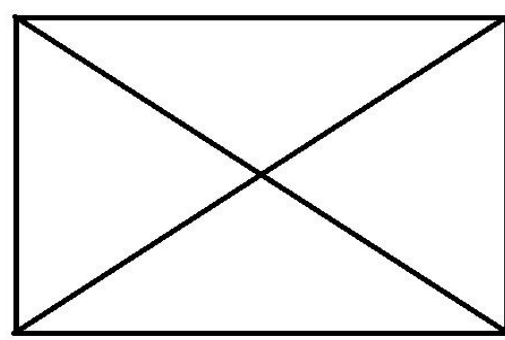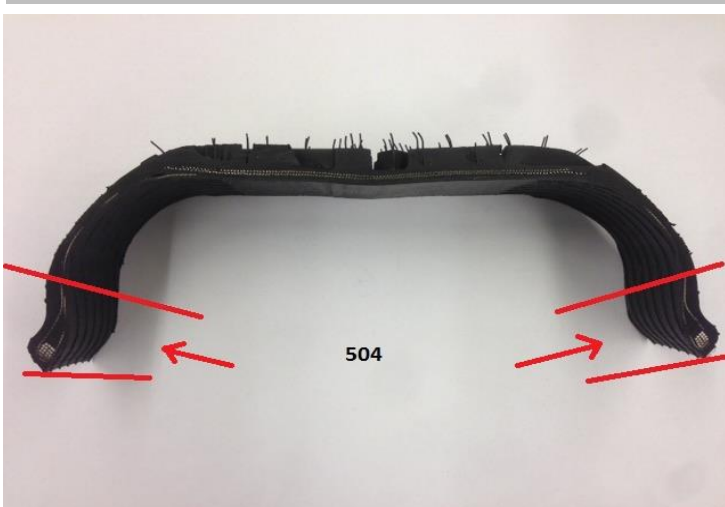





505	Air bridging problem/ bladder not touch	Action code	OE	Replacement	Scrap
	Shiny appearance on top of bladder ribs	1	X	X	
	Depth of imperfection < bladder profile	1		X	
	More than above	10		X	X



506 *CC	Bladder leak	Action code	OE	Replacement	Scrap
	In all cases				X

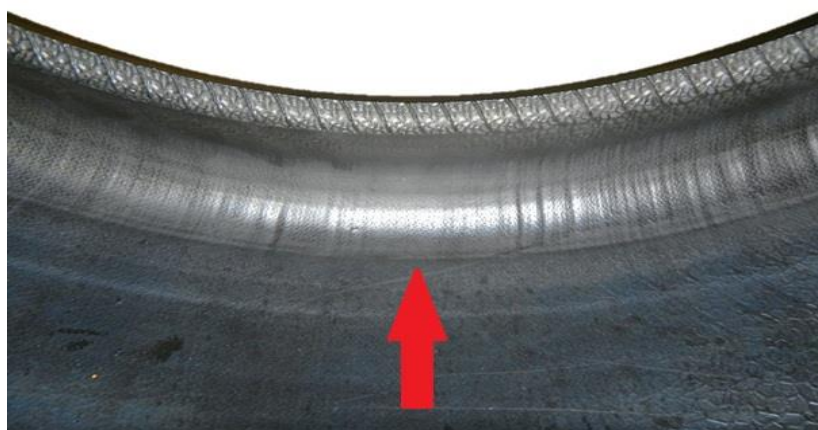


Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

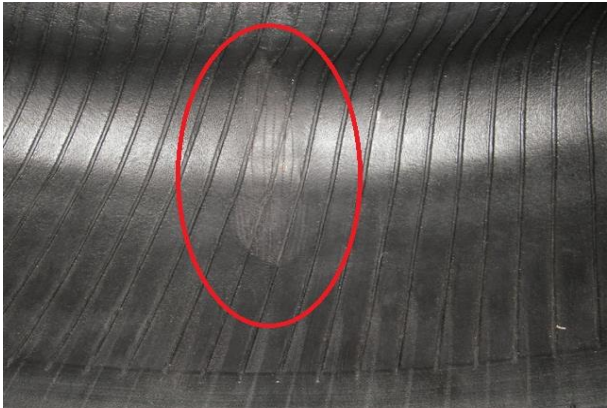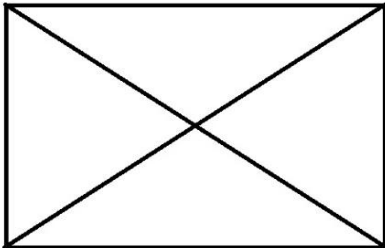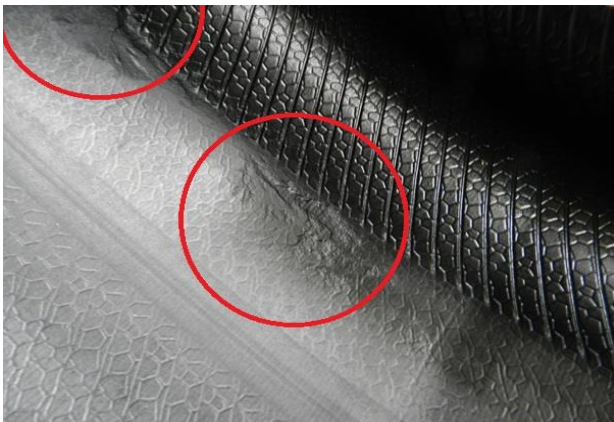
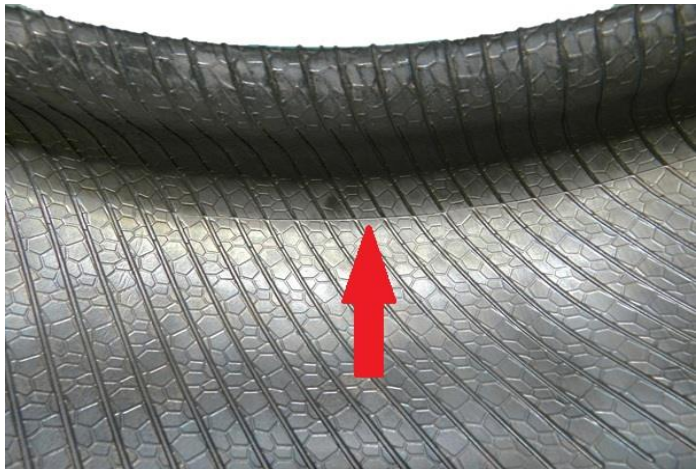
507	Cord visible through inner liner	Action code	OE	Replacement	Scrap
	Cord visible (rubberized or not)				X
	Section analysis: > 0.55 mm inner liner over cords	1	X	X	
					
					
508	Inner liner splice imperfections	Action code	OE	Replacement	Scrap
	Overlap splice < 10 mm	1	X	X	
	Overlap splice < 30 mm	6	X	X	
	Hair line crack < 0.5 mm wide	1	X	X	
	Open inner liner splice				X
	More than above				X
					
					
509	Inner liner imperfections	Action code	OE	Replacement	Scrap
	Size of imperfection < 20 x 20 mm	1		X	
	Number of imperfections max. 3	1		X	
	Peel off (inner liner stuck to bladder)				X
	Section analysis: > 0.55 mm inner liner over cords	1		X	
	More than above				X
	Inner liner delamination				X
					
					
510	Inner liner crack	Action code	OE	Replacement	Scrap
	In all cases				X
					
					

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal



512 *CC	Ply splice imperfections	Action code	OE	Replacement	Scrap
	Overlap splice < 10 mm	1	X	X	
	Overlap splice < 20 mm	6	X	X	
	Missing cord				X
	Open ply splice				X
	More than above				X

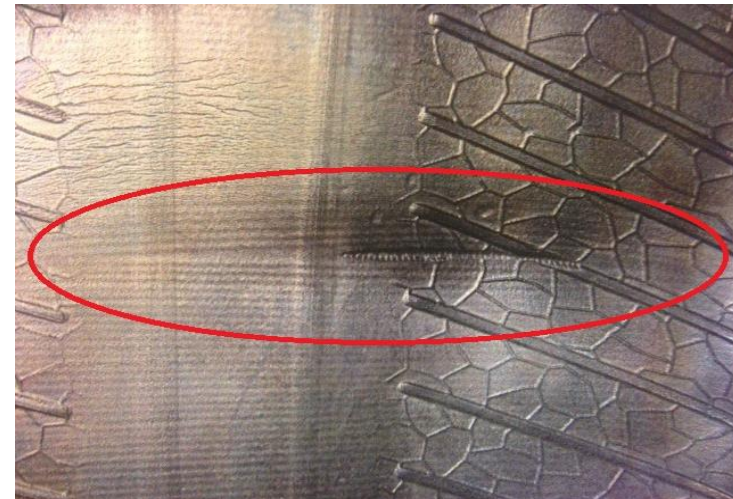



513	Ply split/ split fabric	Action code	OE	Replacement	Scrap
	Depth of imperfection < bladder profile	1	X	X	
	Depth of imperfection in flat surface < 0.2 mm	1		X	
	More than above or cord visible				X

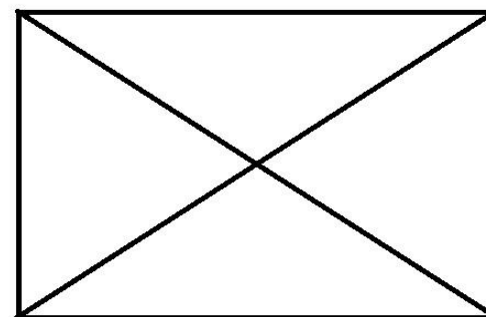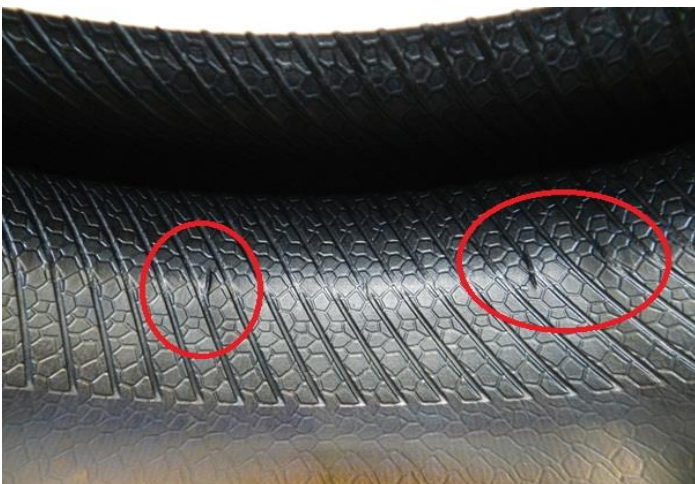

514	Chafer splice imperfections	Action code	OE	Replacement	Scrap
	Chafer splice hump < 6 mm	1	X	X	
	Chafer splice hump in bead sitting area				X
	Chafer splice is open				X
	More than above				X

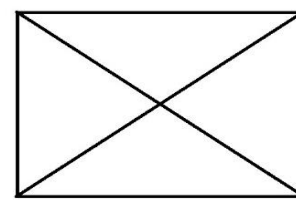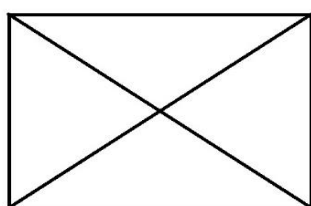


515	Cap ply splice imperfections	Action code	OE	Replacement	Scrap
	Cap ply splice < 25 mm	1	X	X	
	Cap ply splice < 35 mm	1		X	
	Open cap ply splice				X
	More than above				X

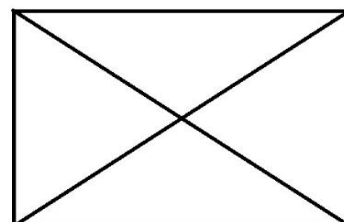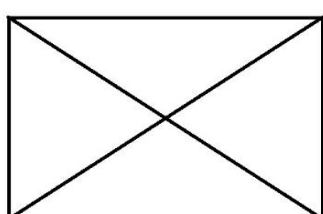

Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal


516	Belt imperfections	Action code	OE	Replacement	Scrap
	Width of diagonal imperfection < 2 mm	1	X	X	
	More than above	6		X	
	Loose cord	6		X	

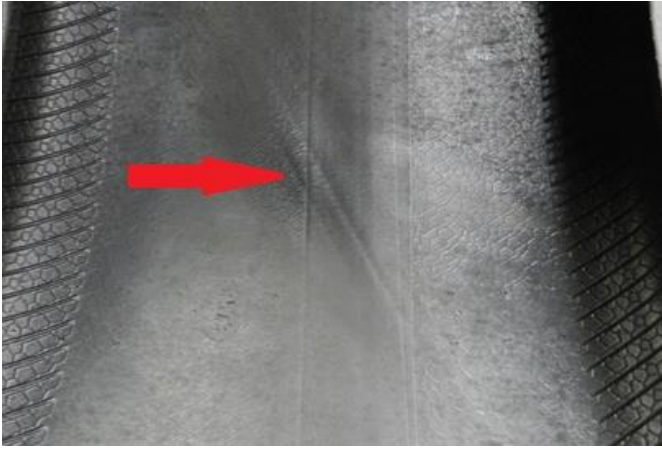




517	Bladder fold	Action code	OE	Replacement	Scrap
	In all cases				X




518	Material fold (cap ply/ cap strip/ ply/ inner liner)	Action code	OE	Replacement	Scrap
	Width of bump < 10 mm	1	X	X	
	Height of bump < 0.5 mm	1	X	X	
	More than above				X

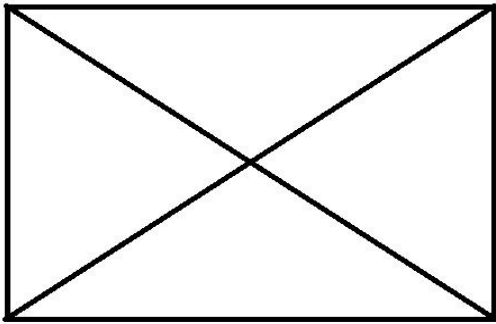



519	Reverse hump	Action code	OE	Replacement	Scrap
	Width of hump < 10 mm	1	X	X	
	Width of hump < 15 mm	6		X	
	More than above				X

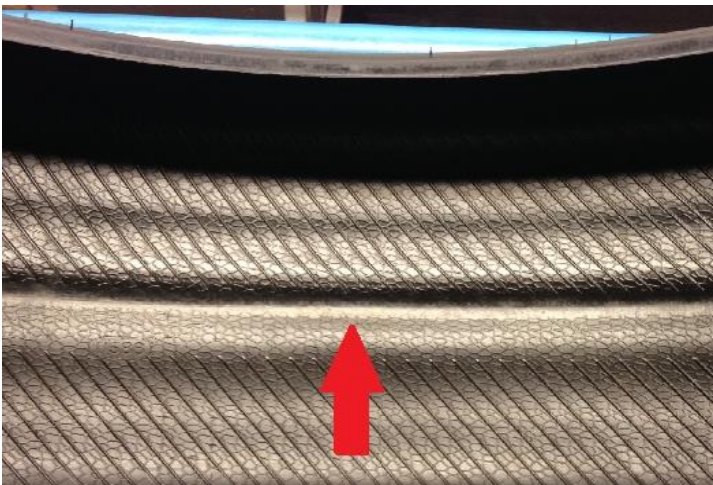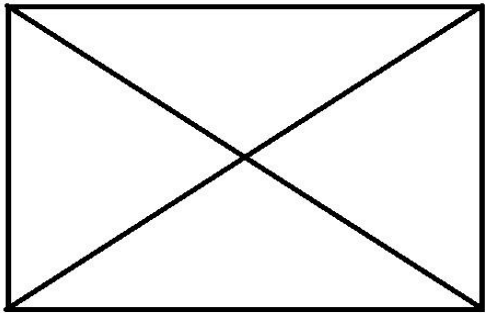Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

601	Double moulding	Action code	OE	Replacement	Scrap
	In all cases				X

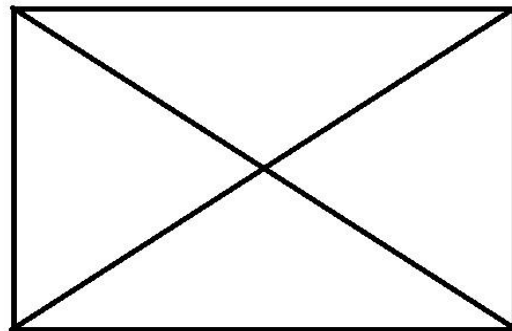



602	Damaged tyre during curing cycle	Action code	OE	Replacement	Scrap
	If a damaged tyre appears				X



603	Damaged tyre during dry cycle	Action code	OE	Replacement	Scrap
	If a damaged tyre appears				X




604	Press late open	Action code	OE	Replacement	Scrap
	Extension of cycle time < 3 minutes	1		X	
	More than above				X
	*indicated by production or logging system				

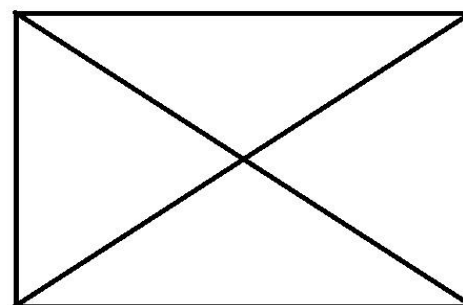
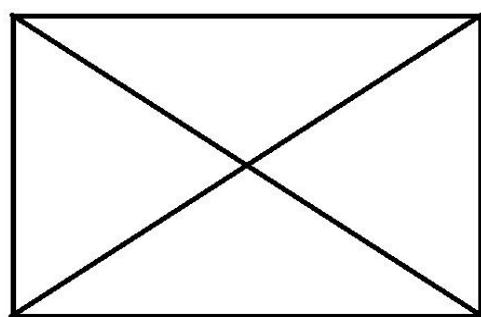


Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal


605 *CC	Visible under cure	Action code	OE	Replacement	Scrap
	In all cases				X

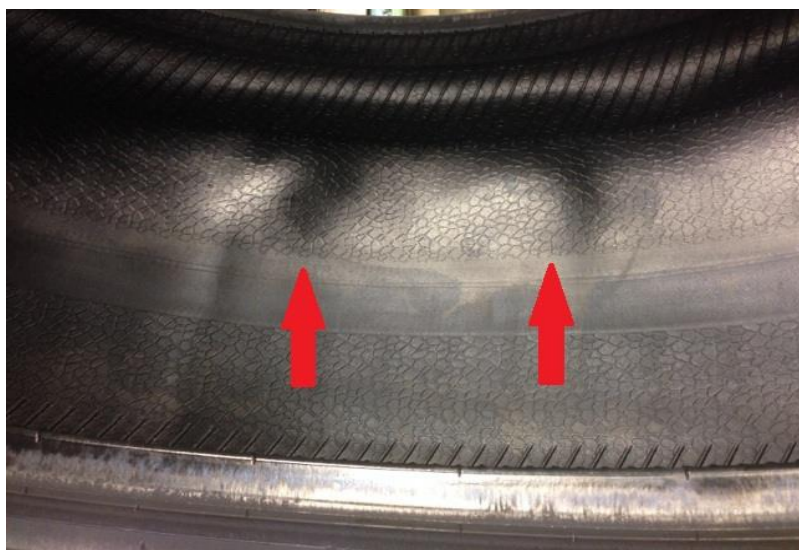


606	Curing irregularities related to the curing equipment	Action code	OE	Replacement	Scrap
	If curing irregularities appear				X

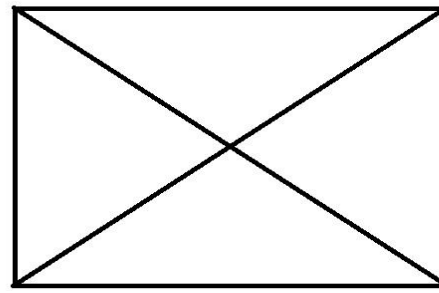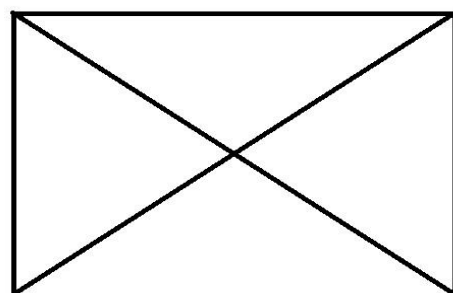

607 *CC	Wrong moulding	Action code	OE	Replacement	Scrap
	If wrong greentyre/ mould combination appears				X

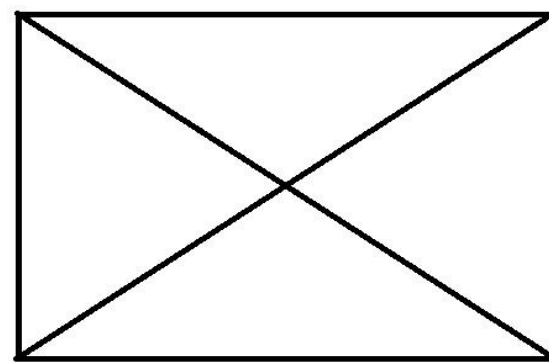


608	Asymmetrical tyre cured upside down	Action code	OE	Replacement	Scrap
	Non- W-,Y-tyre	6		X	
	W-, or Y-tyre				X

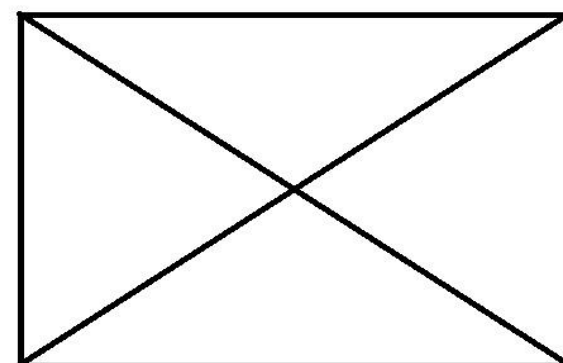



Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

609	Tyre waviness	Action code	OE	Replacement	Scrap
	If tyre waviness appears				X

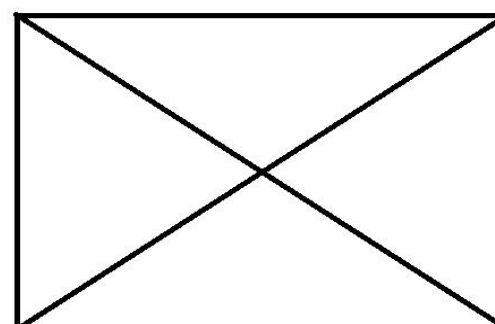

610	Off standard green tyre	Action code	OE	Replacement	Scrap
	If off standard greentyre appears				X

For instance: missing or incorrect component

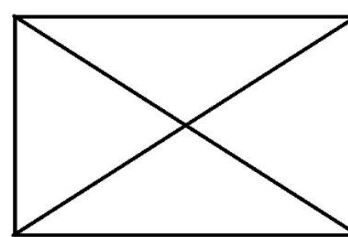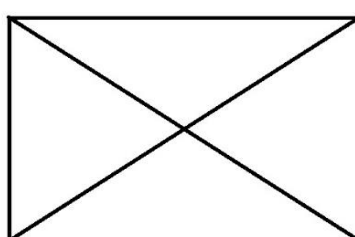

701	Foreign Material - Dirty Mould	Action code	OE	Replacement	Scrap
	Area of imperfection < 10 x 10 mm	4		X	
	Depth/ or height of imperfection < 0.5 mm	4		X	
	Depth/ or height of imperfection < 1 mm				X
	More than above				X



705	Foreign Material - lubricant	Action code	OE	Replacement	Scrap
	Size of imperfection with no depth < 20 x 20 mm	2, 3, 4	X	X	
	Number of imperfections < 5	2, 3, 4	X	X	
	Depth of imperfection < 0.5 mm				X
	Lubricant between layers				X
	More than above				X



Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

706	Foreign Material - in the inner liner	Action code	OE	Replacement	Scrap
	Size of imperfection < 20 x 20 x 0.2 mm	1		X	
	Number of imperfections max. 5	1		X	
	Location of imperfection under steel belts	1		X	
	Imperfection causing a puncture in the inner liner				X
	More than above				X



707	Foreign Material - Recured rubber	Action code	OE	Replacement	Scrap
	Area of imperfection < 10 x 10 mm	4		X	
	Depth of imperfection < 0.5 mm	4		X	
	Area of imperfection < 30 x 30 mm				X
	Depth of imperfection < 2 mm				X
	More than above				X





Document Name	Global Off Standard Catalogue for PCR Tyres	Date of Release	05/07/2023
Document No.	SOP-GQ&BE-001	Date of Applicability	17/07/2023
Revision No.	03	Process Owner	Corporate
Document Status	Approved	Security Classification	Internal

708	Foreign Material - Various	Action code	OE	Replacement	Scrap
	Area of imperfection < 10 x 10 mm	4		X	
	Depth of imperfection < 0.5 mm	4		X	
	Area of imperfection < 30 x 30 mm				X
	Depth of imperfection < 2 mm				X
	More than above				X



7.0 Version History:

Ver. No.	Description	Date
1	Initial release of global Off standard catalogue	15/07/2016
2	Condition 106 - Added rework with action code 3 and changed disposition to replacement. Condition 110 - Added Trimming Imperfection "Missing spring or micro venting insert". Condition 202 - Action code changed from 2 to 3,4. Removed action code 1 which is not applicable for scrap. Condition 402 - Action code changed from 2 to 3,4. Condition 501 - Description changed by adding zones. Action code changed from 1 to 5. Condition 705 - Added action code 3,4.	20/08/2018
3	DA category removed (condition 102, 109, 116, 302, 305, 401, 404, 409, 701, 705, 707, 708) Condition 405 - Criteria for hollow bead imperfection revised. Tyres having hollow bead shall be scrapped. Condition 414 - narrow bead and condition 415 - round bead added. Description added for condition 105 Criteria for condition 516 updated All changes have been highlighted with blue font.	05/07/2023

Originated by		Approved by	
Name	Function:	Name	Designation:
Saurabh Tripathi	Div. Head Corporate Quality	Yoichi (Joe) Sato	Chief Quality Officer
Arpit Upadhyay	Sr. Manger - Corporate Quality		
FR-GQ&BE-001 / 03 / 02.09.2021			