


### LIS3DSH

# MEMS digital output motion sensor: ultra-low-power high-performance three-axis "nano" accelerometer

Datasheet - production data

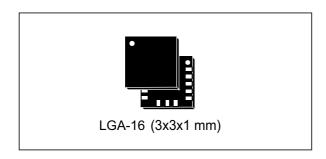

#### **Features**

- Wide supply voltage, 1.71 V to 3.6 V
- Independent IOs supply (1.8 V) and supply voltage compatible
- Ultra-low power consumption
- ±2g/±4g/±6g/±8g/±16g dynamically selectable full scale
- I<sup>2</sup>C/SPI digital output interface
- 16-bit data output
- · Programmable embedded state machines
- Embedded temperature sensor
- · Embedded self-test
- Embedded FIFO
- 10000 g high shock survivability
- ECOPACK®, RoHS and "Green" compliant

### **Applications**

- Motion-controlled user interface
- Gaming and virtual reality
- Pedometers
- Intelligent power saving for handheld devices
- Display orientation
- Click/double-click recognition
- · Impact recognition and logging
- · Vibration monitoring and compensation

### **Description**

The LIS3DSH is an ultra-low-power highperformance three-axis linear accelerometer belonging to the "nano" family with an embedded state machine that can be programmed to implement autonomous applications.

The LIS3DSH has dynamically selectable full scales of  $\pm 2g/\pm 4g/\pm 6g/\pm 8g/\pm 16g$  and is capable of measuring accelerations with output data rates from 3.125 Hz to 1.6 kHz.

The self-test capability allows the user to check the functioning of the sensor in the final application.

The device can be configured to generate interrupt signals activated by user-defined motion patterns.

The LIS3DSH has an integrated first-in, first-out (FIFO) buffer allowing the user to store data in order to limit intervention by the host processor.

The LIS3DSH is available in a small thin plastic land grid array package (LGA) and is guaranteed to operate over an extended temperature range from -40 °C to +85 °C.

Table 1. Device summary

Order codes	Temperature range [°C]	Package	Packaging
LIS3DSHTR	-40 to +85	LGA-16	Tape and reel



# Contents

1	Bloc	ck diagram and pin description
	1.1	Block diagram
	1.2	Pin description
2	Mec	hanical and electrical specifications1
	2.1	Mechanical characteristics
	2.2	Electrical characteristics
	2.3	Communication interface characteristics
		2.3.1 SPI - serial peripheral interface
		2.3.2 I <sup>2</sup> C - inter-IC control interface
	2.4	Absolute maximum ratings
	2.5	Terminology 1
		2.5.1 Sensitivity
		2.5.2 Zero-g level
	2.6	Functionality
		2.6.1 Self-test
	2.7	Sensing element
	2.8	IC interface
	2.9	Factory calibration
3	Арр	lication hints
	3.1	Soldering information
4	Digi	tal main blocks
	4.1	State machine
	4.2	FIFO 2
		4.2.1 Bypass mode
		4.2.2 FIFO mode
		4.2.3 Stream mode
		4.2.4 Stream-to-FIFO mode
		4.2.5 Retrieving data from FIFO
5	Digi	tal interfaces
2/53		DocID022405 Rev 2



	5.1	I <sup>2</sup> C seria	l interface .		 	 	. 22
		5.1.1	I <sup>2</sup> C operation		 	 	23
	5.2	SPI bus i	nterface		 	 	. 25
		5.2.1	SPI read		 	 	26
			SPI write				
		5.2.3	SPI read in 3-	wire mode	 	 	28
6	Regis	ter map	oing		 	 	. 29
7	Regis	ter desc	ription		 	 	. 32
	7.1	INFO1 (0	Dh)		 	 	. 32
	7.2	INFO2 (C	Eh)		 	 	. 32
	7.3	WHO_A	M_I (0Fh)		 	 	. 32
	7.4	CTRL_R	EG3 (23h) .		 	 	. 32
	7.5	CTRL_R	EG4 (20h) .		 	 	. 33
	7.6	CTRL_R	EG5 (24h) .		 	 	. 34
	7.7	CTRL_R	EG6 (25h) .		 	 	. 34
	7.8	STATUS	(27h)		 	 	. 35
	7.9	OUT_T (	0Ch)		 	 	. 36
	7.10	OFF_X (	10h)		 	 	. 36
	7.11	OFF_Y (	11h)		 	 	. 36
	7.12	OFF_Z (	12h)		 	 	. 36
	7.13	CS_X (13	3h)		 	 	. 36
	7.14	CS_Y (14	4h)		 	 	. 37
	7.15	CS_Z (15	5h)		 	 	. 37
	7.16	LC (16h -	- 17h)		 	 	. 37
	7.17	STAT (18	Bh)		 	 	. 37
	7.18	VFC_1 (	1Bh)		 	 	. 38
	7.19	VFC_2 (	1Ch)		 	 	. 38
	7.20	VFC_3 (	1Dh)		 	 	. 38
	7.21	VFC_4 (	1Eh)		 	 	. 38
	7.22		1Fh)				
	7.23	OUT_X (	28h - 29h) .		 	 	. 39
	7.24	OUT_Y (	2Ah - 2Bh)		 	 	. 39

DocID022405 Rev 2



7.25	OUT_Z (2Ch - 2Dh)	39
7.26	FIFO_CTRL (2Eh)	40
7.27	FIFO_SRC (2Fh)	40
7.28	CTRL_REG1 (21h)	41
7.29	STx_1 (40h-4Fh)	41
7.30	TIM4_1 (50h)	41
7.31	TIM3_1 (51h)	42
7.32	TIM2_1 (52h - 53h)	42
7.33	TIM1_1 (54h - 55h)	42
7.34	THRS2_1 (56h)	42
7.35	THRS1_1 (57h)	42
7.36	MASK1_B (59h)	43
7.37	MASK1_A (5Ah)	43
7.38	SETT1 (5Bh)	44
7.39	PR1 (5Ch)	44
7.40	TC1 (5Dh-5E)	44
7.41	OUTS1 (5Fh)	45
7.42	PEAK1 (19h)	45
7.43	CTRL_REG2 (22h)	45
7.44	STx_1 (60h-6Fh)	46
7.45	TIM4_2 (70h)	46
7.46	TIM3_2 (71h)	46
7.47	TIM2_2 (72h - 73h)	46
7.48	TIM1_2 (74h - 75h)	46
7.49	THRS2_2 (76h)	47
7.50	THRS1_2 (77h)	47
7.51	MASK2_B (79h)	
7.52	MASK2_A (7Ah)	48
7.53	SETT2 (7Bh)	
7.54	PR2 (7Ch)	
7.55	TC2 (7Dh-7E)	49
7.56	OUTS2 (7Fh)	
7.57	PEAK2 (1Ah)	50



9	Revision history 5
	8.1 LGA-16 package information
8	Package information
	7.58 DES2 (78h)



# List of tables

Table 1.	Device summary	1
Table 2.	Pin description	
Table 3.	Mechanical characteristics	
Table 4.	Electrical characteristics	. 13
Table 5.	SPI slave timing values	. 14
Table 6.	I <sup>2</sup> C slave timing values	
Table 7.	Absolute maximum ratings	
Table 8.	Serial interface pin description	
Table 9.	I <sup>2</sup> C terminology	
Table 10.	SAD+Read/Write patterns	
Table 11.	Transfer when master is writing one byte to slave	
Table 12.	Transfer when master is writing multiple bytes to slave	
Table 13.	Transfer when master is receiving (reading) one byte of data from slave	
Table 14.	Transfer when master is receiving (reading) multiple bytes of data from slave	
Table 15.	Register address map	
Table 16.	INFO1 register default values	
Table 17.	INFO2 register default values	
Table 18.	WHO_AM_I register default values.	
Table 19.	Control register 3	
Table 20.	CTRL REG3 register description	
Table 21.	Control register 4	
Table 22.	CTRL_REG4 register description	
Table 23.	CTRL4 ODR configuration	
Table 24.	Control register 5	
Table 25.	Control register 5 description	
Table 26.	Self-test mode selection	
Table 27.	Control register 6	
Table 28.	Control register 6 description	
Table 29.	Status register.	
Table 30.	Status register description	
Table 31.	OUT_T register	
Table 32.	OUT_T register description.	
Table 33.	Offset X default values	
Table 34.	Offset Y default values	
Table 35.	Offset Z default values	
Table 36.	Constant shift X-axis default values	
Table 37.	Constant shift Y-axis default values	
Table 38.	Constant shift Z-axis default values	
Table 39.	LC_L default values	
Table 40.	LC H default values	
Table 41.	STAT register	
Table 42.	STAT register description	
Table 43.	Vector filter coefficient register 1 default values	
Table 44.	Vector filter coefficient register 2 default values	
Table 45.	Vector filter coefficient register 3 default values	
Table 46.	Vector filter coefficient register 4 default values	
Table 47.	Threshold value register 3 default values	
Table 48.	OUT X L register default values	
		-55



Table 49.	OUT_X_H register default values	
Table 50.	OUT_Y_L register default values	
Table 51.	OUT_Y_H register default values	
Table 52.	OUT_Z_L register default values	
Table 53.	OUT_Z_H register default values	
Table 54.	FIFO control register	
Table 55.	FIFO control register description.	
Table 56.	FIFO mode selection.	
Table 57.	FIFO_SRC register	
Table 58.	FIFO_SRC register description	
Table 59.	SM1 control register	
Table 60.	SM1 control register structure	
Table 61.	Timer4 default values	
Table 62.	Timer3 default values	
Table 63.	TIM2_1_L default values	
Table 64.	TIM2_1_H default values	
Table 65.	TIM1_1_L default values	
Table 66.	TIM1_1_H default values	
Table 67.	THRS2_1 default values	
Table 68.	THRS1_1 default values	
Table 69.	MASK1_B axis and sign mask register	
Table 70.	MASK1_B register structure	
Table 71.	MASK1_A axis and sign mask register	
Table 72.	MASK1_A register structure	
Table 73.	SETT1 register structure	
Table 74.	SETT1 register description	
Table 75.	PR1 register	
Table 76.	PR1 register description	
Table 77.	TC1_L default values	
Table 78.	TC1_H default values	
Table 79.	OUTS1 register	
Table 80.	OUTS1 register description.	
Table 81.	PEAK1 default values	
Table 82.	SM2 control register	
Table 83.	SM2 control register description	
Table 84.	Timer4 default values	
Table 85.	Timer3 default values	
Table 86.	TIM2_2_L default values.	
Table 87.	TIM2_2_H default values	
Table 88.	TIM1_2_L default values	
Table 89.	TIM1_2_H default values	
Table 90.	THRS2_2 default values	
Table 91.	THRS1_2 default values	
Table 92.	MASK2_B axis and sign mask register	
Table 93. Table 94.	MASK2_B register description	
	MASK2_A axis and sign mask register	
Table 95.	MASK2_A register description	
Table 96.	SETT2 register description	
Table 97. Table 98.	SETT2 register description	
Table 98.	PR2 register description	
Table 99.	TC2 L default values	
iable 100.	102_L deladit values	+9



Table 101.	TC2_H default values	. 49
	OUTS2 register	
Table 103.	OUTS2 register description	. 49
Table 104.	PEAK2 default values	. 50
Table 105.	DES2 default values	. 50
Table 106	Document revision history	52

DocID022405 Rev 2



# List of figures


Figure 1.	Block diagram	10
Figure 2.	Pin connections	10
Figure 3.	SPI slave timing diagram	14
Figure 4.	I2C slave timing diagram	15
Figure 5.	LIS3DSH electrical connections	19
Figure 6.	LIS3DSH state machines: sequence of state to execute an algorithm	20
Figure 7.	Read and write protocol	25
Figure 8.	SPI read protocol	26
Figure 9.	Multiple byte SPI read protocol (2-byte example)	26
Figure 10.	SPI write protocol	27
Figure 11.	Multiple byte SPI write protocol (2-byte example)	27
Figure 12.	SPI read protocol in 3-wire mode	28
Figure 13.	LGA-16: package outline and mechanical data	51



# 1 Block diagram and pin description

### 1.1 Block diagram

Figure 1. Block diagram

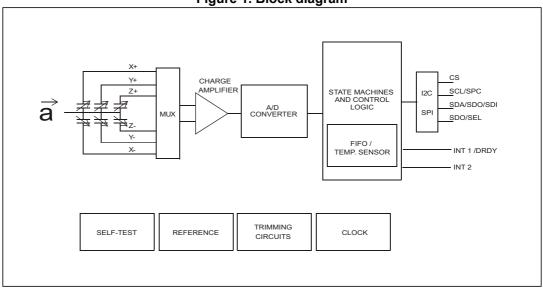

### 1.2 Pin description

Figure 2. Pin connections

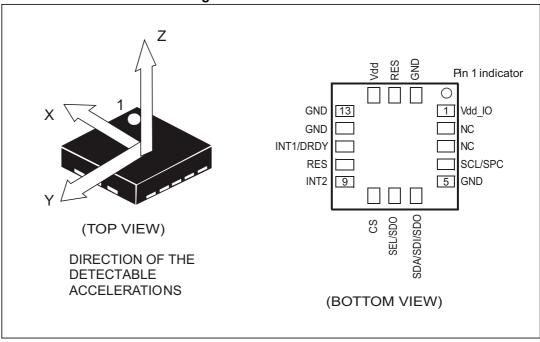




Table 2. Pin description

Pin#	Name	Function
1	Vdd_IO	Power supply for I/O pins
2	NC	Not connected
3	NC	Not connected
4	SCL SPC	I <sup>2</sup> C serial clock (SCL) SPI serial port clock (SPC)
5	GND	0 V supply
6	SDA SDI SDO	I <sup>2</sup> C serial data (SDA) SPI serial data input (SDI) 3-wire interface serial data output (SDO)
7	SEL SDO	I <sup>2</sup> C address selection SPI serial data output (SDO)
8	CS	SPI enable I <sup>2</sup> C/SPI mode selection (1: SPI idle mode / I <sup>2</sup> C communication enabled; 0: SPI communication mode / I <sup>2</sup> C disabled)
9	INT 2	Interrupt 2
10	Reserved	Connect to GND
11	INT 1/DRDY	Interrupt 1/ DRDY
12	GND	0 V supply
13	GND	0 V supply
14	Vdd	Power supply
15	Reserved	Connect to Vdd, connect to GND, or leave unconnected
16	GND	0 V supply



# 2 Mechanical and electrical specifications

#### 2.1 Mechanical characteristics

@ Vdd = 2.5 V, T =  $25 ^{\circ}\text{C}$  unless otherwise noted<sup>(a)</sup>.

**Table 3. Mechanical characteristics** 

Symbol	Parameter	Test conditions	Min.	Typ. <sup>(1)</sup>	Max.	Unit
FS		FS bit set to 000		±2.0		
		FS bit set to 001		±4.0		
	Measurement range <sup>(2)</sup>	FS bit set to 010		±6.0		g
		FS bit set to 011		±8.0		
		FS bit set to 100		±16.0		
		FS bit set to 000		0.06		
		FS bit set to 001		0.12		
So	Sensitivity	FS bit set to 010		0.18		m <i>g</i> /digit
		FS bit set to 011		0.24		
		FS bit set to 100		0.73		
TCSo	Sensitivity change vs. temperature	FS bit set to 00		0.01		%/°C
TyOff	Typical zero-g level offset accuracy <sup>(3)</sup>	FS bit set to 00		±40		m <i>g</i>
TCOff	Zero-g level change vs. temperature	Max. delta from 25 °C		±0.5		mg/°C
An	Acceleration noise density	FS bit set to 00, normal mode, ODR = 100 Hz		150		μ <i>g/</i> sqrt(Hz)
ST Self test posit difference <sup>(4)</sup>	Self test positive	$\pm 2 g$ range, X, Y-axis ST2,ST1 = [01] see Figure 23		140		ma
	difference <sup>(4)</sup>	$\pm$ 2 g range, Z-axis ST2,ST1 = [01] see Figure 23		590		m <i>g</i>
Тор	Operating temperature range		-40		+85	°C

<sup>1.</sup> Typical specifications are not guaranteed.

<sup>2.</sup> Verified by wafer level test and measurement of initial offset and sensitivity.

<sup>3.</sup> Typical zero-g level offset value after MSL3 preconditioning.

<sup>4.</sup> Self-test output change" is defined as:  $OUTPUT[mg]_{(CNTL5\ ST2,\ ST1\ bits=01)}$  -  $OUTPUT[mg]_{(CNTL5\ ST2,\ ST1\ bits=00)}$ 

a. The product is factory calibrated at 2.5 V. The operational power supply range is from 1.71 V to 3.6 V.



### 2.2 Electrical characteristics

@ Vdd = 2.5 V, T = 25 °C unless otherwise noted(b).

Table 4. Electrical characteristics (1)

Symbol	Parameter	Test conditions	Min.	Typ. <sup>(2)</sup>	Max.	Unit
Vdd	Supply voltage		1.71	2.5	3.6	V
Vdd_IO	I/O pins supply voltage <sup>(3)</sup>		1.71		Vdd+0.1	V
IddA	Current consumption in active mode	1.6 kHz ODR		225		μA
IduA		3.125 Hz ODR		11		μA
IddPdn	Current consumption in power-down/standby mode			2		μA
VIH	Digital high-level input voltage		0.8*Vdd_IO			V
VIL	Digital low-level input voltage				0.2*Vdd_IO	V
VOH	High-level output voltage		0.9*Vdd_IO			V
VOL	Low-level output voltage				0.1*Vdd_IO	V
Тор	Operating temperature range		-40		+85	°C

<sup>1.</sup> The product is factory calibrated at 2.5 V. The operational power supply range is from 1.71 V to 3.6 V.

DocID022405 Rev 2

<sup>2.</sup> Typical specifications are not guaranteed.

<sup>3.</sup> It is possible to remove Vdd while maintaining Vdd\_IO without blocking the communication busses, in this condition the measurement chain is powered off.

b. The product is factory calibrated at 2.5 V. The operational power supply range is from 1.71 V to 3.6 V.



#### 2.3 Communication interface characteristics


### 2.3.1 SPI - serial peripheral interface

Subject to general operating conditions for Vdd and Top.

Table 5. SPI slave timing values

		Value <sup>(1)</sup>		Unit
Symbol	Parameter	Min.	Max.	
t <sub>c(SPC)</sub>	SPI clock cycle	100		ns
f <sub>c(SPC)</sub>	SPI clock frequency		10	MHz
t <sub>su(CS)</sub>	CS setup time	6		
t <sub>h(CS)</sub>	CS hold time	8		
t <sub>su(SI)</sub>	SDI input setup time	5		
t <sub>h(SI)</sub>	SDI input hold time	15		ns
t <sub>v(SO)</sub>	SDO valid output time		50	
t <sub>h(SO)</sub>	SDO output hold time	9		]
t <sub>dis(SO)</sub>	SDO output disable time		50	

Values are guaranteed at 10 MHz clock frequency for SPI with both 4 and 3 wires, based on characterization results, not tested in production.

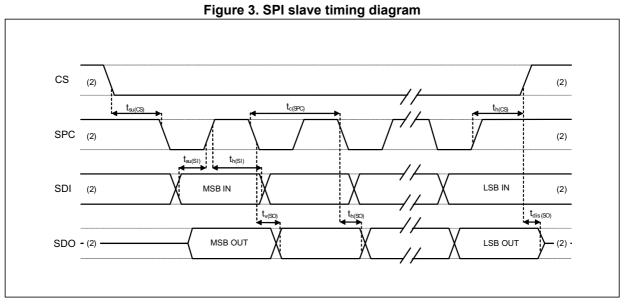

2. When no ongoing communication, data on SDO is driven by internal pull-up resistor.

Note: Measurement points are done at 0.2·Vdd\_IO and 0.8·Vdd\_IO, for both input and output ports.



#### I<sup>2</sup>C - inter-IC control interface 2.3.2

Subject to general operating conditions for Vdd and Top.

Table 6. I<sup>2</sup>C slave timing values

		I <sup>2</sup> C		I <sup>2</sup> C fast			
Symbol	Parameter	Min.	Max.	Min.	Max.	Unit	
f <sub>(SCL)</sub>	SCL clock frequency	0	100	0	400	kHz	
t <sub>w(SCLL)</sub>	SCL clock low time	4.7		1.3			
t <sub>w(SCLH)</sub>	SCL clock high time	4.0		0.6		— µs	
t <sub>su(SDA)</sub>	SDA setup time	250		100		ns	
t <sub>h(SDA)</sub>	SDA data hold time	0.01	3.45	0.01	0.9	μs	
t <sub>r(SDA)</sub> t <sub>r(SCL)</sub>	SDA and SCL rise time		1000	20 + 0.1C <sub>b</sub> <sup>(2)</sup>	300	no	
t <sub>f(SDA)</sub> t <sub>f(SCL)</sub>	SDA and SCL fall time		300	20 + 0.1C <sub>b</sub> <sup>(2)</sup>	300	– ns	
t <sub>h(ST)</sub>	START condition hold time	4		0.6			
t <sub>su(SR)</sub>	t <sub>su(SR)</sub> Repeated START condition setup time			0.6			
t <sub>su(SP)</sub>	STOP condition setup time	4		0.6		μs	
t <sub>w(SP:SR)</sub>	Bus free time between STOP and START condition	4.7		1.3			

- 1. Data based on standard  $I^2C$  protocol requirement, not tested in production.
- 2.  $C_b$  = total capacitance of one bus line, in pF.

Figure 4. I<sup>2</sup>C slave timing diagram REPEATED START START SDA  $\overrightarrow{t_{\text{su(SP)}}}$ STOP SCL

Note: Measurement points are done at 0.2·Vdd\_IO and 0.8·Vdd\_IO, for both ports.

DocID022405 Rev 2



#### 2.4 **Absolute maximum ratings**

Stresses above those listed as "absolute maximum ratings" may cause permanent damage to the device. This is a stress rating only and functional operation of the device under these conditions is not implied. Exposure to maximum rating conditions for extended periods may affect device reliability.

Table 7. Absolute maximum ratings

Symbol	Ratings	Maximum value	Unit
Vdd	Supply voltage	-0.3 to 4.8	V
Vdd_IO	I/O pins supply voltage	-0.3 to 4.8	V
Vin	Input voltage on any control pin (CS, SCL/SPC, SDA/SDI/SDO, SDO/SEL)	-0.3 to Vdd_IO +0.3	V
Λ	Acceleration (any axis, powered, Vdd = 2.5 V)	3000 for 0.5 ms	g
A <sub>POW</sub>	Acceleration (any axis, powered, vdd – 2.5 v)	10000 for 0.1 ms	g
_	Acceleration (any axis, unpowered)	3000 for 0.5 ms	g
A <sub>UNP</sub>	Acceleration (any axis, unpowered)	10000 for 0.1 ms	g
T <sub>OP</sub>	Operating temperature range	-40 to +85	°C
T <sub>STG</sub>	Storage temperature range	-40 to +125	°C
ESD	Electrostatic discharge protection	2 (HBM)	kV

Note: Supply voltage on any pin should never exceed 4.8 V



This device is sensitive to mechanical shock, improper handling can cause permanent damage to the part.



This device is sensitive to electrostatic discharge (ESD), improper handling can cause permanent damage to the part.



### 2.5 Terminology

#### 2.5.1 Sensitivity

Sensitivity describes the gain of the sensor and can be determined, for example, by applying 1 g acceleration to it. As the sensor can measure DC accelerations this can be done easily by pointing the axis of interest towards the center of the Earth, noting the output value, rotating the sensor by 180 degrees (pointing to the sky) and noting the output value again. By doing so,  $\pm 1$  g acceleration is applied to the sensor. Subtracting the larger output value from the smaller one, and dividing the result by 2, leads to the actual sensitivity of the sensor. This value changes very little over temperature and also time. The sensitivity tolerance describes the range of sensitivities of a large population of sensors.

### 2.5.2 Zero-g level

Zero-*g* level offset (TyOff) describes the deviation of an actual output signal from the ideal output signal if no acceleration is present. A sensor in a steady-state on a horizontal surface measures 0 *g* for the X-axis and 0 *g* for the Y-axis, whereas the Z-axis measures 1 *g*. The output is ideally in the middle of the dynamic range of the sensor (content of OUT registers 00h, data expressed as 2's complement number). A deviation from the ideal value in this case is called Zero-*g* offset. Offset is to some extent a result of stress to MEMS sensor and therefore the offset can slightly change after mounting the sensor on a printed circuit board or exposing it to extensive mechanical stress. Offset changes little over temperature, see "Zero-*g* level change vs. temperature". The Zero-*g* level tolerance (TyOff) describes the standard deviation of the range of Zero-*g* levels of a population of sensors.

### 2.6 Functionality

#### 2.6.1 Self-test

The self-test allows checking the sensor functionality without moving it. The self-test function is off when the self-test bit (ST) is programmed to '0'. When the self-test bit is programmed to '1', an actuation force is applied to the sensor, simulating a definite input acceleration. In this case the sensor outputs exhibit a change in their DC levels which are related to the selected full scale through the device sensitivity. When the self-test is activated, the device output level is given by the algebraic sum of the signals produced by the acceleration acting on the sensor and by the electrostatic test-force. If the output signals change within the amplitude specified in *Table 3*, then the sensor is working properly and the parameters of the chip interface are within the defined specifications.

### 2.7 Sensing element

A proprietary process is used to create a surface micromachined accelerometer. The technology allows processing suspended silicon structures which are attached to the substrate in a few points called anchors and are free to move in the direction of the sensed acceleration. In order to be compatible with traditional packaging techniques, a cap is placed on top of the sensing element to avoid blocking the moving parts during the molding phase of the plastic encapsulation.

DocID022405 Rev 2



When an acceleration is applied to the sensor, the proof mass displaces from its nominal position, causing an imbalance in the capacitive half bridge. This imbalance is measured using charge integration in response to a voltage pulse applied to the capacitor.

At steady-state the nominal value of the capacitors are a few pF and when an acceleration is applied, the maximum variation of the capacitive load is in the fF range.

#### 2.8 IC interface

The complete measurement chain is made up of a low-noise capacitive amplifier which converts the capacitive unbalancing of the MEMS sensor into an analog voltage that is available to the user through an analog-to-digital converter.

The acceleration data may be accessed through an I<sup>2</sup>C/SPI interface, therefore making the device particularly suitable for direct interfacing with a microcontroller.

The LIS3DSH features a Data-Ready signal (DRDY) which indicates when a new set of measured acceleration data is available, therefore simplifying data synchronization in the digital system that uses the device.

### 2.9 Factory calibration

The IC interface is factory calibrated for sensitivity (So) and Zero-g level (TyOff).

The trimming values are stored inside the device in nonvolatile memory. Any time the device is turned on, the trimming parameters are downloaded into the registers to be used during the active operation. This allows using the device without further calibration.



### 3 Application hints

 $\cap$ Vdd 16 10uF [1] 13 Vdd\_IO ( J E NC Γ ] NC **TOP VIEW** L INT1/DRDY  $\square$ 100nF **\_5**\_ 9 6 8 INT2 SDA/SDI/SDO SS SCL/SPC GND Digital signal from/to signal controller. Signal levels are defined by proper selection of Vdd\_IO.

Figure 5. LIS3DSH electrical connections

Note:

Pin 15 can be connected to Vdd or GND or left unconnected.

The device core is supplied through the Vdd line while the I/O pins are supplied through the Vdd\_IO line. Power supply decoupling capacitors (100 nF ceramic, 10  $\mu$ F) should be placed as near as possible to pin 14 of the device (common design practice).

All the voltage and ground supplies must be present at the same time to have proper behavior of the IC (refer to *Figure 5*). It is possible to remove Vdd while maintaining Vdd\_IO without blocking the communication bus, in this condition the measurement chain is powered off.

The functionality of the device and the measured acceleration data are selectable and accessible through the I<sup>2</sup>C or SPI interfaces. When using the I<sup>2</sup>C, CS must be tied high.

### 3.1 Soldering information

The LGA package is compliant with the ECOPACK<sup>®</sup>, RoHS and "Green" standard. It is qualified for soldering heat resistance according to JEDEC J-STD-020.

Leave "Pin 1 Indicator" unconnected during soldering.

DocID022405 Rev 2



# Digital main blocks

#### 4.1 State machine

The LIS3DSH embeds two state machines able to run a user-defined program.

The program is made up of a set of instructions that define the transition to successive states. Conditional branches are possible.

From each state (n) it is possible to have a transition to the next state (n+1) or to a reset state. The transition to the reset point happens when "RESET condition" is true; The transition to the next step happens when "NEXT condition" is true.

An interrupt is triggered when the output/stop/continue state is reached.

Each state machine allows implementing gesture recognition in a flexible way, free-fall, wake-up, 4D/6D orientation, pulse counter and step recognition, click/double-click, shake/double-shake, face-up/face-down, turn/double-turn:

- Code and parameters are loaded by the host into dedicated memory areas for the state program
- State program with timing based on ODR or decimated time
- Possibility of conditional branches

Figure 6. LIS3DSH state machines: sequence of state to execute an algorithm **START** State 1 reset next reset State 2 next reset State 3 next reset State n **INT** set **OUTPUT/STOP/CONTINUE** 



#### **4.2** FIFO

The LIS3DSH embeds an acceleration data FIFO for each of the three output channels, X, Y, and Z. This allows consistent power saving for the system since the host processor does not need to continuously poll data from the sensor, but it can wake up only when needed and burst the significant data out from the FIFO. This buffer can work according to four different modes: Bypass mode, FIFO mode, Stream mode and Stream-to-FIFO mode. Each mode is selected by the FIFO\_MODE bits. Programmable watermark level, FIFO\_empty or FIFO\_Full events can be enabled to generate dedicated interrupts on the INT1/2 pins.

### 4.2.1 Bypass mode

In Bypass mode, the FIFO is not operational and for this reason it remains empty. For each channel only the first address is used. The remaining FIFO slots are empty.

#### 4.2.2 FIFO mode

In FIFO mode, data from the X, Y, and Z channels are stored in the FIFO. A watermark interrupt can be enabled in order to be raised when the FIFO is filled to the level specified by the internal register. The FIFO continues filling until it is full. When full, the FIFO stops collecting data from the input channels.

#### 4.2.3 Stream mode

In Stream mode, data from the X, Y, and Z measurements are stored in the FIFO. A watermark interrupt can be enabled and set as in the FIFO mode. The FIFO continues filling until it's full. When full, the FIFO discards the older data as the new arrive.

#### 4.2.4 Stream-to-FIFO mode

In Stream-to-FIFO mode, data from the X, Y, and Z measurements are stored in the FIFO. A watermark interrupt can be enabled in order to be raised when the FIFO is filled to the level specified by the internal register. The FIFO continues filling until it's full. When full, the FIFO discards the older data as the new arrive. Once a trigger event occurs, the FIFO starts operating in FIFO mode.

#### 4.2.5 Retrieving data from FIFO

FIFO data is read from the OUT\_X, OUT\_Y and OUT\_Z registers. When the FIFO is in Stream, Bypass or FIFO mode, a read operation to the OUT\_X, OUT\_Y or OUT\_Z registers provides the data stored in the FIFO. Each time data is read from the FIFO, the oldest X, Y, and Z data are placed in the OUT\_X, OUT\_Y and OUT\_Z registers and both single-read and read-burst operations can be used.

DocID022405 Rev 2



### 5 Digital interfaces

The registers embedded inside the LIS3DSH may be accessed through both the  $I^2C$  and SPI serial interfaces. The latter may be SW configured to operate either in 3-wire or 4-wire interface mode.

The serial interfaces are mapped to the same pins. To select/exploit the I<sup>2</sup>C interface, the CS line must be tied high (i.e. connected to Vdd\_IO).

Table 8. Serial interface pin description

Pin name	Pin description							
CS	SPI enable I <sup>2</sup> C/SPI mode selection (1: SPI idle mode / I <sup>2</sup> C communication enabled; 0: SPI communication mode / I <sup>2</sup> C disabled)							
SCL SPC	I <sup>2</sup> C serial clock (SCL) SPI serial port clock (SPC)							
SDA SDI SDO	I <sup>2</sup> C serial data (SDA) SPI serial data input (SDI) 3-wire interface serial data output (SDO)							
SEL SDO	I <sup>2</sup> C address selection SPI serial data output (SDO)							

### 5.1 I<sup>2</sup>C serial interface

The LIS3DSH I<sup>2</sup>C is a bus slave. The I<sup>2</sup>C is employed to write data into registers whose content can also be read back.

The relevant I<sup>2</sup>C terminology is given in the table below.

Table 9. I<sup>2</sup>C terminology

Term	Description
Transmitter	The device which sends data to the bus
Receiver	The device which receives data from the bus
Master	The device which initiates a transfer, generates clock signals and terminates a transfer
Slave	The device addressed by the master

There are two signals associated with the I<sup>2</sup>C bus: the serial clock line (SCL) and the serial data line (SDA). The latter is a bidirectional line used for sending and receiving the data to/from the interface. Both lines must be connected to Vdd\_IO through an external pull-up resistor. When the bus is free, both lines are high.

The  $I^2C$  interface is compliant with fast mode (400 kHz)  $I^2C$  standards as well as with normal mode.



#### 5.1.1 I<sup>2</sup>C operation

The transaction on the bus is started through a start (ST) signal. A start condition is defined as a HIGH to LOW transition on the data line while the SCL line is held HIGH. After this has been transmitted by the master, the bus is considered busy. The next byte of data transmitted after the start condition contains the address of the slave in the first 7 bits and the eighth bit tells whether the master is receiving data from the slave or transmitting data to the slave. When an address is sent, each device in the system compares the first seven bits after a start condition with its address. If they match, the device considers itself addressed by the master.

The slave address (SAD) associated to the LIS3DSH is 00111xxb where the xx bits are modified by the SEL/SDO pin in order to modify the device address. If the SEL pin is connected to the voltage supply, the address is 0011101b, otherwise the address is 0011110b if the SEL pin is connected to ground. This solution allows connecting and addressing two different accelerometers to the same I<sup>2</sup>C lines.

Data transfer with acknowledge is mandatory. The transmitter must release the SDA line during the acknowledge pulse. The receiver must then pull the data line LOW so that it remains stable low during the HIGH period of the acknowledge clock pulse. A receiver which has been addressed is obliged to generate an acknowledge after each byte of data received.

The I<sup>2</sup>C embedded inside the LIS3DSH behaves as a slave device and the following protocol must be adhered to. After the start condition (ST) a slave address is sent, once a slave acknowledge (SAK) has been returned, an 8-bit sub-address (SUB) is transmitted: the 7 LSb represents the actual register address while the ADD\_INC bit (CTRL\_REG6) defines the address increment.

The slave address is completed with a read/write bit. If the bit is '1' (Read), a repeated start (SR) condition must be issued after the two sub-address bytes; if the bit is '0' (Write), the master transmits to the slave with direction unchanged. *Table 10* explains how the SAD+Read/Write bit pattern is composed, listing all the possible configurations.

SAD+R/W  $SAD[1] = \overline{SEL}$ R/W Command SAD[6:2] SAD[0] = SEL1 Read 00111 1 0 00111101 Write 0 0 00111 1 00111100 Read 00111 0 1 1 00111011 0 1 Write 00111 0 00111010

Table 10. SAD+Read/Write patterns

Table 11. Transfer when master is writing one byte to slave

Master	ST	SAD + W		SUB		DATA		SP
Slave			SAK		SAK		SAK	

DocID022405 Rev 2



#### Table 12. Transfer when master is writing multiple bytes to slave

Master	ST	SAD + W		SUB		DATA		DATA		SP
Slave			SAK		SAK		SAK		SAK	

#### Table 13. Transfer when master is receiving (reading) one byte of data from slave

Master	ST	SAD + W		SUB		SR	SAD + R			NMAK	SP
Slave			SAK		SAK			SAK	DATA		

#### Table 14. Transfer when master is receiving (reading) multiple bytes of data from slave

Master	ST	SAD+W		SUB		SR	SAD+R			MAK		MAK		NMAK	SP
Slave			SAK		SAK			SAK	DATA		DAT A		DATA		

Data are transmitted in byte format (DATA). Each data transfer contains 8 bits. The number of bytes transferred per transfer is unlimited. Data is transferred with the Most Significant bit (MSb) first. If a receiver can't receive another complete byte of data until it has performed some other function, it can hold the clock line, SCL LOW, to force the transmitter into a wait state. Data transfer only continues when the receiver is ready for another byte and releases the data line. If a slave receiver doesn't acknowledge the slave address (i.e. it is not able to receive because it is performing some real-time function) the data line must be left HIGH by the slave. The master can then abort the transfer. A LOW to HIGH transition on the SDA line while the SCL line is HIGH is defined as a STOP condition. Each data transfer must be terminated by the generation of a STOP (SP) condition.

In the communication format presented, MAK is Master acknowledge and NMAK is No Master Acknowledge.




#### 5.2 SPI bus interface

The LIS3DSH SPI is a bus slave. The SPI allows writing to and reading from the registers of the device.

The serial interface interacts with the outside world with 4 wires: CS, SPC, SDI and SDO.

Figure 7. Read and write protocol

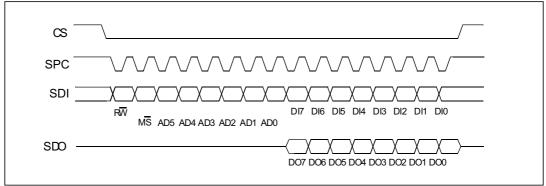

CS is the serial port enable and it is controlled by the SPI master. It goes low at the start of the transmission and goes back high at the end. SPC is the serial port clock and it is controlled by the SPI master. It is stopped high when CS is high (no transmission). SDI and SDO are respectively the serial port data input and output. Those lines are driven at the falling edge of SPC and should be captured at the rising edge of SPC.

Both the read register and write register commands are completed in 16 clock pulses or in multiples of 8 in case of multiple read/write bytes. Bit duration is the time between two falling edges of SPC. The first bit (bit 0) starts at the first falling edge of SPC after the falling edge of CS while the last bit (bit 15, bit 23, ...) starts at the last falling edge of SPC just before the rising edge of CS.

**bit 0**: RW bit. When 0, the data DI(7:0) is written into the device. When 1, the data DO(7:0) from the device is read. In the latter case, the chip drives **SDO** at the start of bit 8.

bit 1-7: address AD(6:0). This is the address field of the indexed register.

bit 8-15: data DI(7:0) (write mode). This is the data that is written into the device (MSb first).

bit 8-15: data DO(7:0) (read mode). This is the data that is read from the device (MSb first).

In multiple read/write commands further blocks of 8 clock periods are added. When the ADD\_INC CTRL\_REG6 (25h) bit is '0', the address used to read/write data remains the same for every block. When the ADD\_INC bit is '1', the address used to read/write data is increased at every block.


The function and the behavior of **SDI** and **SDO** remain unchanged.

DocID022405 Rev 2



#### 5.2.1 SPI read

Figure 8. SPI read protocol

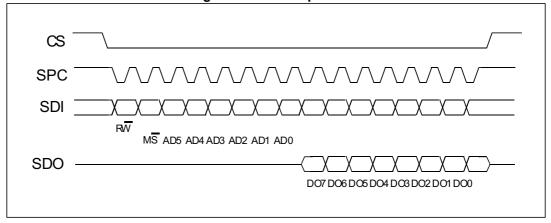

The SPI Read command is performed with 16 clock pulses. A multiple byte read command is performed by adding blocks of 8 clock pulses to the previous one.


bit 0: READ bit. The value is 1.

bit 1-7: address AD(6:0). This is the address field of the indexed register.

bit 8-15: data DO(7:0) (read mode). This is the data that is read from the device (MSb first).

bit 16-...: data DO(...-8). Further data in multiple byte reads.


Figure 9. Multiple byte SPI read protocol (2-byte example)

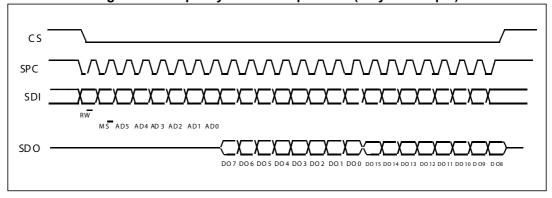



#### 5.2.2 SPI write

Figure 10. SPI write protocol

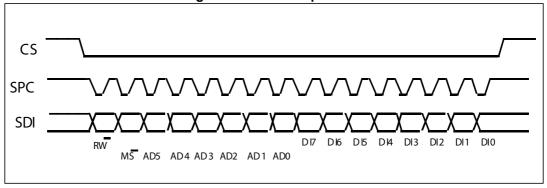

The SPI Write command is performed with 16 clock pulses. A multiple byte write command is performed by adding blocks of 8 clock pulses to the previous one.


bit 0: WRITE bit. The value is 0.

bit 1 -7: address AD(6:0). This is the address field of the indexed register.

*bit 8-15*: data DI(7:0) (write mode). This is the data that is written inside the device (MSb first).

bit 16-...: data DI(...-8). Further data in multiple byte writes.

Figure 11. Multiple byte SPI write protocol (2-byte example)

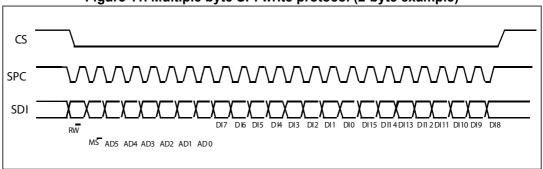


DocID022405 Rev 2



#### 5.2.3 SPI read in 3-wire mode

3-wire mode is entered by setting the SIM bit to '1' (SPI serial interface mode selection) by internal register.

Figure 12. SPI read protocol in 3-wire mode

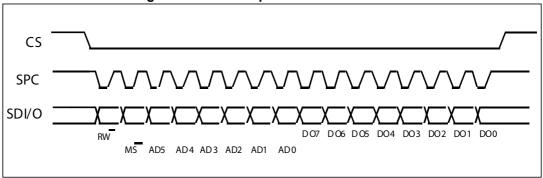

The SPI read command is performed with 16 clock pulses:

bit 0: READ bit. The value is 1.

bit 1-7: address AD(6:0). This is the address field of the indexed register.

bit 8-15: data DO(7:0) (read mode). This is the data that is read from the device (MSb first).

A multiple read command is also available in 3-wire mode.



# 6 Register mapping

*Table 15* provides a list of the 8/16-bit registers embedded in the device and the corresponding addresses.

Table 15. Register address map

	Туре		address in			
Name		Hex	Binary	Default	Comment	
INFO1	r	0D	00001101	0010 0001	Information register 1	
INFO2	r	0E	00001110	0000 0000	Information register 2	
WHO_AM_I	r	OF	00001111	0011 1111	Who I am ID	
CTRL_REG3	r/w	23	00100011	-		
CTRL_REG4	r/w	20	00100000	-	0	
CTRL_REG5	r/w	24	00100100	-	Control registers	
CTRL_REG6	r/w	25	00100101	-		
STATUS	r	27	00100111	-	Status data register	
OUT_T	r	0C	00001100	-	Temperature output	
OFF_X	r/w	10	00010000	0000 0000	X-axis offset correction	
OFF_Y	r/w	11	00010001	0000 0000	Y-axis offset correction	
OFF_Z	r/w	12	00010010	0000 0000	Z-axis offset correction	
CS_X	r/w	13	00010011	0000 0000	Constant shift X	
CS_Y	r/w	14	00010100	0000 0000	Constant shift Y	
CS_Z	r/w	15	00010101	0000 0000	Constant shift Z	
LC_L	r/w	16	00010110	0000 0001		
LC_H	r/w	17	00010111	0000 0000	Long counter registers	
STAT	r	18	00011000	-	Interrupt synchronization	
VFC_1	r/w	1B	00011011	-	Vector filter coefficient 1	
VFC_2	r/w	1C	00011100	-	Vector filter coefficient 2	
VFC_3	r/w	1D	00011101	-	Vector filter coefficient 3	
VFC_4	r/w	1E	00011110	-	Vector filter coefficient 4	
THRS3	r/w	1F	00011111	-	Threshold value 3	
OUT_X_L	r	28	00101000	0000 0000		
OUT_X_H	r	29	00101001			
OUT_Y_L	r	2A	00101010			
OUT_Y_H	r	2B	00101011		Output registers	
OUT_Z_L	r	2C	00101100			
OUT_Z_H	r	2D	00101101			

DocID022405 Rev 2



Table 15. Register address map (continued)

Name	Туре	Registe	r address	Default	Comment
Name		Hex	Binary	Delault	Comment
FIFO_CTRL	r/w	2E	00101110	0000 0000	FIFO registers
FIFO_SRC	r	2F	00101111	-	FIFO registers
CTRL_REG1	r/w	21	00100001	0000 0000	SM1 control register
ST1_X	w	40-4F	01000000 01001111	-	SM1 code register (X =1-16)
TIM4_1	w	50	01010000	-	
TIM3_1	w	51	01010001	-	
TIM2_1	w	52-53	01010010 01010011	-	SM1 general timer
TIM1_1	w	54-55	01010100 01010101	-	
THRS2_1	w	56	01010110	-	SM1 threshold value 1
THRS1_1	w	57	01010111	-	SM1 threshold value 2
MASK1_B	w	59	01011001	-	SM1 axis and sign mask
MASK1_A	w	5A	01011010	-	SM1 axis and sign mask
SETT1	w	5B	01011011	-	SM1 detection settings
PR1	r	5C	01011100	-	Program-reset pointer
TC1	r	5D-5E	01011101 01011110	-	Timer counter
OUTS1	r	5F	01011111	-	Main set flag
PEAK1	r	19	00011001	-	Peak value
CTRL_REG2	r/w	22	00100010	-	SM2 control register
ST2_X	w	60-6F	01100000 01101111	-	SM2 code register (X =1-16)
TIM4_2	w	70	01110000	-	
TIM3_2	w	71	01110001	-	
TIM2_2	w	72-73	01110010 01110011	-	SM2 general timer
TIM1_2	w	74-75	01110100 01110101	-	
THRS2_2	w	76	01110110	-	SM2 threshold value 1
THRS1_2	w	77	01110111	-	SM2 threshold value 2
MASK2_B	w	79	01111001	-	SM2 axis and sign mask
MASK2_A	w	7A	01111010		SM2 axis and sign mask
SETT2	w	7B	01111011	-	SM2 detection settings



Table 15. Register address map (continued)

	Туре	Register	address		
Name		Hex	Binary	Default	Comment
PR2	r	7C	01111100	-	Program-reset pointer
TC2	r	7D-7E	01111101 01111110	-	Timer counter
OUTS2	r	7F	01111111		Main set flag
PEAK2	r	1A	00011010	-	Peak value
DES2	W	78	01111000	-	Decimation factor

Registers marked as '*Reserved*' must not be changed. Writing to those registers may cause permanent damage to the device.

The content of the registers that are loaded at boot should not be changed. They contain the factory calibration values. Their content is automatically restored when the device is powered up.

DocID022405 Rev 2



# 7 Register description

### 7.1 INFO1 (0Dh)

Read-only information register.

#### Table 16. INFO1 register default values

				·				
0	0	1	0	0	0	0	1	١

### 7.2 INFO2 (0Eh)

Read-only information register.

#### Table 17. INFO2 register default values

0	0	0	0	0	0	0	0

### 7.3 WHO\_AM\_I (0Fh)

Who\_AM\_I register.

#### Table 18. WHO\_AM\_I register default values

1	1

### 7.4 CTRL\_REG3 (23h)

Control register 3.

#### Table 19. Control register 3

DR_EN IEA IEL	INT2_EN INT1_EN	VFILT -	STRT
---------------	-----------------	---------	------

#### Table 20. CTRL\_REG3 register description

DR EN	DRDY signal enable to INT1. Default value: 0
DIV_LIN	(0: data ready signal not connected; 1: data ready signal connected to INT1)
IEA	Interrupt signal polarity. Default value: 0
ILA	(0: interrupt signals active LOW; 1: interrupt signals active HIGH)
IEL	Interrupt signal latching. Default value: 0
166	(0: interrupt signal latched; 1: interrupt signal pulsed)
INT2 EN	Interrupt 2 enable/disable. Default value:0
IINIZ_LIN	(0: INT2 signal disabled; 1: INT2 signal enabled)
INT1 EN	Interrupt 2 enable/disable. Default value: 0
INTI_EN	(0: INT1/DRDY signal disabled; 1: INT1/DRDY signal enabled)
VFILT	Vector filter enable/disable. Default value: 0
VEILI	(0: vector filter disabled; 1: vector filter enabled)
STRT	Soft reset bit
SIKI	(0: no soft reset; 1: soft reset (POR function)



### 7.5 CTRL\_REG4 (20h)

Control register 4.

Table 21. Control register 4

ODR3 ODR2 ODR1 ODR0 BDU Zen Yen Xe
------------------------------------

Table 22. CTRL\_REG4 register description

ODR 3:0	Output data rate and power mode selection. Default value: 0000 (see Table 23)
BDU	Block data update. Default value: 0 (0: continuous update; 1: output registers not updated until MSB and LSB have been read)
Zen	Z-axis enable. Default value: 1 (0: Z-axis disabled; 1: Z-axis enabled)
Yen	Y-axis enable. Default value: 1 (0: Y-axis disabled; 1: Y-axis enabled)
Xen	X-axis enable. Default value: 1 (0: X-axis disabled; 1: X-axis enabled)

**ODR[3:0]** is used to set the power mode and ODR selection. In *Table 23* (output data rate selection) all available frequencies are shown.

Table 23. CTRL4 ODR configuration

ODR3	ODR2	ODR1	ODR0	ODR selection
0	0	0	0	Power down
0	0	0	1	3.125 Hz
0	0	1	0	6.25 Hz
0	0	1	1	12.5 Hz
0	1	0	0	25 Hz
0	1	0	1	50 Hz
0	1	1	0	100 Hz
0	1	1	1	400 Hz
1	0	0	0	800 Hz
1	0	0	1	1600 Hz

The **BDU** bit is used to inhibit the update of the output registers until both upper and lower register parts are read. In default mode (BDU = '0') the output register values are updated continuously. When the BDU is activated (BDU = '1'), the content of the output registers is not updated until both MSb and LSb are read which avoids reading values related to different sample times.

DocID022405 Rev 2



# 7.6 CTRL\_REG5 (24h)

Control register 5.

#### Table 24. Control register 5

#### Table 25. Control register 5 description

BW2:BW1	Anti-aliasing filter bandwidth. Default value: 00 (00: 800 Hz; 01: 200 Hz; 10: 400 Hz; 11: 50 Hz)
FSCALE2:0	Full-scale selection. Default value: 00 (000: ±2 <i>g</i> ; 001: ±4 <i>g</i> ; 010: ±6 <i>g</i> ; 011: ±8 <i>g</i> ; 100: ±16 <i>g</i> )
ST2:1	Self-test enable. Default value: 00 (00: self-test disabled)
SIM	SPI serial interface mode selection. Default value: 0 (0: 4-wire interface; 1: 3-wire interface)

#### Table 26. Self-test mode selection

ST2	ST1	Self-test mode
0	0	Normal mode
0	1	Positive sign self-test
1	0	Negative sign self-test
1	1	Not allowed

# 7.7 CTRL\_REG6 (25h)

Control register 6.

#### Table 27. Control register 6

BOOT FIFO_EN WTM_EI	I ADD_ INC	P1_ EMPTY	P1_WTM	P1_OVER RUN	P2_ BOOT
---------------------	---------------	--------------	--------	----------------	-------------



### Table 28. Control register 6 description

BOOT	Force reboot, cleared as soon as the reboot is finished. Active high.
FIFO_EN	FIFO enable. Default value 0. (0: disable; 1: enable)
WTM_EN	Enable FIFO watermark level use. Default value 0. (0: disable; 1: enable)
ADD_INC	Register address automatically incremented during a multiple byte access with a serial interface (I <sup>2</sup> C or SPI). (0: disable; 1: enable)
P1_EMPTY	Enable FIFO empty indication on Int1. Default value 0. (0: disable; 1: enable)
P1_WTM	FIFO watermark interrupt on Int1. Default value 0. (0: disable; 1: enable)
P1_OVERRUN	FIFO overrun interrupt on Int1. Default value 0. (0: disable; 1: enable)
P2_BOOT	BOOT interrupt on Int2. Default value 0. (0: disable; 1: enable)

### 7.8 STATUS (27h)

Status register.

#### Table 29. Status register

ZYXOR	ZOR	YOR	XOR	ZYXDA	ZDA	YDA	XDA
				l			l

#### Table 30. Status register description

ZYXOR	X, Y, and Z-axis data overrun. Default value: 0 (0: no overrun has occurred; 1: a new set of data has overwritten the previous set)
ZOR	Z-axis data overrun. Default value: 0 (0: no overrun has occurred; 1: new data for the Z-axis has overwritten the previous)
YOR	Y-axis data overrun. Default value: 0 (0: no overrun has occurred; 1: new data for the Y-axis has overwritten the previous)
XOR	X-axis data overrun. Default value: 0 (0: no overrun has occurred; 1: new data for the X-axis has overwritten the previous)
ZYXDA	X, Y, and Z-axis new data available. Default value: 0 (0: a new set of data is not yet available; 1: a new set of data is available)
ZDA	Z-axis new data available. Default value: 0 (0: new data for the Z-axis is not yet available; 1: new data for the Z-axis is available)
YDA	Y-axis new data available. Default value: 0 (0: new data for the Y-axis is not yet available; 1: new data for the Y-axis is available)
XDA	X-axis new data available. Default value: 0 (0: new data for the X-axis is not yet available; 1: new data for the X-axis is available)

DocID022405 Rev 2



### 7.9 OUT\_T (0Ch)

Temperature output register. Temperature data (1LSB/deg - 8-bit resolution). The value is expressed as two's complement.

#### Table 31. OUT\_T register

Temp7	Temp6	Temp5	Temp4	Temp3	Temp2	Temp1	Temp0
-			· ·		-	I	-

#### Table 32. OUT\_T register description

Temp7-Temp0
-------------

### 7.10 OFF\_X (10h)

Offset correction X-axis register, signed value.

#### Table 33. Offset X default values

0 0 0	0	0	0	0	0
-------	---	---	---	---	---

### 7.11 OFF\_Y (11h)

Offset correction Y-axis register, signed value.

#### Table 34. Offset Y default values

		0	0	0	0	0	0	0	0
--	--	---	---	---	---	---	---	---	---

### 7.12 OFF\_Z (12h)

Offset correction Z-axis register, signed value.

#### Table 35. Offset Z default values

0	0	0	0	0	0	0	0

### 7.13 CS\_X (13h)

Constant shift, signed value X-axis register - state machine only.

#### Table 36. Constant shift X-axis default values

0	0	0	0	0	0	0	0



### 7.14 CS\_Y (14h)

Constant shift, signed value Y-axis register - state machine only.

#### Table 37. Constant shift Y-axis default values

0	0	0	0	0	0	0	0

### 7.15 CS\_Z (15h)

Constant shift, signed value Y-axis register - state machine only.

#### Table 38. Constant shift Z-axis default values

ı						
- 1	Λ	·	 	1 0	 	
- 1	U	0	 	, ,	 	
- 1						

## 7.16 LC (16h - 17h)

16-bit long-counter register for interrupt state machine program timing.

#### Table 39. LC\_L default values

0	0	0	0	0	0	0	1
_	1	_	_	_	-	_	

#### Table 40. LC\_H default values

0	0	0	0	0	0	0	0

01h=counting stopped, 00h=counter full: interrupt available and counter is set to default. Values higher than 00h: counting

## 7.17 STAT (18h)

Interrupt status - interrupt synchronization register.

#### Table 41. STAT register

				_			
LONG	SYNCW	SYNC1	SYNC2	INT_SM1	INT_SM2	DOR	DRDY



#### Table 42. STAT register description

	<u> </u>
LONG	0: no interrupt; 1: long counter (LC) interrupt flag common for both SM
SYNCW	Synchronization for external host controller interrupt based on output data (0: no action waiting from host; 1: action from host based on output data)
SYNC1	0: SM1 running normally; 1: SM1 stopped and await restart request from SM2
SYNC2	0: SM2 running normally; 1: SM2 stopped and await restart request from SM1
INT_SM1	SM1 - Interrupt Selection (1: SM1 interrupt enable; 0: SM1 interrupt disable)
NT_SM2	SM2 - Interrupt Selection (1: SM2 interrupt enable; 0: SM2 interrupt disable)
DOR	Data overrun indicates unread data from output register when next data sample measures start; (0: no overrun; 1: data overrun bit is reset when next sample is ready)
DRDY	Data ready from output register (0: data not ready; 1: data ready)

## 7.18 VFC\_1 (1Bh)

Vector coefficient register 1 for diff filter.

Table 43. Vector filter coefficient register 1 default values

0 0 0	0	0 0	0	0
-------	---	-----	---	---

## 7.19 VFC\_2 (1Ch)

Vector coefficient register 2 for diff filter.

### Table 44. Vector filter coefficient register 2 default values

0	0	0	0	0	0	0	0

## 7.20 VFC\_3 (1Dh)

Vector coefficient register 3 for FSM2 filter.

### Table 45. Vector filter coefficient register 3 default values

0 0	0 0	0	0 0	0
-----	-----	---	-----	---

## 7.21 VFC\_4 (1Eh)

Vector coefficient register 4 for diff filter.

### Table 46. Vector filter coefficient register 4 default values

_								
	0	0	0	0	0	0	0	0



## 7.22 THRS3 (1Fh)

Threshold value register.

Table 47. Threshold value register 3 default values

0	0	0	0	0	0	0	0

## 7.23 OUT\_X (28h - 29h)

X-axis output register.

Table 48. OUT\_X\_L register default values

0	0	0	0	0	0	0	0
							l

Table 49. OUT\_X\_H register default values

				<u> </u>			
0	0	0	0	0	0	0	0

### 7.24 OUT\_Y (2Ah - 2Bh)

Y-axis output register.

Table 50. OUT\_Y\_L register default values

0	0	0	0	0	0	0	0

#### Table 51. OUT\_Y\_H register default values

0	0	0	0	0	0	0	0

## 7.25 OUT\_Z (2Ch - 2Dh)

Z-axis output register.

#### Table 52. OUT\_Z\_L register default values

0 0 0 0 0 0 0									
	0	0	0	0	0	0	0	0	

#### Table 53. OUT\_Z\_H register default values

0	0	0	0	0	0	0	0	

DocID022405 Rev 2

39/53



## 7.26 FIFO\_CTRL (2Eh)

FIFO control register.

### Table 54. FIFO control register

FMODE2 FMODE1 FMODE0 WTM	P4 WTMP3 W	TMP2 WTMP1 WTMP4
--------------------------	------------	------------------

### Table 55. FIFO control register description

FMODE2:FMODE0	FIFO mode selection
WTMP4:WTMP0	FIFO watermark pointer; FIFO deep if the watermark is enabled.

#### Table 56. FIFO mode selection

FMODE2	FMODE1	FMODE0	Mode
0	0	0	Bypass mode. FIFO turned off
0	0	1	FIFO mode. Stops collecting data when FIFO is full.
0	1	0	Stream mode. If the FIFO is full, the new sample overwrites the older one.
0	1	1	Stream mode until trigger is de- asserted, then FIFO mode
1	0	0	Bypass mode until trigger is de- asserted, then Stream mode
1	0	1	Not used
1	1	0	Not used.
1	1	1	Bypass mode until trigger is de- asserted, then FIFO mode

The FIFO trigger is the INT2 source.

## 7.27 FIFO\_SRC (2Fh)

FIFO SRC control register.

### Table 57. FIFO\_SRC register

WTM OVRN_ FIFO EMPTY FSS4 FSS3 FSS2 FSS1 FSS
--



### Table 58. FIFO\_SRC register description

WTM	Watermark status. (0: FIFO filling is lower than WTM level; 1: FIFO filling is equal or higher than WTM level)
OVRN_FIFO	Overrun bit status. (0: FIFO is not completely filled; 1: FIFO is completely filled)
EMPTY	FIFO empty bit. (0: FIFO not empty; 1: FIFO empty)
FSS4-FSS0	FIFO stored data level

### 7.28 CTRL\_REG1 (21h)

SM1 control register.

### Table 59. SM1 control register

#### Table 60. SM1 control register structure

HYST2_1 HYST1_1 HYST0_1	Hysteresis unsigned value to be added or subtracted from threshold value in SM1 Default value: 000
SM1_PIN	0: SM1 interrupt routed to INT1; 1: SM1 interrupt routed to INT2 pin Default value: 0
SM1_EN	0: SM1 disabled; 1: SM1 enabled Default value: 0

## 7.29 STx\_1 (40h-4Fh)

State machine 1 code register  $STx_1$  (x = 1-16).

State machine 1 system register is made up of 16, 8-bit registers to implement 16-step opcode.

## 7.30 TIM4\_1 (50h)

8-bit general timer (unsigned value) for SM1 operation timing.

#### Table 61. Timer4 default values

)	0	0	0	_	0	0	_
U	U	U	0	0	l 0	U	l 0

DocID022405 Rev 2

41/53



### 7.31 TIM3\_1 (51h)

8-bit general timer (unsigned value) for SM1 operation timing.

#### Table 62. Timer3 default values

0	0	0	0	0	0	0	0
0	0		•	•	•	Ŭ	U

### 7.32 TIM2\_1 (52h - 53h)

16-bit general timer (unsigned value) for SM1 operation timing.

#### Table 63. TIM2\_1\_L default values

0	0	0	0	0	0	0	0
_	_	_	_	_	_	_	_

#### Table 64. TIM2\_1\_H default values

0	0	0	0	0	0	0	0

### 7.33 TIM1\_1 (54h - 55h)

16-bit general timer (unsigned value) for SM1 operation timing.

#### Table 65. TIM1\_1\_L default values

0	0	0	n	n	n	0	n
0	0	0	0	0	0	0	0

#### Table 66. TIM1 1 H default values

0	0	0	0	0	0	0	0

## 7.34 THRS2\_1 (56h)

Threshold value for SM1 operation.

#### Table 67. THRS2\_1 default values

0	0	0	0	0	0	0	0

## 7.35 THRS1\_1 (57h)

Threshold value for SM1 operation.

#### Table 68. THRS1\_1 default values

0	0	0	0	0	0	0	0



## 7.36 MASK1\_B (59h)

Axis and sign mask (swap) for SM1 motion-detection operation.

### Table 69. MASK1\_B axis and sign mask register

P_X	N_X	P_Y	N_Y	P_Z	N_Z	P_V	N_V
_	_	_	_	_	_	_	_

### Table 70. MASK1\_B register structure

P_X	0: X + disabled; 1: X + enabled				
N_X	0: X - disabled; 1: X – enabled				
P_Y	0: Y+ disabled; 1: Y + enabled				
N_Y	0: Y- disabled; 1: Y – enabled				
P_Z	0: Z + disabled; 1: Z + enabled				
N_Z	0: Z - disabled; 1: Z – enabled				
P_V	0: V + disabled; 1: V + enabled				
N_V 0: V - disabled; 1: V - enabled					

## 7.37 MASK1\_A (5Ah)

Axis and sign mask (default) for SM1 motion-detection operation.

### Table 71. MASK1\_A axis and sign mask register

P_X
-----

### Table 72. MASK1\_A register structure

P_X	0: X + disabled; 1: X + enabled
N_X	0: X - disabled; 1: X – enabled
P_Y	0: Y + disabled; 1: Y + enabled
N_Y	0: Y - disabled; 1: Y – enabled
P_Z	0: Z + disabled; 1: Z + enabled
N_Z	0: Z - disabled; 1: Z – enabled
P_V	0: V + disabled; 1: V + enabled
N_V	0: V - disabled; 1: V – enabled



## 7.38 SETT1 (5Bh)

Setting of threshold, peak detection and flags for SM1 motion-detection operation.

### Table 73. SETT1 register structure

P_DET THR3_SA ABS	-	=	THR3_MA	R_TAM	SITR
-------------------	---	---	---------	-------	------

### Table 74. SETT1 register description

	<u> </u>
P_DET	SM1 peak detection. Default value: 0 (0: peak detection disabled; 1: peak detection enabled)
THR3_SA	Default value: 0 (0: no action; 1: threshold 3 limit value for axis and sign mask reset (MASKB_1)
ABS	Default value: 0 (0: unsigned thresholds; 1: signed thresholds)
THR3_MA	Default value: 0 (0: no action; 1: threshold 3 limit value for axis and sign mask reset (MASKA_1)
R_TAM	Next condition validation flag. Default value: 0 (0: no valid next condition found; 1: valid next condition found and reset)
SITR	Default value: 0 (0: no actions; 1: program flow can be modified by STOP and CONT commands)

## 7.39 PR1 (5Ch)

Program and reset pointer for SM1 motion-detection operation.

### Table 75. PR1 register

PP3         PP2         PP1         PP0         RP3         RP2         RP1         RP0
---

### Table 76. PR1 register description

PP3-PP0	SM1 program pointer address
RP3-RP0	SM1 reset pointer address

## 7.40 TC1 (5Dh-5E)

16-bit general timer (unsigned output value) for SM1 operation timing.

### Table 77. TC1\_L default values

|--|

### Table 78. TC1\_H default values

|--|



### 7.41 OUTS1 (5Fh)

Output flags on axis for interrupt SM1 management.

#### Table 79. OUTS1 register

P_X N	I_X P_Y	N_Y	P_Z	N_Z	P_V	N_V
-------	---------	-----	-----	-----	-----	-----

Read action of this register, depending on the flag affects SM1 interrupt functions.

### Table 80. OUTS1 register description

P_X	0: X + no show; 1: X+ show					
N_X 0: X - no show; 1: X - show						
P_Y	0: Y + no show; 1: Y + show					
N_Y	0: Y - no show; 1: Y – show					
P_Z	0: Z + no show; 1: Z + show					
N_Z	0: Z - no show; 1: Z – show					
P_V	0: V + no show; 1: V + show					
N_V	0: V - no show, 1: V – show					

### 7.42 **PEAK1** (19h)

Peak detection value register for SM1 operation.

#### Table 81. PEAK1 default values

_						
ſ						
	Λ Ι	Λ	^	· ·	 	 
	0 1	U	U		 	 

Peak detected value for next condition SM1.

## 7.43 CTRL\_REG2 (22h)

State program 2 interrupt MNG - SM2 control register.

#### Table 82. SM2 control register

HYST2_2	HYST1_2	HYST0_2	-	SM2_PIN	-	-	SM2_EN
---------	---------	---------	---	---------	---	---	--------

### Table 83. SM2 control register description

HYST2_2 HYST1_2 HYST0_2	Hysteresis unsigned value to be added or subtracted from threshold value in SM2.  Default value: 000
SM2_PIN	0: SM2 interrupt routed to INT1; 1: SM2 interrupt routed to INT1 pin.  Default value: 0
SM2_EN	0: SM2 disabled; 1: SM2 enabled. Default value: 0

DocID022405 Rev 2

45/53



### 7.44 STx\_1 (60h-6Fh)

State machine 2 code register  $STx_1$  (x = 1-16).

State machine 2 system register is made up of 16 8-bit registers, to implement 16-step opcode.

### 7.45 TIM4\_2 (70h)

8-bit general timer (unsigned value) for SM2 operation timing.

#### Table 84. Timer4 default values

- 1	Λ Ι	<b>Λ</b>	· ·	· ^	l 0	· ·	· ^	l 0
								1 0
	_	_	_	_	_	_	_	I -

### 7.46 TIM3\_2 (71h)

8-bit general timer (unsigned value) for SM2 operation timing.

#### Table 85. Timer3 default values

0	0	0	0	0	0	0	0

### 7.47 TIM2\_2 (72h - 73h)

16-bit general timer (unsigned value) for SM2 operation timing.

#### Table 86. TIM2\_2\_L default values

0	0	0	0	0	0	0	0
_	_	_	_	_	_	_	_

### Table 87. TIM2\_2\_H default values

0	0	0	0	0	0	0	0	l

## 7.48 TIM1\_2 (74h - 75h)

16-bit general timer (unsigned value) for SM2 operation timing.

#### Table 88. TIM1\_2\_L default values

0	0	0	0	0	0	0	0

#### Table 89. TIM1\_2\_H default values

0	0	0	0	0	0	0	0



## 7.49 THRS2\_2 (76h)

Threshold signed value for SM2 operation.

### Table 90. THRS2\_2 default values

			<b>.</b>	_			
0	0	0	0	0	0	0	0

### 7.50 THRS1\_2 (77h)

Threshold signed value for SM2 operation.

### Table 91. THRS1\_2 default values

0	0	0	0	0	0	0	0

## 7.51 MASK2\_B (79h)

Axis and sign mask (swap) for SM2 motion-detection operation.

### Table 92. MASK2\_B axis and sign mask register

P_X	N_X	P_Y	N_Y	P_Z	N_Z	P_V	N_V
-----	-----	-----	-----	-----	-----	-----	-----

### Table 93. MASK2\_B register description

P_X	0: X + disabled; 1: X + enabled
N_X	0: X - disabled; 1: X – enabled
P_Y	0: Y + disabled; 1: Y + enabled
N_Y	0: Y - disabled; 1: Y – enabled
P_Z	0: Z + disabled; 1: Z + enabled
N_Z	0: Z - disabled; 1: Z – enabled
P_V	0: V + disabled; 1: V + enabled
N_V	0: V - disabled; 1: V – enabled



## 7.52 MASK2\_A (7Ah)

Axis and sign mask (default) for SM2 motion-detection operation.

### Table 94. MASK2\_A axis and sign mask register

P_X	N_X	P_Y	N_Y	P_Z	N_Z	P_V	N_V
_	_	_	_	_	_		_

### Table 95. MASK2\_A register description

P_X	0: X + disabled; 1: X + enabled
N_X	0: X - disabled; 1: X – enabled
P_Y	0: Y + disabled; 1: Y + enabled
N_Y	0: Y - disabled; 1: Y – enabled
P_Z	0: Z + disabled; 1: Z + enabled
N_Z	0: Z - disabled; 1: Z – enabled
P_V	0: V + disabled; 1: V + enabled
N_V	0: V - disabled; 1: V – enabled

## 7.53 SETT2 (7Bh)

Setting of threshold, peak detection and flags for SM2 motion-detection operation.

### Table 96. SETT2 register

P_DET   THR3_SA   ABS   -   THR3_MA   R_TAM   SITR
--

### Table 97. SETT2 register description

P_DET	SM2 peak detection. Default value: 0 (0: peak detection disabled; 1: peak detection enabled)
THR3_SA	Default value: 0 (0: no action; 1: threshold 3 limit value for axis and sign mask reset (MASK2_B)
ABS	Default value: 0 (0: unsigned thresholds; 1: signed thresholds)
THR3_MA	Default value: 0 (0: no action; 1: threshold 3 limit value for axis and sign mask reset (MASK2_A)
R_TAM	Next condition validation flag. Default value: 0 (0: no valid next condition found; 1: valid next condition found and reset)
SITR	Default value: 0 (0: no actions; 1: program flow can be modified by STOP and CONT commands)



## 7.54 PR2 (7Ch)

Program and reset pointer for SM2 motion-detection operation.

### Table 98. PR2 register

PP3 PP	<u> </u>	PP0	RP3	RP2	RP1	RP0
--------	----------	-----	-----	-----	-----	-----

### Table 99. PR2 register description

PP3-PP0	SM2 program pointer address
RP3-RP0	SM2 reset pointer address

### 7.55 TC2 (7Dh-7E)

16-bit general timer (unsigned output value) for SM2 operation timing.

#### Table 100. TC2\_L default values

0	0	0	0	0	0	0	0
Table 101, TC2 H default values							

Table 101. 102_11 default values							
0	0	0	0	0	0	0	0

### 7.56 OUTS2 (7Fh)

Output flags on axis for interrupt SM2 management.

#### Table 102. OUTS2 register

РΧ	ΝX	PΥ	ΝΥ	PΖ	ΝZ	ΡV	ΝV
_	_	_	_	_	_	-	. –

Read action of this register, depending on the flag affects SM2 interrupt functions.

#### Table 103. OUTS2 register description

P_X	0: X + no show; 1: X + show
N_X	0: X - no show; 1: X – show
P_Y	0: Y + no show; 1: Y + show
N_Y	0: Y - no show; 1: Y - show
P_Z	0: Z + no show; 1: Z + show
N_Z	0: Z - no show; 1: Z – show
P_V	0: V + no show; 1: V + show
N_V	0: V - no show; 1: V – show



## 7.57 PEAK2 (1Ah)

Peak detection value register for SM2 operation.

#### Table 104. PEAK2 default values

|--|

Peak detected value for next condition SM2.

## 7.58 DES2 (78h)

Decimation counter value register for SM2 operation.

#### Table 105. DES2 default values


0	0	0	0	0	0	0	0
				l			



## 8 LGA-16 package information

### 8.1

Figure 13. LGA-16: package outline and mechanical data

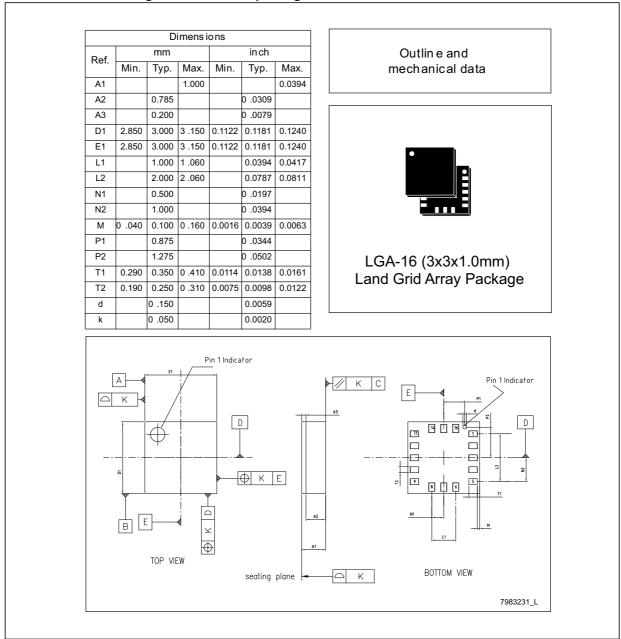



# 9 Revision history

Table 106. Document revision history

Date	Revision	Changes
26-Oct-2011	1	Initial release.
15-Oct-2015	2	Document status promoted to production data Updated Table 1: Device summary Updated description of pin 15 in Table 2: Pin description Added Note concerning pin 15 below Figure 5: LIS3DSH electrical connections Updated description of BW bits in Table 25: Control register 5 description Updated package outline in Figure 13: LGA-16: package outline and mechanical data Minor textual updates

