

Key matrix (col2row): 4 rows × 6 columns, 21 keys per half

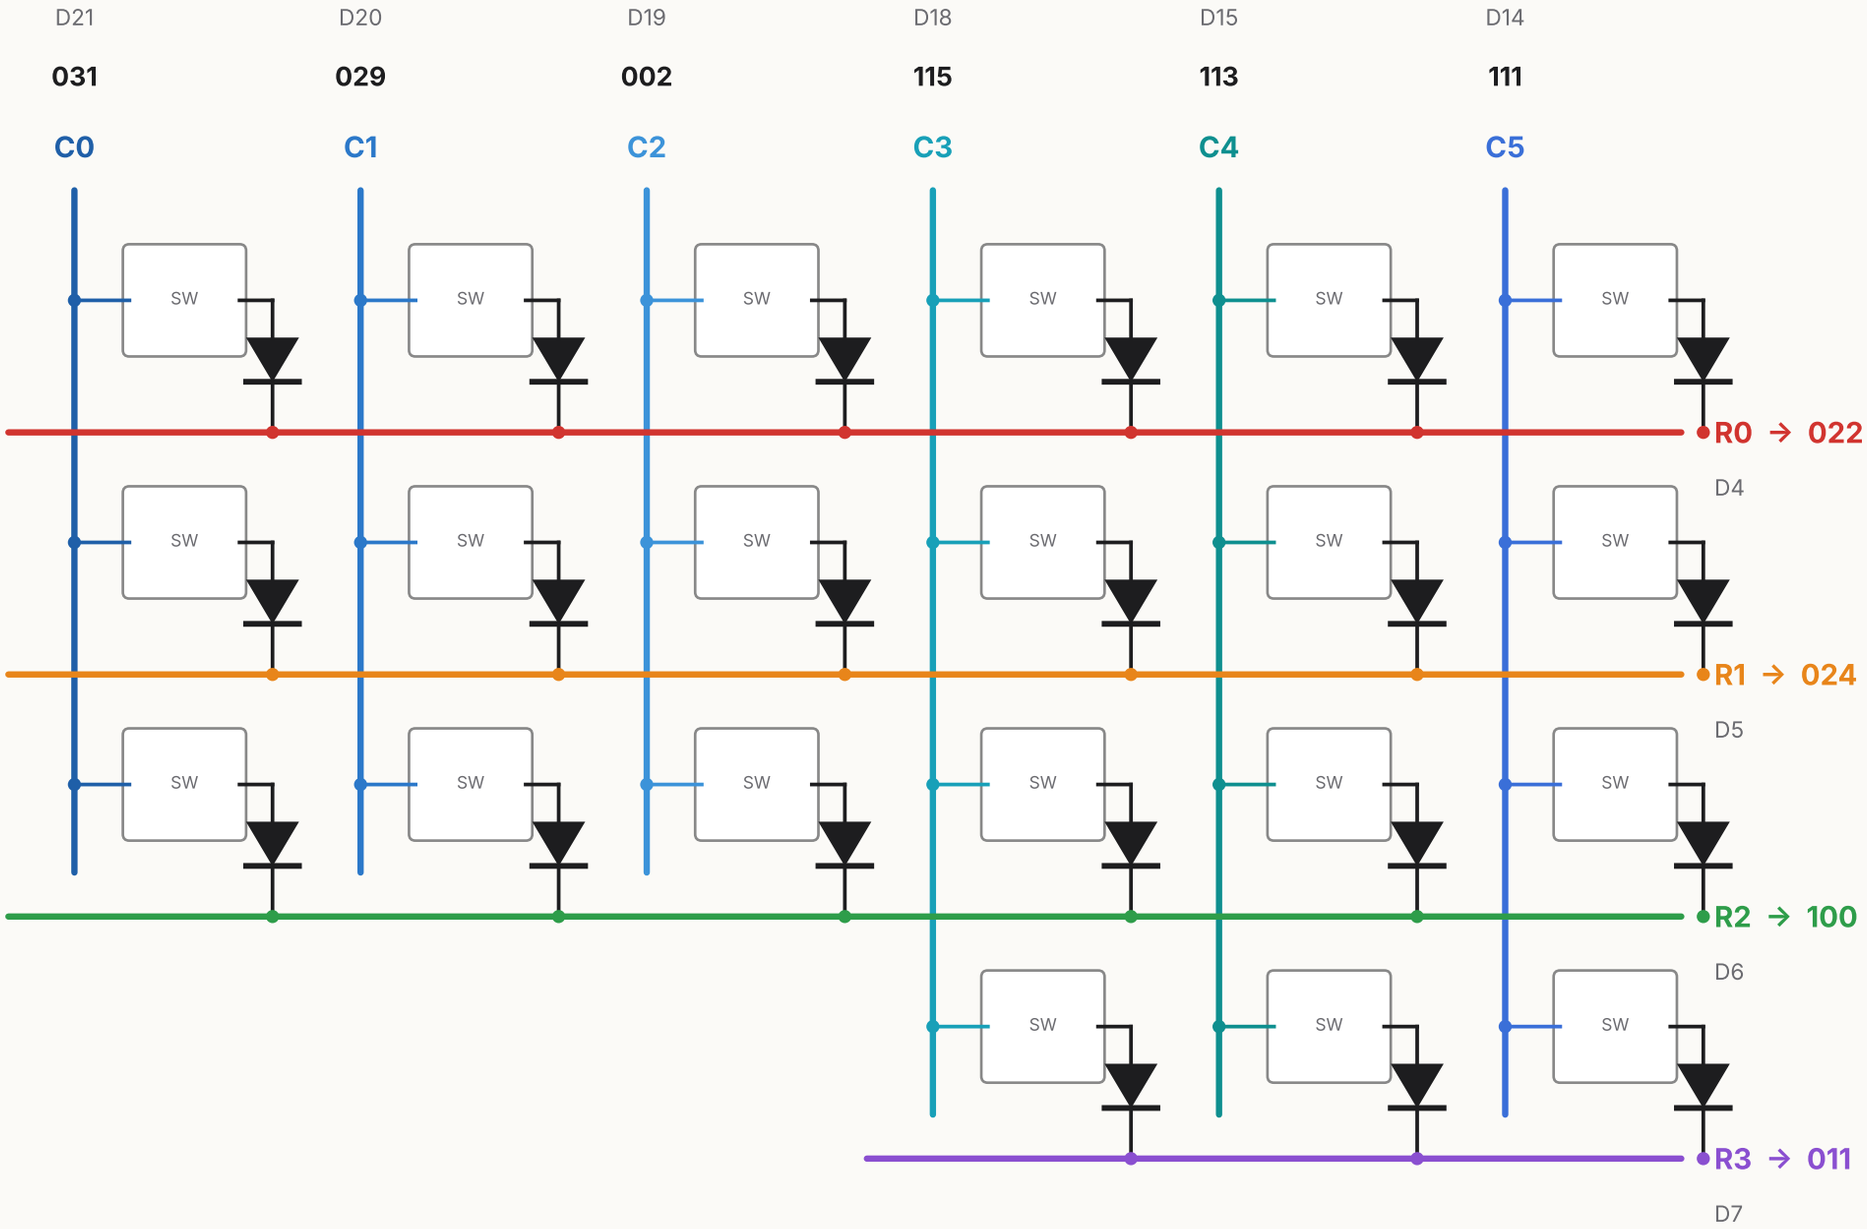


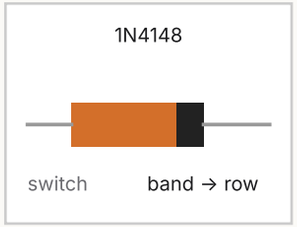


Same wiring on both halves. C0 is the outer pinky column on each half; the 3 thumb keys sit on R3 under C3, C4, C5.

Each key: column wire → switch pin, other switch pin → diode → row wire. Diode band (cathode) toward the ROW. 1N4148 diodes.

LEFT half: complete wiring, seen from underneath

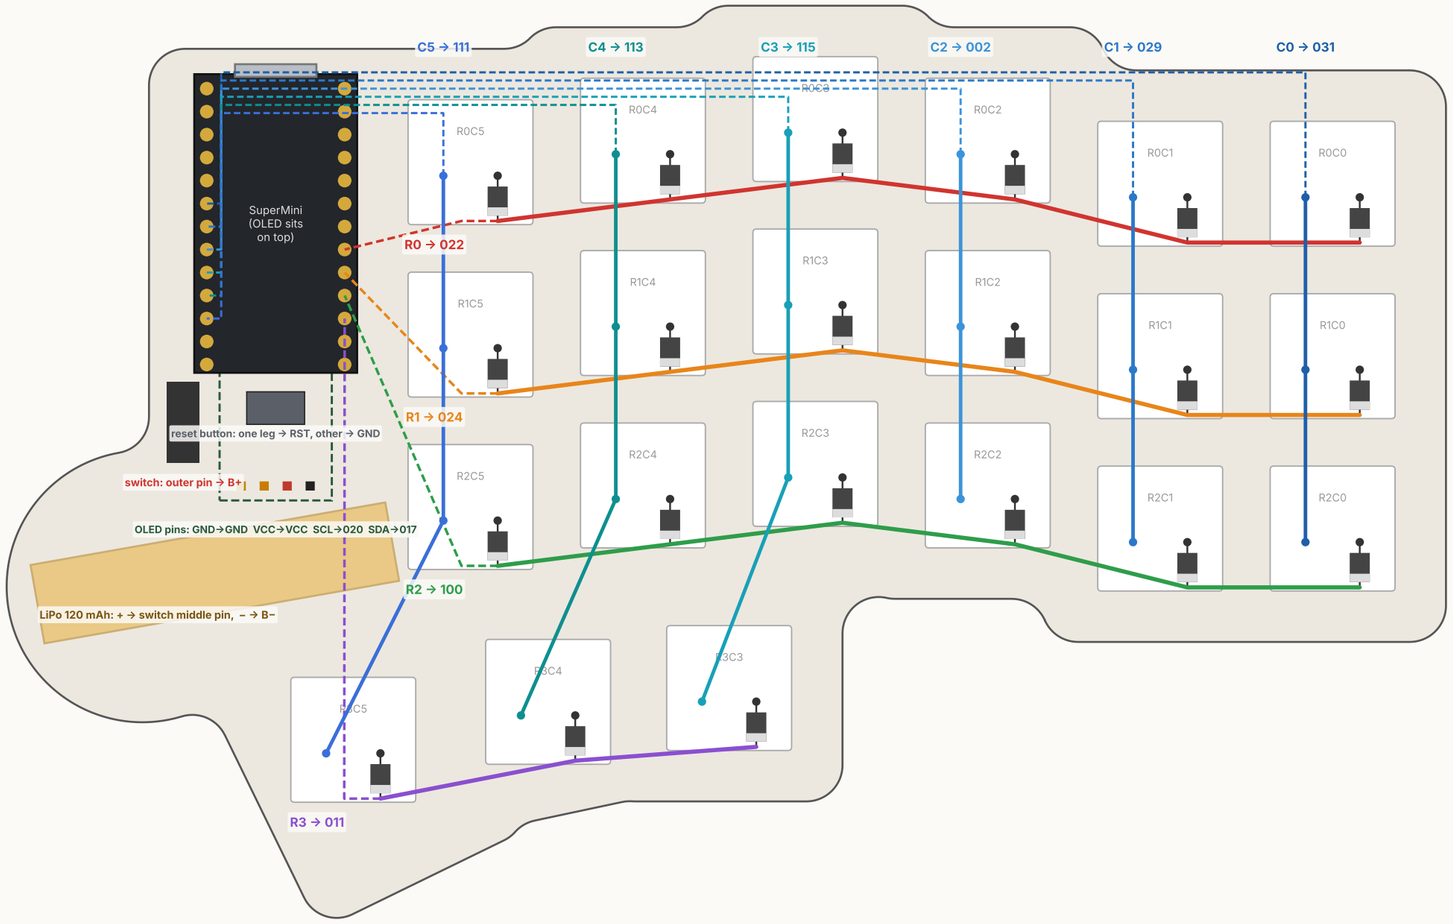


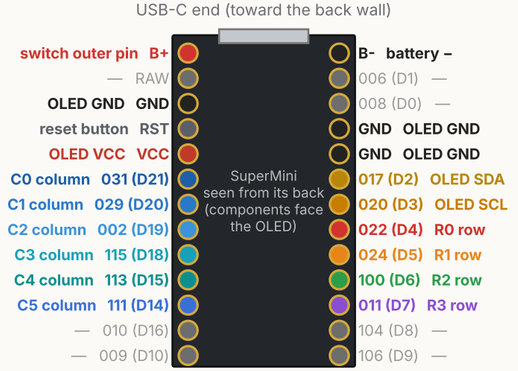


Seen from underneath, plate face-down: the way you solder. Solid = wires along the keys, dashed = runs to the board (keep them flat along the back wall and beside the battery, never over it).

Pad names are as printed on your SuperMini. 30 AWG silicone wire. Solder the trackpad and OLED wires first, then the matrix.

RIGHT half: complete wiring, seen from underneath

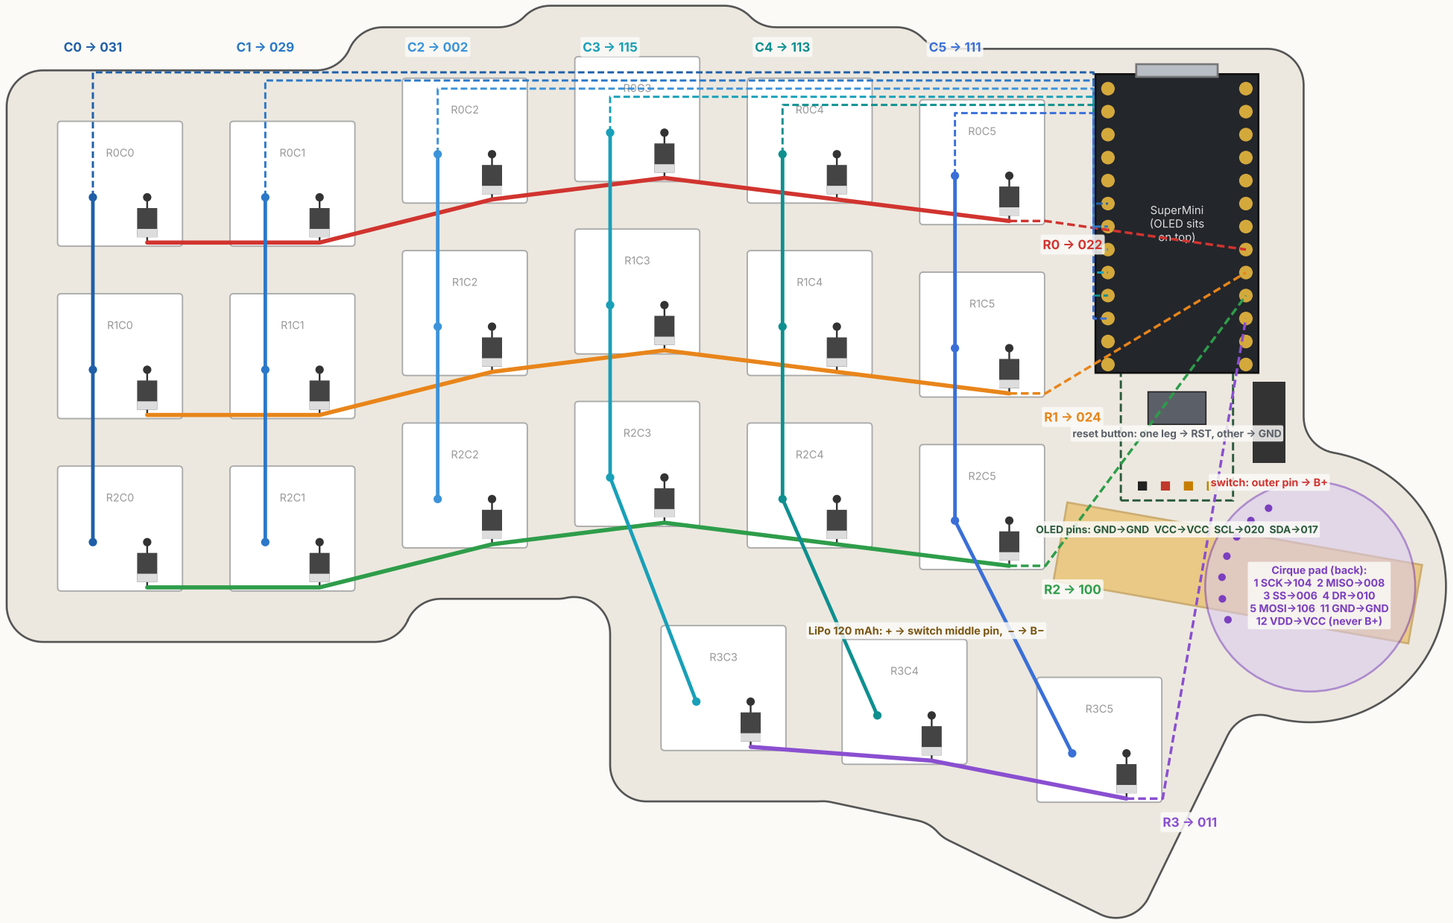

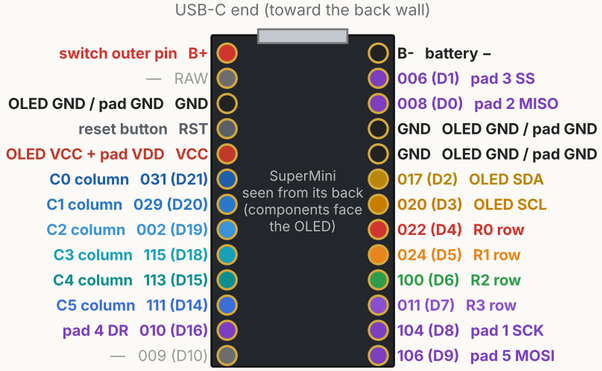


Seen from underneath, plate face-down: the way you solder. Solid = wires along the keys, dashed = runs to the board (keep them flat along the back wall and beside the battery, never over it).

Pad names are as printed on your SuperMini. 30 AWG silicone wire. Solder the trackpad and OLED wires first, then the matrix.

SuperMini nRF52840: components up, USB-C at the top (as in the shop photo)

USB-C is flush with this edge, on the component side

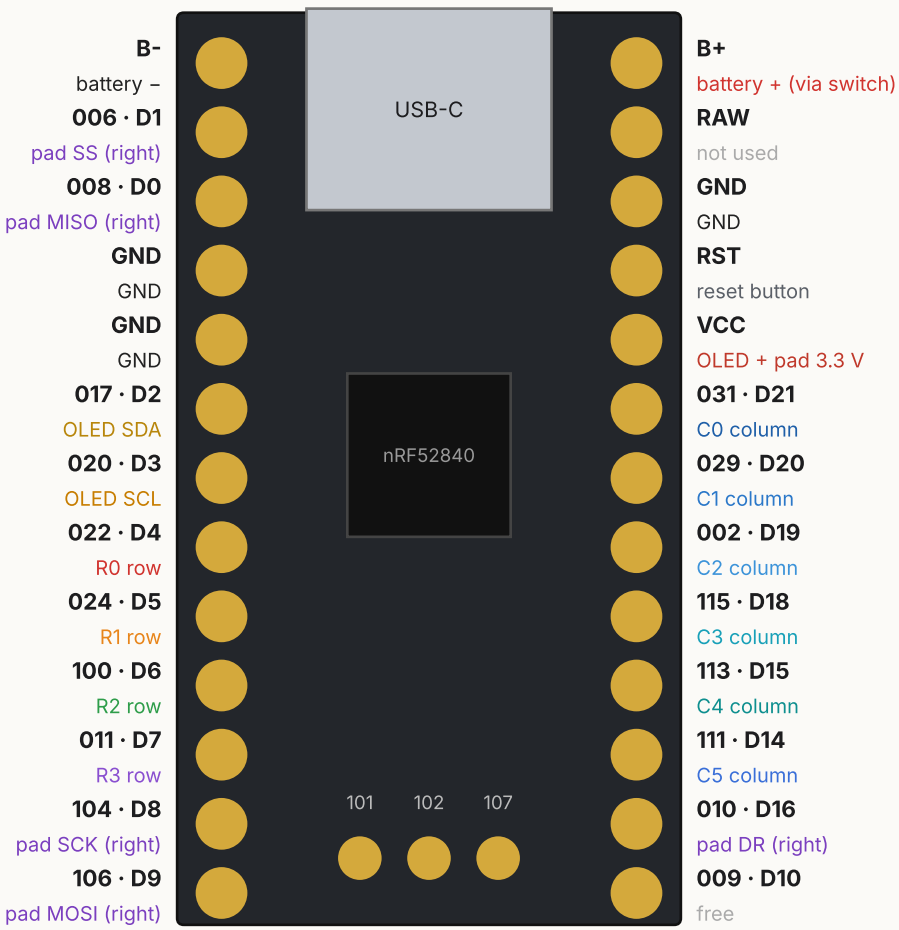

middle pads: free