

HAZARD IDENTIFICATION REPORT

Place of Inspection: Male Dormitory Abu Bakar Ash-Shidiq, Universitas Darussalam Gontor (UNIDA Gontor).

Date of Inspection: 22 June 2026

Team of Inspection:

- 1) Dr. Mohd Shahril Bin Abu Hanifah
- 2) Dr. Norwahida Binti Yakub
- 3) Dr. Azim Azuan Bin Osman
- 4) Mrs. Nur Fazhilah Binti Abdul Razak

A. SAM-iSAFE Checklist System

Score:

0 = Not available / Not implemented

1 = Partially available / Partially implemented

2 = Fully available / Fully implemented

Total Score = Sum of all items (Maximum = 100)

Safety Index (%) = (Total Score / 100) × 100

Score	Risk Level
80–100%	Low Risk / Good Safety Readiness
60–79%	Moderate Risk / Improvement Needed
Below 60%	High Risk / Immediate Action Required

Domain	Checklist Items	Assessor 1	Assessor 2
1. Physical Safety	Building structure and materials are safe and suitable for occupancy.	2	2
	Building approval/usage complies with relevant regulations (where applicable).	1	0
	Electrical wiring, sockets, and appliances are safe and regularly inspected.	1	0
	Classrooms and dormitories have adequate lighting and ventilation.	1	1
	Furniture and equipment are arranged safely and do not pose hazards.	1	1
	Corridors, staircases, and walkways are unobstructed and safe for movement.	1	2
	Emergency exits and access routes are clearly accessible at all times.	1	2
	Dormitory occupancy density is within safe limits (not overcrowded).	2	2
	Adequate spacing between beds allows safe movement.	2	2
	Storage of materials (including flammable or hazardous items) is safe and controlled.	0	1

2. Emergency Preparedness & Fire Safety	Fire extinguishers are available, accessible, suitable and serviced.	1	0
	Fire alarm systems, smoke/heat detectors, and emergency lighting are functional.	0	0
	Exit signs and evacuation routes are clearly marked and visible.	0	0
	Emergency exit doors are accessible and open in the direction of escape.	0	2
	Assembly points are designated and communicated to all occupants.	0	0
	Fire drills or evacuation exercises are conducted periodically	0	0
	Records of drills (e.g., evacuation time, participation) are maintained.	0	0
	An emergency response plan (ERP) is established and communicated.	0	0
	Emergency contact numbers are displayed in visible locations.	0	0
	Fire risks such as open flame, cooking areas, and electrical misuse are controlled.	0	1
3. Health, Hygiene & Disease Control	Clean and safe water supply is available for daily use.	1	2
	Toilets and bathrooms are clean, functional, and well maintained.	1	1
	Dormitories and classrooms are kept clean and hygienic.	1	2
	Kitchens and dining areas follow proper food hygiene practices.	0	1
	Food storage and preparation follow safe handling procedures.	0	2
	Waste management and disposal systems are properly maintained.	2	1
	Pest control measures are implemented effectively.	0	1
	First aid kits are available, accessible, and properly maintained.	0	2
	Health monitoring or screening practices are implemented when necessary.	2	0
	Infection control measures (e.g., during outbreaks) are in place.	1	0
4. Safety Behaviour	Students and staff comply with safety rules and standard operating procedures (SOPs).	1	2
	Unsafe behaviours (e.g., blocking exits, unsafe electrical use) are monitored and controlled.	0	1
	Students and staff participate in safety briefings, training, or awareness activities.	0	0
	Fire drills and emergency exercises are actively participated in by all occupants.	0	0

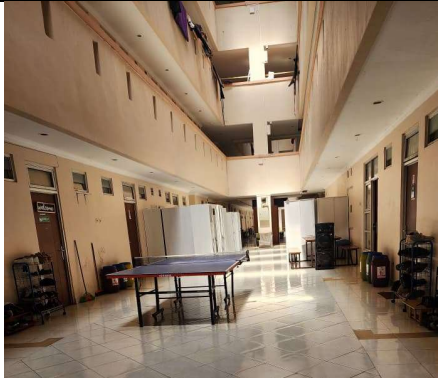
	Hazard identification activities (e.g., inspections, hazard hunts) are conducted.	0	0
	Incidents, hazards, and near misses are reported by students and staff.	0	0
	Safety violations are addressed through corrective actions.	0	0
	Safety awareness is consistently reinforced by teachers or administrators.	1	0
	Students demonstrate awareness of emergency procedures.	1	1
	Safety practices are integrated into daily routines and activities.	0	0
5. Social Support & Governance	A safety and health policy is established and communicated to all stakeholders.	1	0
	A safety committee or designated safety team is established.	0	0
	Regular safety meetings or discussions are conducted.	0	0
	Safety inspections and audits are conducted periodically.	0	0
	Records and documentation of safety activities are maintained.	0	0
	Collaboration with external agencies (e.g., BOMBA, PBT, health authorities) is established.	0	0
	Safety training and capacity-building programs are provided to staff and students.	0	0
	Emergency roles and responsibilities are clearly assigned.	1	0
	Support mechanisms for student wellbeing (e.g., counselling, anti-bullying) are available.	2	1
	Safety improvement actions are implemented based on inspection findings.	1	0
TOTAL SCORE		29	33
SAFETY INDEX		29%	33%
RISK LEVEL		HIGH	HIGH

Overall Comment:

The safety assessment shows an average Safety Index of 31%, placing the facility within the **High Risk** category and indicating that structured safety management requires urgent enhancement. While certain foundational elements, such as building structural suitability and dormitory occupancy density, are currently adequate, there are significant systemic gaps across the core domains of emergency preparedness, safety governance, and proactive hazard behavior monitoring. The near-zero scores in fire safety infrastructure, formal incident reporting, and external agency collaboration highlight a pressing need to transition from an informal approach to a structured safety framework. To ensure a fully secure and compliant environment for all occupants, it is gently recommended that management prioritize the development of an Emergency Response Plan, establish a formal safety committee, and implement regular safety training to foster a proactive safety culture.

B. Walkthrough Observation

No.	Hazard	Effect	Control Measure
1.	Fire extinguisher is covered in mud/dirt, shows signs of rust on the brackets/nozzle, and the inspection tag is missing. 	Equipment failure during a fire emergency, leading to uncontrolled fire spread, property damage, or loss of life.	- Schedule an inspection by a certified fire safety technician to check pressure and functionality. - Replace the unit if it fails inspection. - Ensure regular monthly/annual checks are logged on a visible tag. - Provide training for the staff/occupants in fire management.
2.	Visible structural cracks in the concrete/plaster ceiling accompanied by dark mold growth and water stains near an air vent. 	- Respiratory issues or allergies due to mold spores - Potential ceiling collapse or falling debris causing head injuries.	- Remove the cracks ceiling - Cordon off the area if necessary. - Task the maintenance team to identify and fix the underlying water leak and repair the structural crack. - Treat/remove the mold. - Implement routine inspection schedule - Limit indoor activities that generate high humidity
3.	Obstruction of emergency evacuation routes due to placement of a ping-pong table and multiple recreational items directly along the main communal hall/atrium walkway.	Causing a crush or delay hazard; potential tip-over injury; collision hazard.	- Relocate the wardrobes to individual rooms or designated storage areas. - Move the ping-pong table to a dedicated recreational room

			or fold and store it against a non-critical wall when not in use. • Ensure all designated escape routes and hallways remain completely clear. • Provide storage facilities. • Install permanent barriers such floor marking to prevent placement of equipment within emergency access routes.
4.	Scattered construction debris, a loose bicycle wheel, shoes, boxes, and miscellaneous trash piled on an outdoor concrete pathway. 	• Slip, trip, and fall hazards • Sharp items can cause puncture wounds • Breeding grounds for pests (rodents, mosquitoes), venomous animal (snake) • Blocks exterior access.	• Remove all unnecessary waste materials from the pathway immediately • Perform a thorough housekeeping. • Properly dispose of trash/scrap items. • Organize usable materials in a designated storage shed • Install waste bins/skids for construction debris disposal. • Assign responsible personnel to monitor housekeeping
5.	Green, murky, stagnant water accumulating in an outdoor water fountain feature may promote vector disease.	• Dengue or Zika virus) • Foul odor.	• Drain and clean the fountain basin to remove algae. • Ensure the water filtration/pump system runs

			regularly to keep water moving. • Treat the water with appropriate larvicides (e.g., Abate). • Monitor water quality and cleanliness conditions regularly
6.	Poor hygiene practices, unsealed food bags, and dirty shelving inside a shared refrigerator may cause bacterial cross-contamination of stored food items.  	• Food poisoning or stomach illnesses. • Unpleasant odors attracting pests. • Mental stress with unpleasant odor	• Establish a regular cleaning schedule for communal refrigerators. • Implement a policy requiring all food to be stored in labeled, airtight containers. • Discard items expired weekly. • Assign responsibility for refrigerator maintenance.
7.	The plastic utility/network enclosure mounted on the pillar is wide open with exposed wiring.	• Risk of electrical shock or short-circuit if tampered	• Securely close and lock the utility box door to protect the wiring.

		with or exposed to moisture.	• Conduct regular inspection and maintenance of utility/network enclosures. • Display warning labels/signage indicating electrical hazards where necessary.
8.	Uncovered recycling/waste barrels that may attract pests, cause foul odours, and increase fire hazards. 	• Health issues such as allergies, respiratory irritation • Psychological stress from odor • Potential fire hazard if flammable materials are dropped inside.	• Equip all waste barrels with tight-fitting or flip-top lids to contain odors and prevent pest access. • Locate waste storage areas away from indoor working/living areas where possible. • Provide awareness training on proper waste disposal practices.
9.	The wall panel hatch to a plumbing/utility shaft is left wide open. 	• Unauthorized access or tampering. • Objects/trash dropped inside could damage utilities • Protrusion hazard where a passerby could hit the sharp door edge.	• Close the utility door. • Install a latch or lock mechanism that can only be opened by authorized maintenance personnel.

10.	A large, open hole in the floor right next to a flight of stairs, lacking any barricade or warning signs. 	• Extreme fall hazard. • Stepping or falling into the opening could cause severe fractures, head trauma, or fatal injuries.	• Cordon off the area with safety cones/warning tape. • Install a load-bearing, flush-fitting floor cover • Secure perimeter guardrail around the opening. • Install warning markings or hazard tape around the opening area.
-----	--	---	---