

DTI FORULA STUDENT MOTOR

Specification for F-MOT motor

Version 1.4

Valid for F-MOT-A and F-MOT-B motors

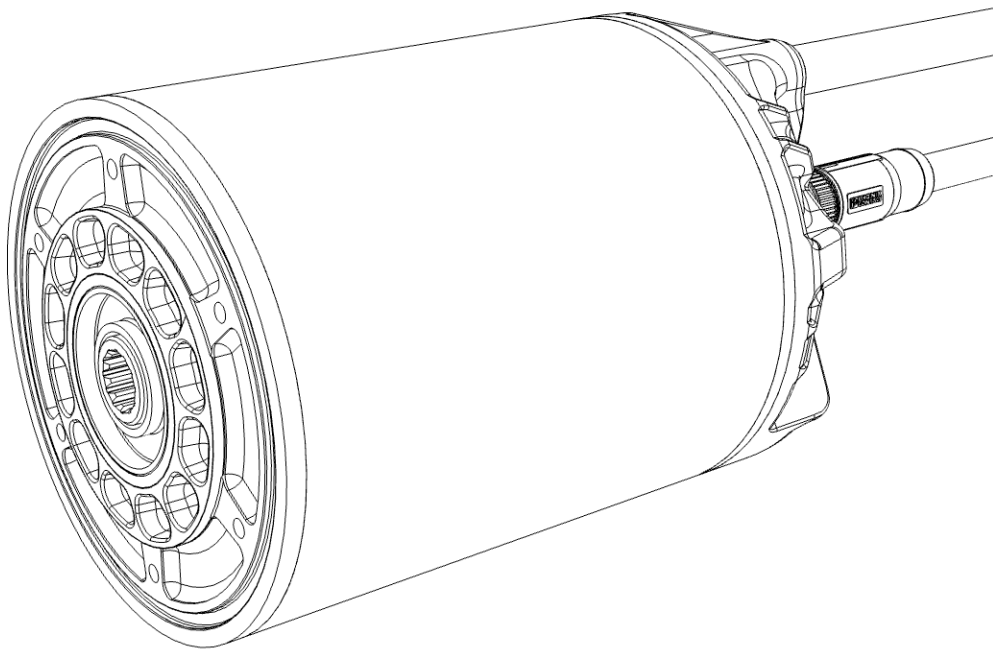


Table of contents

1.	History and related documents.....	3
1.1	Document history.....	3
1.2	Related documents.....	3
2.	Technical specifications.....	4
2.1	Motor peak and nominal condition.....	4
2.2	Motor basic parameters.....	4
2.3	Motor mechanical parameters	5
3.	Thermal and mechanical specification	6
4.	Motor power losses	7
4.1	Total iron loss	7
4.2	Conductive loss	7
4.3	Motor efficiency.....	8
4.4	Torque vs. RPM.....	9
5.	List of tables	10
6.	List of figures	11

1. HISTORY AND RELATED DOCUMENTS

1.1 Document history

10/2024	V1.0 Document created; basic specifications added
02/2025	V1.1 Aluminium material changed, additional appendixes remarked
02/2025	V1.2 Motor Torque-RPM chart added
10/2025	V1.3 Merged document for F-MOT-A and F-MOT-B motor
11/2025	V1.4 Nominal torque value corrected

1.2 Related documents

- F-MOT Motor Application Manual
- F-MOT-A cooled zones // F-MOT-B cooled zones
- F-MOT-A_Drawing // F-MOT-B_Drawing
- F-MOT-A motor_mummy.step // F-MOT-B motor_mummy.step CAD Models
- F-MOT Shaft Geometry.step CAD Model
- F-MOT Power Losses excel sheet

2. TECHNICAL SPECIFICATIONS

Parameters provided by Fischer Elektromotoren.

2.1 Motor peak and nominal condition

Table 1. motor peak and nominal specifications

	F-MOT	Unit
Peak Torque ¹	31,6	Nm
Peak Current ²	85	Arms
Maximum Speed	20.000	rpm
Peak Power ³	35	kW
Nominal Torque	11,1	Nm
Nominal Current	22,6	Arms
Nominal Speed	13250	rpm
Nominal Power	15,4	Kw

2.2 Motor basic parameters

Table 2. basic specifications

	F-MOT	Unit
Torque Constant	0,492	Nm/Arms
BEMF Constant	0,031	Vrms/rpm
Maximum DC bus voltage	600	Vdc
Pole pairs	4	
Temperature sensor ⁴	PT1000	
Position sensor type	TE connectivity 2-1393047-5	
Peak efficiency	>96	%
Phase resistance at 20 °C ⁵	0,126	Ω
Phase inductance ⁶	0,393	mH

¹ Corrected to DTI measured value

² Corrected to DTI measured value

³ Measured at 10.500 rpm

⁴ Isolation voltage 2kV

⁵ Measured resistance per phase

⁶ Measured inductance per phase

2.3 Motor mechanical parameters

Table 3. mechanical specifications

	F-MOT	Unit
Weight	3,7	Kg
Diameter	94,5	mm
Length	113	mm
Length with connector housing	160	mm
Motor housing material	Aluminum Alloy 6082	
Motor shaft material	Titanium Grade 5 (Ti-6Al-4V)	
Motor shaft spline DIN 5480-30deg Flat root	Side fit-11x0,8x30°x12 9H 7h	

- For exact dimensions please check the F-MOT-A Drawing or the F-MOT-B Drawing according to your motor type.

3. THERMAL AND MECHANICAL SPECIFICATION

To ensure that if the inverter is capable of current control (as in the case of the F-SIC inverter), but the user still needs to specify a torque value, a table is provided here to determine the correct values. Data provided by Fischer Elektromotoren.

Table 4. Motor torque and AC current

Motor AC current	Motor torque
5 Arms	2,6 Nm
11 Arms	5,6 Nm
16 Arms	8,2 Nm
21 Arms	10,6 Nm
26 Arms	13,1 Nm
31 Arms	15,5 Nm
36 Arms	17,9 Nm
41 Arms	20,4 Nm
46 Arms	22,7 Nm
51 Arms	25,0 Nm
56 Arms	27,3 Nm
61 Arms	29,5 Nm
66 Arms	31,6 Nm

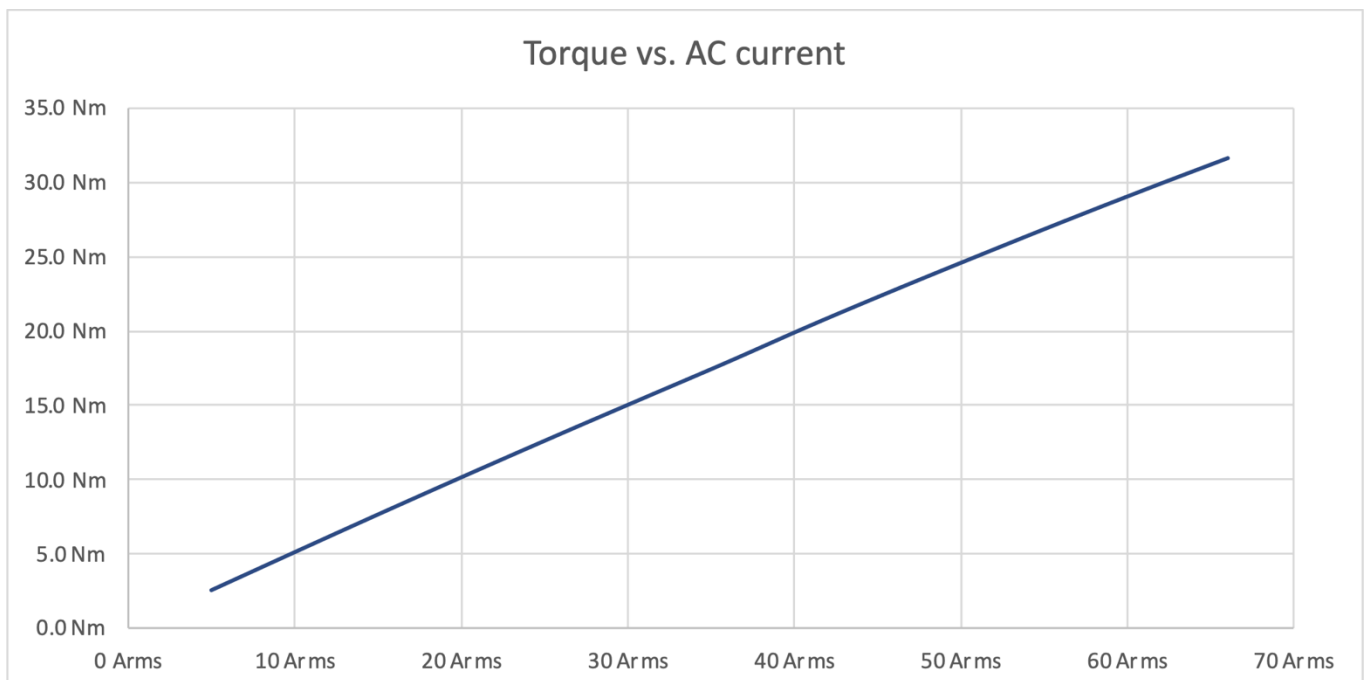


Figure 1 Motor torque and AC current

4. MOTOR POWER LOSSES

The motor generates two main types of losses. The first is the conductive loss, which arises in the motor stator windings and is dependent on the AC current. The second is the iron loss, which occurs in the core of both the stator and rotor. This loss is dependent on the rotational speed of the motor. The iron loss data was provided by Fischer Elektromotoren.

4.1 Total iron loss

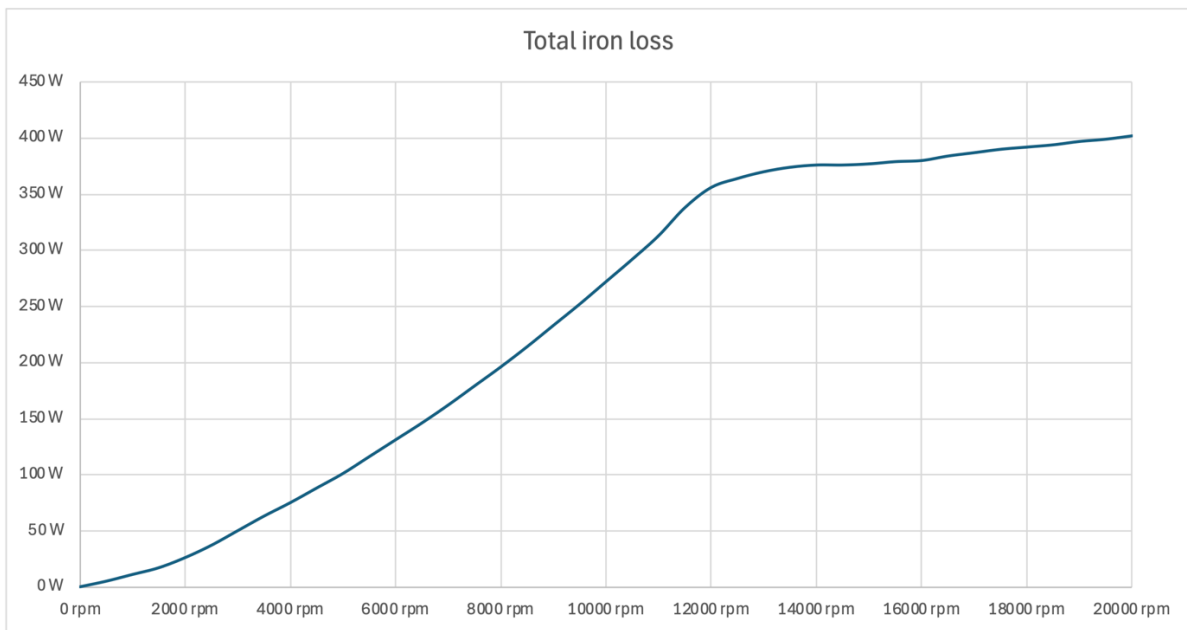


Figure 2 Total iron losses

4.2 Conductive loss

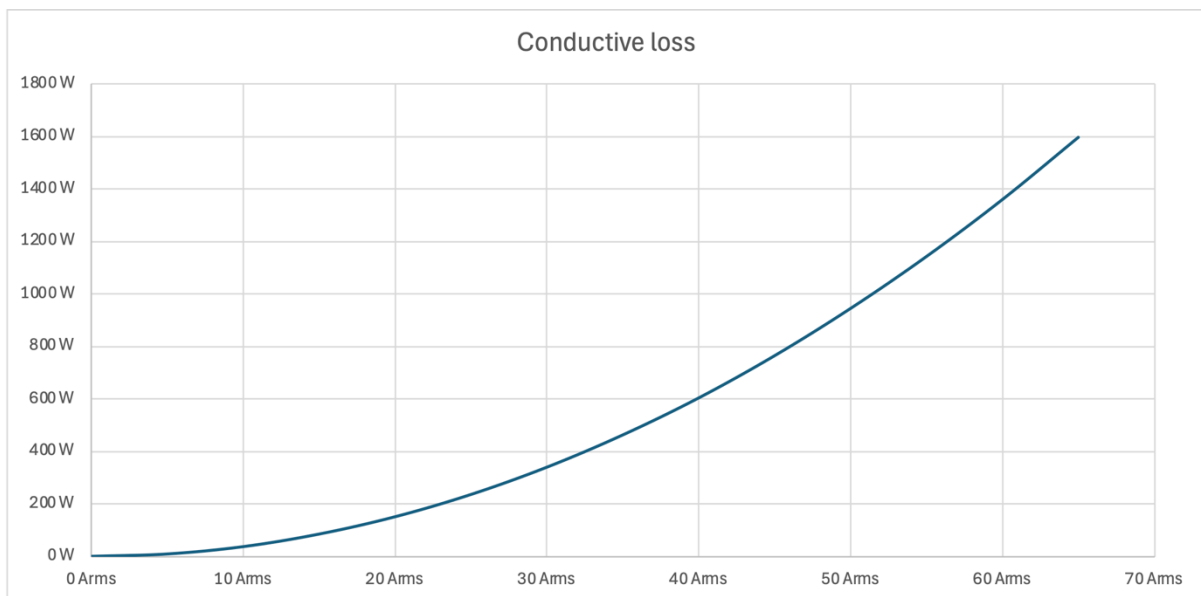


Figure 3 Conductive loss

4.3 Motor efficiency

The efficiency data was provided by **Fischer Elektromotoren**.

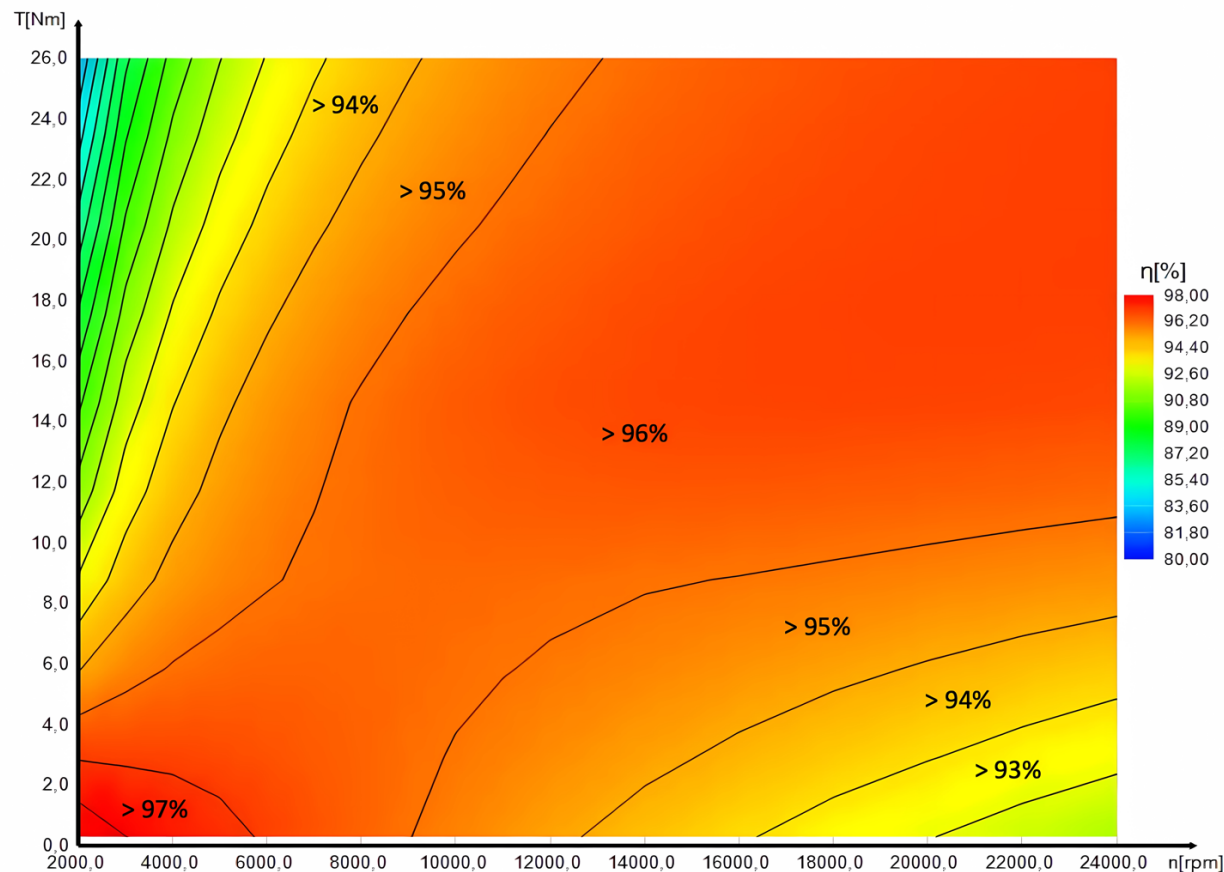


Figure 4 Motor efficiency graph

4.4 Torque vs. RPM

Data provided by Fischer Elektromotoren.

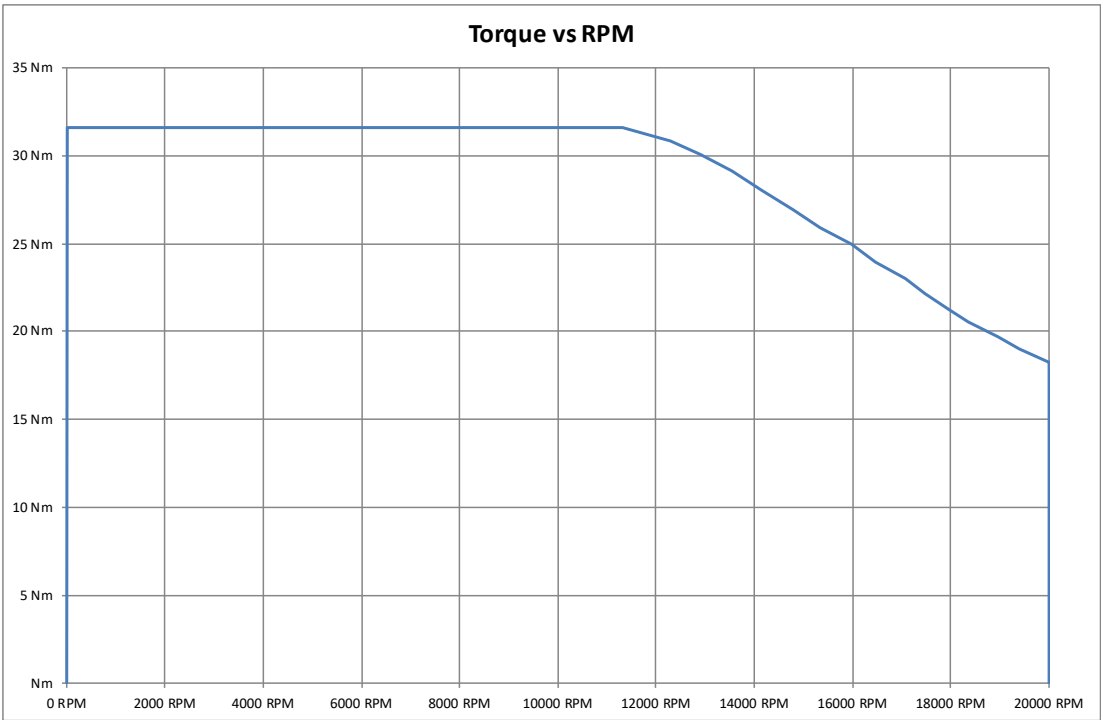


Figure 5 Torque vs. RPM Graph

5. LIST OF TABLES

Table 1. motor peak and nominal specifications..... 4

Table 2. basic specifications..... 4

Table 3. mechanical specifications 5

Table 4. Motor torque and AC current 6

6. LIST OF FIGURES

Figure 1 Motor torque and AC current 6

Figure 2 Total iron losses 7

Figure 3 Conductive loss 7

Figure 4 Motor efficiency graph 8

Figure 5 Torque vs. RPM Graph..... 9