Advantage Environmental & Safety Services

ASBESTOS AND LEAD SURVEY REPORT

United States Coast Guard – Sector San Diego

2170 N. Harbor Drive, San Diego, California 92101



U.S. Coast Guard Sector San Diego – site entrance

AESS Job Number:	26-092
Survey / Sample Collection Date:	July 15, 2026
Report Date:	August 3, 2026
Prepared For:	United States Coast Guard – Sector San Diego
Prepared By:	Advantage Environmental & Safety Services (AESS)

1.0 Executive Summary

Advantage Environmental & Safety Services (AESS) was retained to perform an asbestos- and lead-containing materials survey of designated interior areas at the United States Coast Guard (USCG) Sector San Diego facility, located at 2170 N. Harbor Drive, San Diego, California 92101 (the "Site"). The survey was performed on July 15, 2026 by Matt Bailey, Certified Site Surveillance Technician (CSST) and Lead Sampling Technician, of AESS, and consisted of representative bulk sampling of suspect asbestos-containing materials (ACM) and suspect lead-containing building materials within four buildings (Building D, Building C, Building C-2, and Building F) identified on the sample location diagrams provided as Figures 1 through 4 (Section 5.3).

Twenty-nine (29) bulk samples (representing 86 individual material layers) were collected and submitted for Polarized Light Microscopy (PLM) analysis of asbestos content. Chrysotile asbestos was detected at 2% by visual estimation in three (3) of the twenty-nine samples: Sample 071526-CGSD-12 (texture/taping mud/drywall, Building C, Main Rec Room ceiling), Sample 071526-CGSD-22 (granular material beneath ceramic wall tile, Building C-2, Rm C9/C10 bathroom), and Sample 071526-CGSD-24 (texture/taping mud/drywall, Building C-2, Rm C13/C14 bathroom). These three results are above the 1% analytical threshold used to define asbestos-containing material under 40 CFR Part 61 (NESHAP) and 40 CFR Part 763 (AHERA); the associated materials are confirmed ACM. No asbestos was detected in the remaining twenty-six samples. Eleven (11) bulk samples were collected and submitted for lead analysis by flame atomic absorption spectroscopy (EPA Method 7000B). Detectable lead was identified in two (2) of the eleven samples — both in Building D — at concentrations of 39.0 mg/kg (0.0039% by weight, Sample 071526-CGSD-Pb2, ceramic floor tile grout/thin-set) and 34.9 mg/kg (0.00349% by weight, Sample 071526-CGSD-Pb3, beige paint on drywall), both below the federal regulatory definition of lead-based paint (≥ 0.50% by weight / ≥ 5,000 mg/kg). No lead was detected above the laboratory reporting limit in the remaining nine samples.

A summary of findings and AESS recommendations is provided in Sections 5.0 and 6.0 of this report. Complete laboratory analytical reports, chain-of-custody documentation, and the sample location diagrams (Figures 1–4) are included as Appendices A and B, with applicable personnel certifications provided in Appendix C.

2.0 Introduction and Scope of Work

This report presents the results of a limited asbestos- and lead-containing materials survey conducted by AESS at the request of the United States Coast Guard in connection with planned maintenance, renovation, or abatement-related activities at Sector San Diego. The purpose of the survey was to identify the presence and approximate concentration of asbestos and lead in designated suspect building materials so that appropriate handling, abatement, and disposal procedures can be planned prior to disturbance of those materials.

The scope of work performed by AESS included the following:

- A visual survey of designated interior spaces within Building D (Berthing Room), Building C (Rec Room, including the nursing room and janitor closet), Building C-2 (restrooms serving Rooms C9/C10 and C13/C14), and Building F (Kitchen) to identify homogeneous areas of suspect asbestos-containing and lead-containing materials.

- Collection of twenty-nine (29) representative bulk samples of suspect ACM in general accordance with 40 CFR Part 763 (AHERA) protocols.
- Collection of eleven (11) representative bulk samples of suspect lead-containing materials (paint and ceramic tile/glaze).
- Submission of all samples under chain-of-custody to Schneider Laboratories Global, Inc. (Richmond, Virginia), an accredited analytical laboratory.
- Preparation of sample location diagrams and this summary report of findings.

This survey was limited to the specific materials, locations, and areas identified by AESS field staff and shown on the sample location diagrams in Figures 1–4 (Section 5.3). AESS did not perform a comprehensive, building-wide hazardous materials survey. Refer to Section 7.0, Limitations, for additional information regarding the scope and applicability of this report.

3.0 Site Description

The Site is the USCG Sector San Diego facility located at 2170 N. Harbor Drive, San Diego, California. The areas surveyed include a berthing room (Building D), a recreation room complex including a nursing room and janitor closet (Building C), two restroom groups serving Rooms C9/C10 and C13/C14 (Building C-2), and a kitchen (Building F), as depicted in the sample location diagrams (Figures 1–4, Section 5.3). Suspect materials sampled included ceramic wall and floor tile with associated setting materials (grout, thin-set, and glue), painted drywall, texture and taping mud/joint compound systems, FRP glue, carpet glue, baseboard and baseboard glue, and glossy brown floor coating over a cementitious substrate.

4.0 Survey Methodology

4.1 Asbestos Sampling and Analysis

Suspect ACM was identified by visual inspection and grouped into homogeneous areas based on material type, color, texture, and apparent date of installation. Representative bulk samples were collected from each homogeneous area using wetting techniques and dedicated sampling tools to minimize fiber release, double-bagged, labeled, and submitted under chain-of-custody to Schneider Laboratories Global, Inc. Samples were analyzed by Polarized Light Microscopy (PLM) in accordance with EPA Method 600/R-93/116 and 40 CFR Part 763, Appendix E, Subpart E. Materials composed of multiple layers (e.g., tile / setting bed / grout, or drywall / joint compound / texture) were analyzed and reported by individual layer.

4.2 Lead Sampling and Analysis

Suspect lead-containing painted surfaces and ceramic tile/glaze were sampled by removing a representative bulk chip or section of material. Samples were submitted under chain-of-custody to Schneider Laboratories Global, Inc. and analyzed for total lead content by flame atomic absorption spectroscopy in accordance with EPA Method 7000B. Results are reported in milligrams of lead per kilogram of sample (mg/kg, equivalent to parts per million) and as percent lead by dry weight.

5.0 Summary of Findings

5.1 Asbestos Analytical Results

Twenty-nine bulk samples (Schneider Laboratories Order No. 698175), representing 86 analyzed material layers, were submitted for PLM analysis. Chrysotile asbestos was detected at 2% in one or more layers of three samples: 071526-CGSD-12 (texture/taping mud/drywall, Building C), 071526-CGSD-22 (granular material beneath ceramic wall tile, Building C-2), and 071526-CGSD-24 (texture/taping mud/drywall, Building C-2). These three results are confirmed ACM. No asbestos fibers were detected in any layer of the remaining twenty-six samples. A summary of sampled materials is provided in Table 1; the complete laboratory report is included as Appendix A.

Table 1. Asbestos (PLM) bulk sample summary – Schneider Laboratories Order No. 698175.

Sample ID	Location	Material Sampled	Asbestos Result
071526-CGSD-1	Bldg D, Berthing Rm, NW Floor Wall	2" ceramic wall tile (white), grout, glue	None Detected
071526-CGSD-1.5	Bldg D, Berthing Rm	2" ceramic wall tile (white), grout, glue	None Detected
071526-CGSD-2	Bldg D, Berthing Rm, NW Wall	2" ceramic floor tile (grey), grout, thin-set	None Detected
071526-CGSD-2.5	Bldg D, Berthing Rm	2" ceramic floor tile (grey), grout, thin-set	None Detected
071526-CGSD-3	Bldg D, Berthing Rm, South Wall	FRP glue	None Detected
071526-CGSD-4	Bldg D, Berthing Rm, SW Wall	FRP glue	None Detected
071526-CGSD-5	Bldg D, Berthing Rm, NE Wall	Texture, taping mud, drywall	None Detected
071526-CGSD-6	Bldg D, Berthing Rm, SW Wall	Texture, taping mud, drywall	None Detected
071526-CGSD-7	Bldg C, Main Rec Rm, NW corner wall	Texture, taping mud, drywall	None Detected
071526-CGSD-8	Bldg C, Rec Room, Janitor Closet, SE Wall	Taping mud, drywall	None Detected
071526-CGSD-9	Bldg C, Main Rec Rm, South wall	Baseboard, glue	None Detected
071526-CGSD-10	Bldg C, Rec Room, nursing room, NE wall	Baseboard, glue	None Detected
071526-CGSD-11	Bldg C, Rec Room, nursing room, NE wall	Texture, taping mud, drywall	None Detected
071526-CGSD-12	Bldg C, Main Rec Rm, SW corner ceiling	Texture, taping mud, drywall	2% Chrysotile
071526-CGSD-13	Bldg C, Rec Room, nursing room floor	Carpet glue	None Detected
071526-CGSD-14	Bldg C, Rec Room, west floor	Carpet glue	None Detected
071526-CGSD-15	Bldg C, Rec Room, Janitor Closet floor	12" ceramic floor tile (brown), grout, thin-set	None Detected
071526-CGSD-16	Bldg F, Kitchen, Northwest corner	Texture, taping mud, drywall	None Detected
071526-CGSD-17	Bldg F, Kitchen, Southwest corner	Texture, taping mud, drywall	None Detected

071526-CGSD-18	Bldg F, Kitchen, South Wall	2"x4" ceramic wall tile (white), grout, mastic	None Detected
071526-CGSD-19	Bldg F, Kitchen, South Wall	2"x4" ceramic wall tile (black), grout, mastic	None Detected
071526-CGSD-20	Bldg C-2, Rm C9/C10 bathroom, North Wall	Texture, taping mud, drywall	None Detected
071526-CGSD-21	Bldg C-2, Rm C9/C10 bathroom, South Floor	Glossy brown coating, cementitious substrate	None Detected
071526-CGSD-22	Bldg C-2, Rm C9/C10 bathroom, South Wall	6" ceramic wall tile (white), grout, thin-set	2% Chrysotile
071526-CGSD-23	Bldg C-2, Rm C9/C10 bathroom, East Wall	4" ceramic wall tile (white), grout, thin-set	None Detected
071526-CGSD-24	Bldg C-2, Rm C13/C14 bathroom, South Wall	Texture, taping mud, drywall	2% Chrysotile
071526-CGSD-25	Bldg C-2, Rm C13/C14 bathroom, North Floor	Glossy brown coating, cementitious substrate	None Detected
071526-CGSD-26	Bldg C-2, Rm C13/C14 bathroom, South Wall	6" ceramic wall tile (white), grout, thin-set	None Detected
071526-CGSD-27	Bldg C-2, Rm C13/C14 bathroom, Shower Wall	4" ceramic wall tile (white), grout, thin-set	None Detected

5.2 Lead Analytical Results

Eleven bulk samples (Schneider Laboratories Order No. 698176) were submitted for total lead analysis. Detectable lead was identified in two samples, both in Building D: 071526-CGSD-Pb2 (39.0 mg/kg, 0.0039% by weight; ceramic floor tile grout/thin-set, Berthing Rm NW Wall) and 071526-CGSD-Pb3 (34.9 mg/kg, 0.00349% by weight; beige paint on drywall, Berthing Rm North Wall). Both concentrations are below the current federal regulatory threshold defining lead-based paint (0.50% by weight / 5,000 mg/kg) but confirm the presence of lead in these materials. No lead was detected above the laboratory reporting limit in the remaining nine samples. Results are summarized in Table 2; the complete laboratory report is included as Appendix B.

Table 2. Lead bulk sample summary – Schneider Laboratories Order No. 698176. Federal lead-based paint threshold: 0.50% by weight / 5,000 mg/kg.

Sample ID	Location	Material Sampled	Result	% by Wt.
071526-CGSD-Pb1	Bldg D, Berthing Rm NW Floor	2" ceramic wall tile (white)	<14.6 mg/kg	<0.00146%
071526-CGSD-Pb2	Bldg D, Berthing Rm NW Wall	2" ceramic floor tile (grey)	39.0 mg/kg	0.0039%
071526-CGSD-Pb3	Bldg D, Berthing Rm North Wall	Beige paint on drywall	34.9 mg/kg	0.00349%
071526-CGSD-Pb4	Bldg C, Main Rec Rm, SW corner wall	White paint on drywall	<23.0 mg/kg	<0.0023%
071526-CGSD-Pb5	Bldg C, Rec Room, Janitor Closet floor	12" ceramic floor tile (brown)	<14.8 mg/kg	<0.00148%
071526-CGSD-Pb6	Bldg F, Kitchen, East Wall	White paint on drywall	<23.8 mg/kg	<0.00238%
071526-CGSD-Pb7	Bldg F, Kitchen, South Wall	2"x4" ceramic wall tile (black)	<15.1 mg/kg	<0.00151%
071526-CGSD-Pb8	Bldg F, Kitchen, South Wall	2"x4" ceramic wall tile (white)	<15.5 mg/kg	<0.00155%
071526-CGSD-Pb9	Bldg C-2, Rm C9/C10 bathroom, South Wall	6" ceramic wall tile (white)	<14.6 mg/kg	<0.00146%

071526-CGSD-Pb10	Bldg C-2, Rm C9/C10 bathroom, East Wall	4" ceramic wall tile (white)	<15.4 mg/kg	<0.00154%
071526-CGSD-Pb11	Bldg C-2, Rm C13/C14 bathroom, Shower Wall	4" ceramic wall tile (white)	<15.5 mg/kg	<0.00155%

5.3 Sample Location Diagrams

Figures 1 through 4 depict the approximate location of each asbestos (PLM) and lead (Pb) sample collected during the July 15, 2026 survey, one figure per building. Yellow highlighting indicates no asbestos or lead was reported for that sample; violet highlighting indicates confirmed asbestos (samples 071526-CGSD-12, -22, and -24); red highlighting indicates the two lead detections (071526-CGSD-Pb2 and -Pb3), per the color key shown on each diagram.

Advantage Environmental & Safety Services


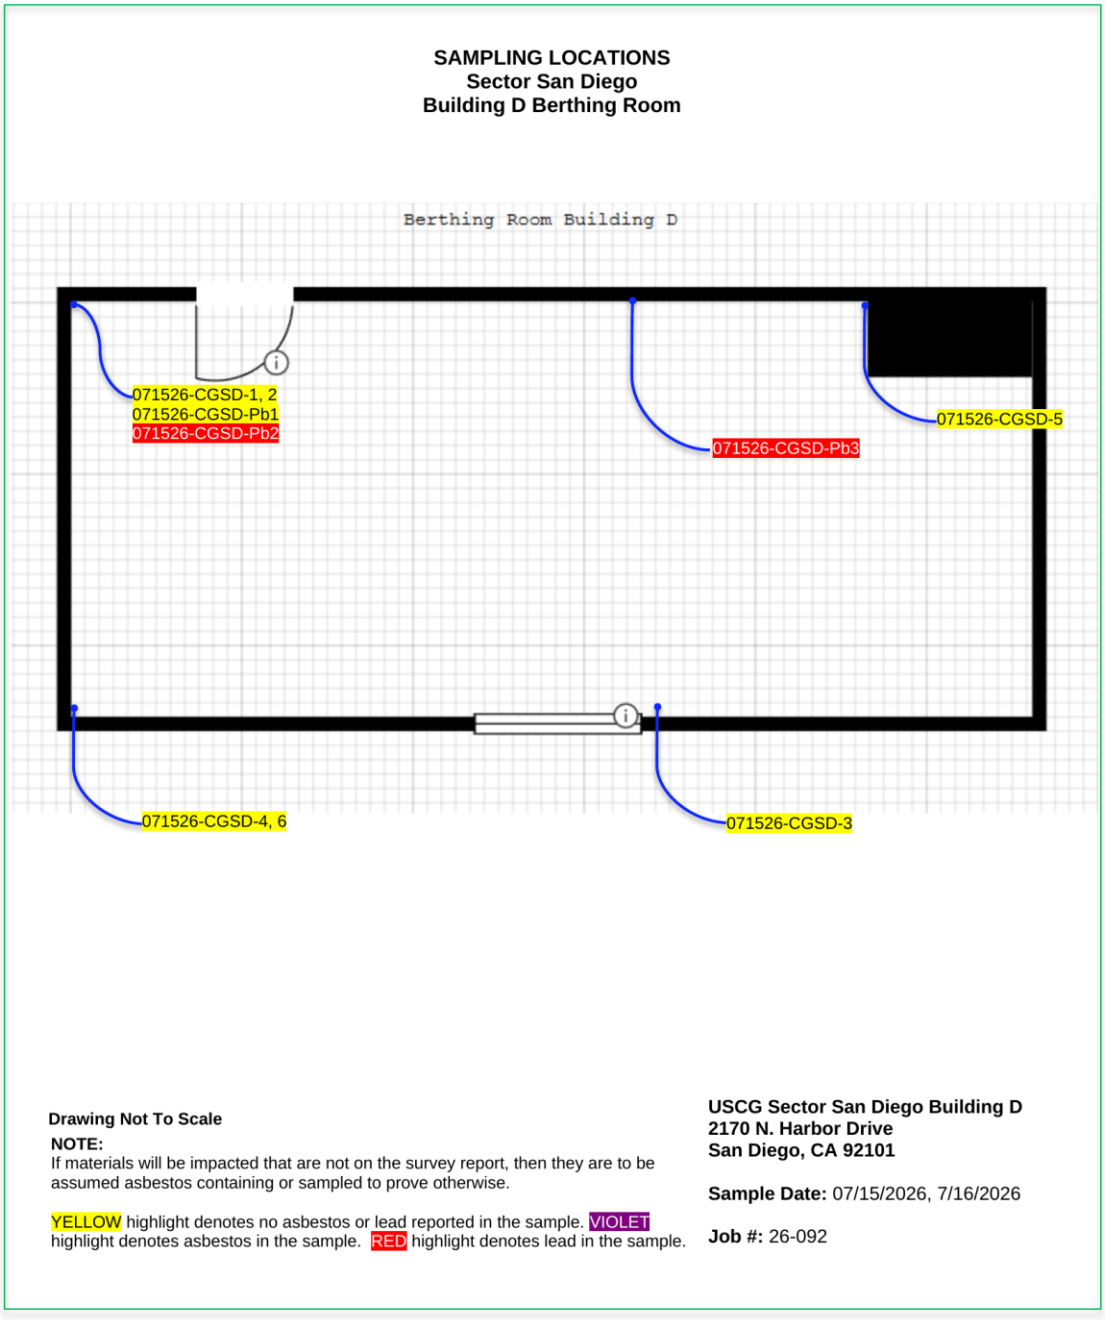


Figure 1. Sample location diagram, Building D (Berthing Room), USCG Sector San Diego (Job No. 26-092).

Advantage Environmental & Safety Services

SAMPLING LOCATIONS
Sector San Diego
Building C Rec Room

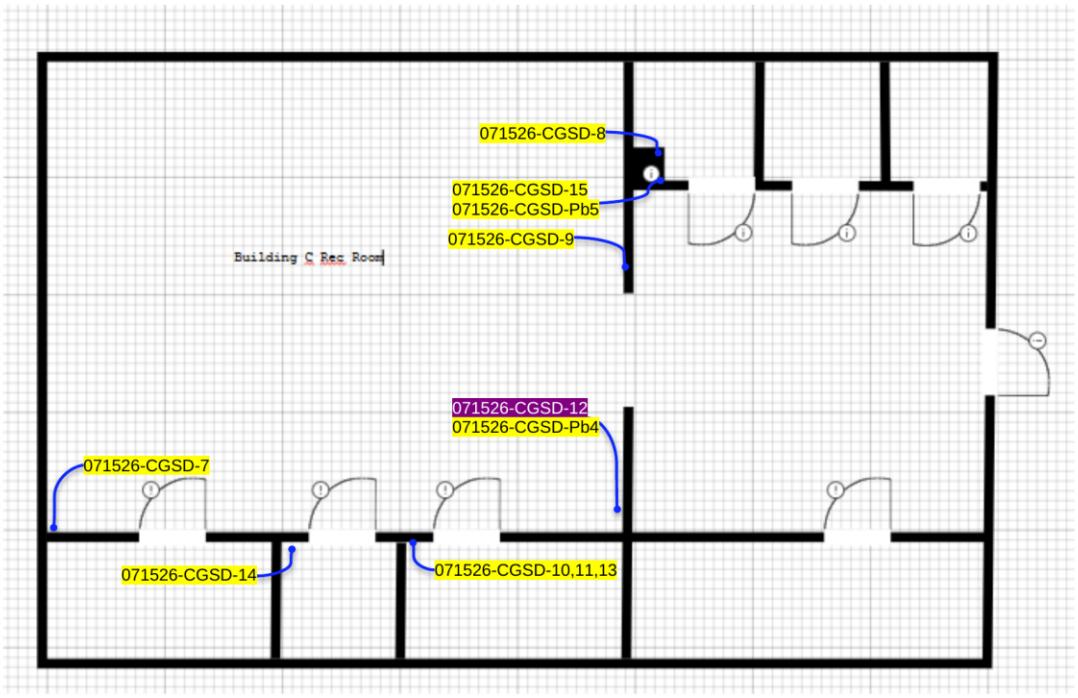

Drawing Not To Scale

NOTE:
If materials will be impacted that are not on the survey report, then they are to be assumed asbestos containing or sampled to prove otherwise.

YELLOW highlight denotes no asbestos or lead reported in the sample. VIOLET highlight denotes asbestos in the sample. RED highlight denotes lead in the sample.

USCG Sector San Diego Building C - Rec Room
2170 N. Harbor Drive
San Diego, CA 92101


Sample Date: 07/15/2026

Job #: 26-092

Figure 2. Sample location diagram, Building C (Rec Room), USCG Sector San Diego (Job No. 26-092).

Advantage Environmental & Safety Services

SAMPLING LOCATIONS
Sector San Diego
Building C-2

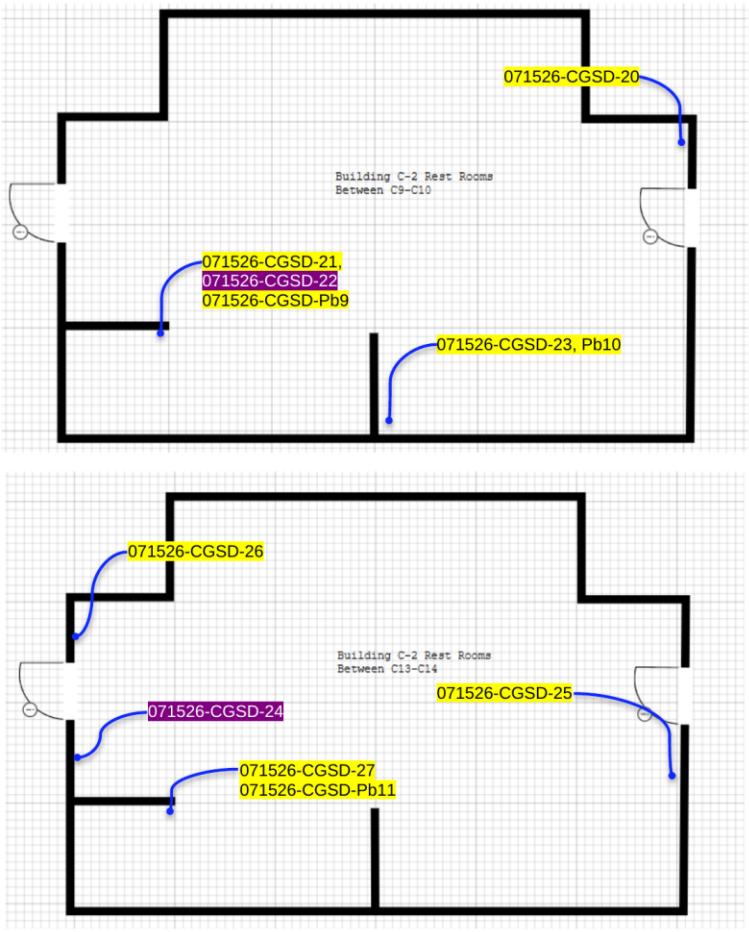

Drawing Not To Scale

NOTE:
If materials will be impacted that are not on the survey report, then they are to be assumed asbestos containing or sampled to prove otherwise.

YELLOW highlight denotes no asbestos or lead reported in the sample. VIOLET highlight denotes asbestos in the sample. RED highlight denotes lead in the sample.

USCG Sector San Diego Building C-2
2170 N. Harbor Drive
San Diego, CA 92101

Sample Date: 07/15/2026, 7/16/2026

Job #: 26-092

Figure 3. Sample location diagram, Building C-2, USCG Sector San Diego (Job No. 26-092).

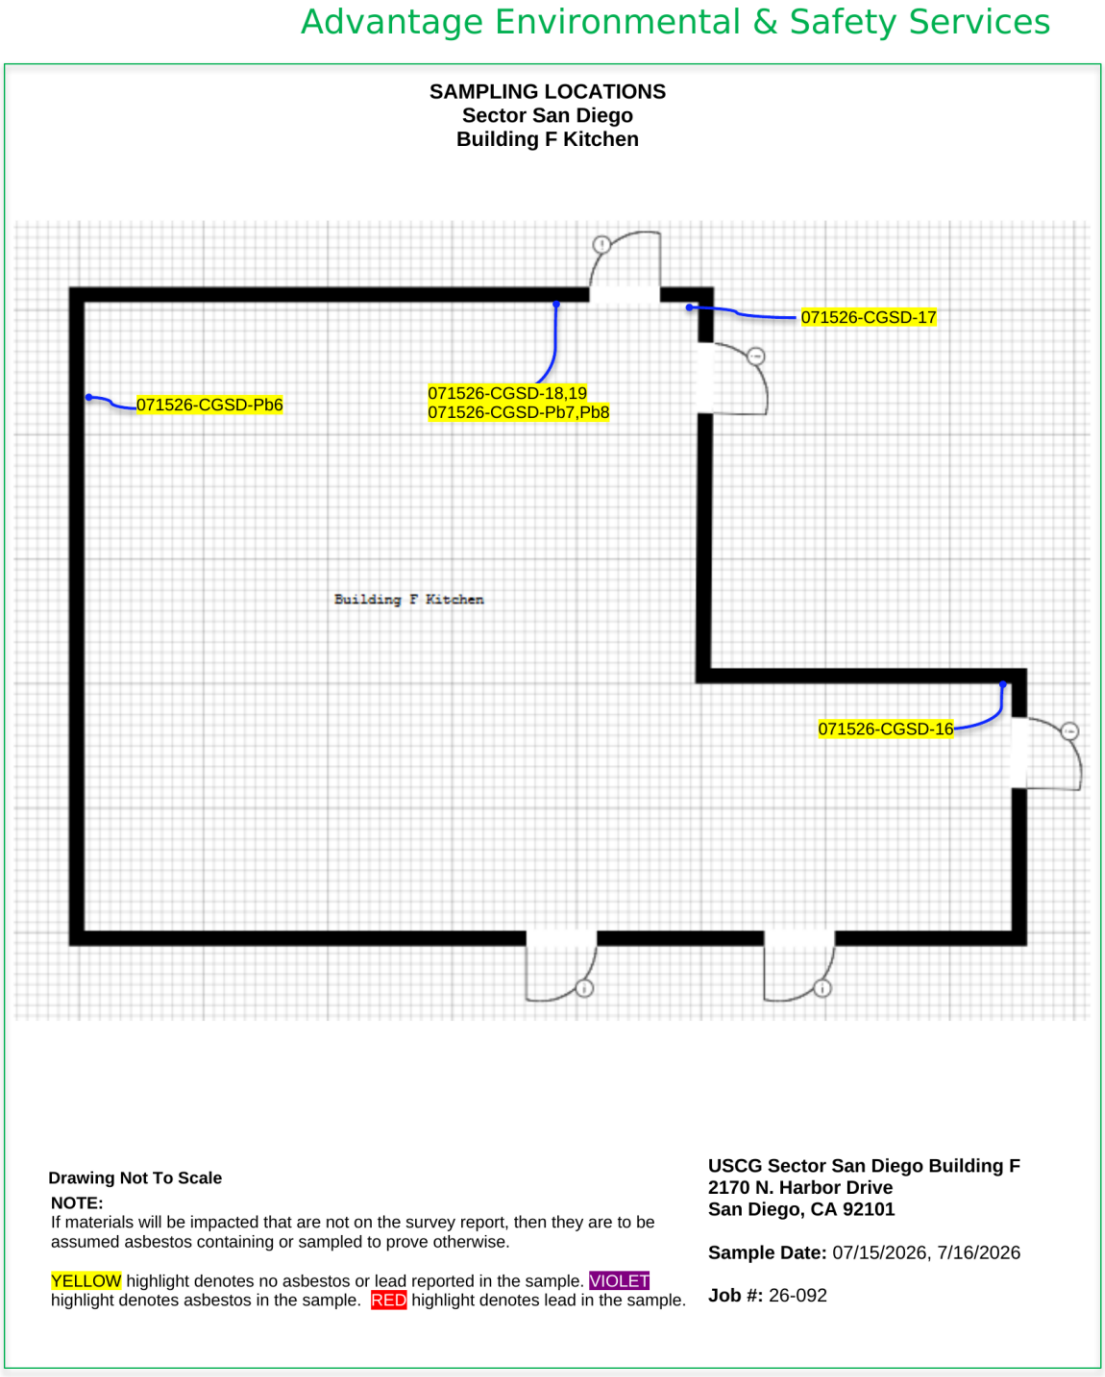


Figure 4. Sample location diagram, Building F (Kitchen), USCG Sector San Diego (Job No. 26-092).

6.0 Conclusions and Recommendations

6.1 Asbestos

Chrysotile asbestos was confirmed at 2% by PLM in three of the twenty-nine samples (three of 86 analyzed layers) collected within the areas surveyed: Sample 071526-CGSD-12 (texture/taping mud/drywall, Building C, Main Rec Room ceiling), Sample 071526-CGSD-22 (granular material beneath ceramic wall tile, Building C-2, Rm C9/C10 bathroom south wall), and Sample 071526-CGSD-24 (texture/taping mud/drywall, Building C-2, Rm C13/C14 bathroom south wall). These results exceed the 1% analytical threshold defining asbestos-containing material under 40 CFR Part 61 (NESHAP), 40 CFR Part 763 (AHERA), and applicable Cal/OSHA asbestos regulations. AESS recommends the following:

- The texture/taping mud/drywall system at the Building C Main Rec Room ceiling (071526-CGSD-12) and the Building C-2 Rm C13/C14 bathroom south wall (071526-CGSD-24), and the granular material beneath the ceramic wall tile at the Building C-2 Rm C9/C10 bathroom south wall (071526-CGSD-22), should be presumed to be ACM throughout the associated homogeneous area and handled by a licensed asbestos abatement contractor prior to any activity that would disturb, cut, drill, sand, or otherwise impact these materials.
- Any maintenance, repair, or renovation work planned in the vicinity of these three sample locations should be preceded by notification to the appropriate air quality management district and compliance with applicable NESHAP demolition/renovation notification requirements if the quantity of ACM to be disturbed exceeds regulatory thresholds.
- The remaining twenty-six sampled materials did not contain asbestos above the laboratory reporting limit and are not subject to asbestos-specific handling requirements based on these results.

This finding applies only to the specific materials and locations sampled. Per the note on each sample location diagram (Figures 1–4), any suspect material encountered outside the scope of this survey that is not represented by a collected sample should be presumed to contain asbestos or should be sampled and analyzed prior to disturbance.

6.2 Lead

Detectable lead was confirmed in two materials, both in Building D: ceramic floor tile grout/thin-set at the Berthing Room NW wall (Sample 071526-CGSD-Pb2, 0.0039% by weight) and beige paint on drywall at the Berthing Room north wall (Sample 071526-CGSD-Pb3, 0.00349% by weight). Although these concentrations fall below the federal regulatory definition of “lead-based paint,” they confirm lead is present in these materials. AESS recommends the following:

- Personnel performing demolition, grinding, sanding, cutting, or removal of the ceramic floor tile grout/thin-set and painted drywall at the 071526-CGSD-Pb2 and 071526-CGSD-Pb3 sample locations should be made aware that the material contains lead and should follow applicable OSHA Lead in Construction Standard (29 CFR 1926.62) requirements, including exposure assessment as warranted by the specific task and controls performed.

- Debris and waste generated from removal of these lead-containing materials should be evaluated for appropriate disposal classification (e.g., TCLP or total threshold limit concentration [TTLC] waste characterization) prior to disposal, consistent with California hazardous waste regulations.
- The remaining nine sampled materials (ceramic wall and floor tile and additional painted drywall locations) did not contain lead above the laboratory reporting limit and are not subject to lead-specific handling requirements based on these results.

As with asbestos, any suspect painted or glazed material outside the scope of this survey should be presumed to contain lead or should be sampled prior to disturbance.

7.0 Report Limitations

This report has been prepared for the exclusive use of the United States Coast Guard for the specific Site, scope, and purpose described herein. The findings and conclusions are based on conditions observed and materials sampled at the time of the July 15, 2026 field survey and on the analytical results provided by Schneider Laboratories Global, Inc. AESS did not sample every material or every location within the facility; materials of similar appearance located in inaccessible or concealed areas were not inspected. Actual conditions may vary from those described in this report, and this report should not be relied upon as a comprehensive, building-wide hazardous materials survey. This report is not intended, and should not be used, as a bidding or specification document for abatement work without further review and, if necessary, additional sampling by AESS.

8.0 Certification

Field sample collection for this survey was performed by Matt Bailey of AESS. This report was prepared and reviewed by Kelly Kilpatrick, Certified Asbestos Consultant (CAC), of AESS. Copies of applicable state certifications held by field and reporting personnel are included as Appendix C.



Matt Bailey
Field Sampling Technician
Cal/OSHA Certified Site Surveillance Technician (CSST) No. 25-7954, exp. 08/15/2027
CDPH Lead Sampling Technician Certificate No. LRC-00013695, exp. 01/23/2027



Kelly Kilpatrick
Report Preparer / Reviewer
Cal/OSHA Certified Asbestos Consultant (CAC) No. 24-7696, exp. 08/16/2027
CDPH Lead Inspector/Assessor Certificate No. LRC-00009599, exp. 01/11/2027

CDPH Lead Project Monitor Certificate No. LRC-00011326, exp. 06/05/2027
CDPH Lead Sampling Technician Certificate No. LRC-00000010, exp. 04/20/2027

Appendix A – Laboratory Analytical Report: Asbestos (PLM)

Schneider Laboratories Global, Inc. – Order No. 698175, including chain-of-custody documentation.

Analysis Report

Schneider Laboratories Global, Inc

2512 W. Cary Street • Richmond, Virginia • 23220-5117
804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1475

Customer: Advantage Environmental (2101)
Address: 1600 Sacramento Inn Way
Suite 127
Sacramento, CA 95815
Attn:

Order #: 698175

Received 07/20/26
Analyzed 07/22/26
Reported 07/23/26

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763

PLM Analysis

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers		Other Materials
698175-001	07/15/26	071526-CGSD-1	Ceramic Floor Tile White			
Layer 1: Ceramic Tile White, Hard				No Asbestos Detected	100%	NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% 98%	CELLULOSE FIBER NON FIBROUS MATERIAL
Layer 3: Glue White, Brittle				No Asbestos Detected	100%	NON FIBROUS MATERIAL
698175-002	07/15/26	071526-CGSD-1.5	Ceramic Floor Tile White			
Layer 1: Ceramic Tile White, Hard				No Asbestos Detected	100%	NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% 98%	CELLULOSE FIBER NON FIBROUS MATERIAL
Layer 3: Glue White, Brittle				No Asbestos Detected	100%	NON FIBROUS MATERIAL

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-003	07/15/26	071526-CGSD-2	Ceramic Floor Tile Grey		
Layer 1: Ceramic Tile Gray, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Thin Set Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
698175-004	07/15/26	071526-CGSD-2.5	Ceramic Floor Tile Grey		
Layer 1: Ceramic Tile Gray, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Thin Set Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
698175-005	07/15/26	071526-CGSD-3	FRP Glue		
Layer 1: FRP Glue Beige, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL
698175-006	07/15/26	071526-CGSD-4	FRP Glue		
Layer 1: FRP Glue Beige, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-007	07/15/26	071526-CGSD-5	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
698175-008	07/15/26	071526-CGSD-6	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-009	07/15/26	071526-CGSD-7	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
698175-010	07/15/26	071526-CGSD-8	Taping Mud Drywall		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
698175-011	07/15/26	071526-CGSD-9	Basebaord Glue		
Layer 1: Baseboard Black, Rubbery				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Glue Yellow, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL
698175-012	07/15/26	071526-CGSD-10	Baseboard Glue		
Layer 1: Baseboard Black, Rubbery				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Glue Yellow, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-013	07/15/26	071526-CGSD-11	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
698175-014	07/15/26	071526-CGSD-12	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud Off White, Granular				2% CHRYSOTILE	96% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud White/Off White, Powdery/Granular				<1% CHRYSOTILE	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture Off White, Granular				2% CHRYSOTILE	96% NON FIBROUS MATERIAL 2% VERMICULITE
698175-015	07/15/26	071526-CGSD-13	Carpet Glue		
Layer 1: Carpet Glue Yellow, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL
698175-016	07/15/26	071526-CGSD-14	Carpet Glue		
Layer 1: Carpet Glue Yellow, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-017	07/15/26	071526-CGSD-15	Ceramic Floor Tile		
Layer 1: Ceramic Tile Brown, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Thin Set Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
698175-018	07/15/26	071526-CGSD-16	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
698175-019	07/15/26	071526-CGSD-17	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-020	07/15/26	071526-CGSD-18	Ceramic Wall Tile White		
Layer 1: Ceramic Tile White, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout White, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Mastic White, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL
698175-021	07/15/26	071526-CGSD-19	Ceramic Wall Tile White		
Layer 1: Ceramic Tile Black, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout White, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Mastic White, Soft				No Asbestos Detected	100% NON FIBROUS MATERIAL
698175-022	07/15/26	071526-CGSD-20	Texture Taping Mud		
Layer 1: Drywall White, Powdery				No Asbestos Detected	4% CELLULOSE FIBER 2% MINERAL/GLASS WOOL 94% NON FIBROUS MATERIAL
Layer 2: Mud White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud White, Powdery/Granular				No Asbestos Detected	2% CELLULOSE FIBER <1% MINERAL/GLASS WOOL 98% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture White, Granular				No Asbestos Detected	98% NON FIBROUS MATERIAL 2% VERMICULITE

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-023	07/15/26	071526-CGSD-21	Glossy Brown Coating		
Layer 1: Coating Brown, Hard/Brittle				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Cementitious Mtrl Gray, Cementitious/Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
698175-024	07/15/26	071526-CGSD-22	Cermaic Wall Tile White		
Layer 1: Ceramic Tile White, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Thin Set Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 4: Granular Material Off White, Granular				2% CHRYSOTILE	98% NON FIBROUS MATERIAL
698175-025	07/15/26	071526-CGSD-23	Cermaic Wall Tile White		
Layer 1: Ceramic Tile White, Hard				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 2: Grout White, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Thin Set Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 4: Granular Material White, Granular				No Asbestos Detected	100% NON FIBROUS MATERIAL

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-026	07/15/26	071526-CGSD-24	Texture Taping Mud		
Layer 1: Drywall Gray, Powdery				No Asbestos Detected	8% CELLULOSE FIBER 92% NON FIBROUS MATERIAL
Layer 2: Mud Off White, Granular				2% CHRYSOTILE	96% NON FIBROUS MATERIAL 2% VERMICULITE
Layer 3: Drywall/Mud Off White/Gray, Powdery/Granular				<1% CHRYSOTILE	4% CELLULOSE FIBER 96% NON FIBROUS MATERIAL <1% VERMICULITE
Layer 4: Texture Off White, Granular				2% CHRYSOTILE	96% NON FIBROUS MATERIAL 2% VERMICULITE
698175-027	07/15/26	071526-CGSD-25	Glossy Brown Coating		
Layer 1: Coating Brown, Hard/Brittle				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Cementitious Mtrl Gray, Cementitious/Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
698175-028	07/15/26	071526-CGSD-26	Ceramic Wall Tile White		
Layer 1: Ceramic Tile White, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Thin Set Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Diego CA
Number: 26-092

Method: EPA 600/R-93/116 & 40 CFR App. E Sub. E Pt. 763 **PLM Analysis**

Sample ID	Collected	Cust. ID	Location	Asbestos Fibers	Other Materials
698175-029	07/15/26	071526-CGSD-27	Ceramic Wall Tile White		
Layer 1: Ceramic Tile White, Hard				No Asbestos Detected	100% NON FIBROUS MATERIAL
Layer 2: Grout Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL
Layer 3: Thin Set Gray, Granular				No Asbestos Detected	2% CELLULOSE FIBER 98% NON FIBROUS MATERIAL

EPA Regulatory Limit: 1%
Total layers analyzed on order: 86

698175-07/23/26 03:14 PM

Analyst **Eisen Zhao**

Reviewed By: **Dionna Cheatham**
Project Manager

Reporting Limit: 1% Gravimetrically Reduced Reporting Limit: 0.01% PLM analysis is based on Visual Estimation and NESHAP recommends that any friable sample with an asbestos content less than 10 percent be verified by Point Count or TEM Analysis. The EPA recommends that any attic loose fill vermiculite should be treated as asbestos containing material. This report must not be reproduced except in full with the approval of the laboratory. Laboratory estimated asbestos error rates available upon request. The test results apply to the sample as received.

O 29

698175

V:\698\698175

kfinnemore 7/20/2026 10:00:21 AM
UP 1Z2E28998469888796
UPS 1Z2E28998469888796
Advantage Environmental & Safety Services

Client: Mr. Matt Bailey Advantage Environmental & Safety Services 1600 Sacramento Inn Wy. Suite 127 Sacramento, CA 95815		**Samples Collected By:** Matt Bailey or Alfred Myers 25-7954 26-8095 LRC-00013695 LRC-00014733	
LAB – TAT: 3 day	**Project #:** 26-092	**Email Results To:** results@aescal.com	**Contact #'s:** 408-839-1224
Project Location: **US Coast Guard Sector San Diego-** 2170 N. Harbor Drive, San Diego, CA 92101			

Sample #	Sample Location	Item Sampled	Sample Type	Sample Date	Type and Analysis
071526-CGSD-1	Bldg D, Berthing BR NW Floor Wall	2" Ceramic wall tile (white), grout, glue	BULK	07/15/26	PLM
071526-CGSD-1.5	Bldg D, Berthing BR	2" Ceramic wall tile (white), grout, glue	BULK	07/15/26	PLM
071526-CGSD-2	Bldg D, Berthing BR NW Wall	2" Ceramic floor tile (grey), grout, thinset	BULK	07/15/26	PLM
071526-CGSD-2.5	Bldg D, Berthing BR	2" Ceramic floor tile (grey), grout, thinset	BULK	07/15/26	PLM
071526-CGSD-3	Bldg D, Berthing BR South Wall	FRP Glue	BULK	07/15/26	PLM
071526-CGSD-4	Bldg D, Berthing BR SW Wall	FRP Glue	BULK	07/15/26	PLM
071526-CGSD-5	Bldg D, Berthing BR NE Wall	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-6	Bldg D, Berthing BR SW Wall	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-7	Bldg C, Main Rec Rm, NW corner wall	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-8	Bldg C, Rec Room, Janitor Closet SE Wall	Taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-9	Bldg C, Main Rec Rm, South wall	Baseboard, glue	BULK	07/15/26	PLM
071526-CGSD-10	Bldg C, Rec Room, nursing room NE wall	Baseboard, glue	BULK	07/15/26	PLM
071526-CGSD-11	Bldg C, Rec Room, nursing room NE wall	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-12	Bldg C, Main Rec Rm, SW corner ceiling	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-13	Bldg C, Rec Room, nursing room floor	Carpet glue	BULK	07/15/26	PLM
071526-CGSD-14	Bldg C, Rec Room, west floor	Carpet glue	BULK	07/15/26	PLM
071526-CGSD-15	Bldg C, Rec Room, Janitor Closet floor	12" ceramic floor tile (brown), grout, thinset	BULK	07/15/26	PLM
071526-CGSD-16	Bldg F, Kitchen Northwest corner	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-17	Bldg F, Kitchen Southwest corner	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-18	Bldg F, Kitchen South Wall	2"x4" ceramic wall tile (white), grout, mastic	BULK	07/15/26	PLM

Advantage Environmental & Safety Services
Page 1 of 2

Sample #	Sample Location	Item Sampled	Sample Type	Sample Date	Type and Analysis
071526-CGSD-19	Bldg F, Kitchen South Wall	2"x4" ceramic wall tile (black), grout, mastic	BULK	07/15/26	PLM
071526-CGSD-20	Bldg C-2, Rm C9/C10 bathroom North Wall	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-21	Bldg C-2, Rm C9/C10 bathroom South Floor	Glossy brown coating, cementitious substrate	BULK	07/15/26	PLM
071526-CGSD-22	Bldg C-2, Rm C9/C10 bathroom South Wall	6" ceramic wall tile (white), grout, thinset	BULK	07/15/26	PLM
071526-CGSD-23	Bldg C-2, Rm C9/C10 bathroom East Wall	4" ceramic wall tile (white), grout, thinset	BULK	07/15/26	PLM
071526-CGSD-24	Bldg C-2, Rm C13/C14 bathroom South Wall	Texture, taping mud, drywall	BULK	07/15/26	PLM
071526-CGSD-25	Bldg C-2, Rm C13/C14 bathroom North Floor	Glossy brown coating, cementitious substrate	BULK	07/15/26	PLM
071526-CGSD-26	Bldg C-2, Rm C13/C14 bathroom South Wall	6" ceramic wall tile (white), grout, thinset	BULK	07/15/26	PLM
071526-CGSD-27	Bldg C-2, Rm C13/C14 bathroom Shower Wall	4" ceramic wall tile (white), grout, thinset	BULK	07/15/26	PLM

Relinquished by Collector: Matt Bailey	**Date:** 07/15/26	**Time:** 15:00
Received by Lab:	**Date:**	**Time:**

Appendix B – Laboratory Analytical Report: Lead

Schneider Laboratories Global, Inc. – Order No. 698176, including chain-of-custody documentation.

Analysis Report

Schneider Laboratories Global, Inc

2512 W. Cary Street • Richmond, Virginia • 23220-5117
804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1475

Customer: Advantage Environmental (2101)
Address: 1600 Sacramento Inn Way
Suite 127
Sacramento, CA 95815
Attn:
Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Deigo CA
Number: 26-092

Order #: 698176

Matrix	Bulk, Paint
Received	07/20/26
Analyzed	07/20/26
Reported	07/20/26

PO Number:

Sample ID / Parameter	Cust. Sample ID	Location / Method	Sample Date	Weight Total g	% / Wt.	Conc.	RL*
698176-001	071526-CGSD-Pb1	Ceramic Wall Tile White	07/15/26	548 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00146 %	<14.6 mg/kg	14.6 mg/kg
698176-002	071526-CGSD-Pb2	Ceramic Floor Tile Grey	07/15/26	528 mg			
Lead		EPA 7000B / ME-003		20.6 g	0.0039 %	39.0 mg/kg	15.2 mg/kg
698176-003	071526-CGSD-Pb3	Beige Paint on Drywall	07/15/26	322 mg			
Lead		EPA 7000B / ME-003		11.2 g	0.00349 %	34.9 mg/kg	24.8 mg/kg
698176-004	071526-CGSD-Pb4	White Paint on Drywall	07/15/26	348 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.0023 %	<23.0 mg/kg	23.0 mg/kg
698176-005	071526-CGSD-Pb5	Ceramic Floor Tile Brown	07/15/26	541 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00148 %	<14.8 mg/kg	14.8 mg/kg
698176-006	071526-CGSD-Pb6	White Paint On Drywall	07/15/26	337 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00238 %	<23.8 mg/kg	23.7 mg/kg
698176-007	071526-CGSD-Pb7	Ceramic Wall Tile Black	07/15/26	531 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00151 %	<15.1 mg/kg	15.1 mg/kg
698176-008	071526-CGSD-Pb8	Ceramic Wall Tile White	07/15/26	519 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00155 %	<15.5 mg/kg	15.4 mg/kg
698176-009	071526-CGSD-Pb9	Ceramic Wall Tile White	07/15/26	549 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00146 %	<14.6 mg/kg	14.6 mg/kg
698176-010	071526-CGSD-Pb1	Ceramic Wall Tile White	07/15/26	521 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00154 %	<15.4 mg/kg	15.4 mg/kg
698176-011	071526-CGSD-Pb1	Ceramic Wall Tile White	07/15/26	517 mg			
Lead		EPA 7000B / ME-003		<8.00 g	<0.00155 %	<15.5 mg/kg	15.5 mg/kg

Lead Minimum Reporting Limit (*RL): 8.0 g. All internal QC parameters were met. Unusual sample conditions, if any, are described. Do not reproduce this report except in full. The test results apply to the sample as received. PPM = mg/kg | PPB = g/kg. Values are reported to three significant figures. AIHA LAP, LLC accredited for Lead (Lab ID 100527).

Analysis Report

Schneider Laboratories Global, Inc

2512 W. Cary Street • Richmond, Virginia • 23220-5117
804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1475

Customer: Advantage Environmental (2101)
Address: 1600 Sacramento Inn Way
Suite 127
Sacramento, CA 95815
Attn:
Project: US Coast Guard Sector
Location: 2170 N Harbor Dr, San Deigo CA
Number: 26-092

Order #: 698176

Matrix	Bulk, Paint
Received	07/20/26
Analyzed	07/20/26
Reported	07/20/26

PO Number:

Sample ID	Cust. Sample ID	Location	Sample Date	Weight			
Parameter		Method		Total g	% / Wt.	Conc.	RL*

Analyst: SAJ
698176-07/20/26 05:22 PM

Kelly Muncy

Reviewed By: **Kelly Muncy**
Manager

Federal Lead Paint Statute as of 7/1/26

Location	Level	Unit
Lead in paint by wt.	0.50	%
Lead in paint PPM	5000	mg/kg

Lead Minimum Reporting Limit (*RL): 8.0 g. All internal QC parameters were met. Unusual sample conditions, if any, are described. Do not reproduce this report except in full. The test results apply to the sample as received. PPM = mg/kg | PPB = g/kg. Values are reported to three significant figures. AIHA LAP, LLC accredited for Lead (Lab ID 100527).

X 11

698176

V:\698\698176

kfinnemore 7/20/2026 10:00:21 AM

UPS 1Z5289984698888796

Advantage Environmental & Safety Services

Client: Mr. Matt Bailey Advantage Environmental & Safety Services 1600 Sacramento Inn Wy. Suite 127 Sacramento, CA 95815	**Samples Collected By:** Matt Bailey or Alfred Myers 25-7954 26-8095 LRC-00013695 LRC-00014733

LAB – TAT:	Project #:	Email Results To:	Contact #'s:
3 day	26-092	results@aescal.com	408-839-1224

Project Location:
US Coast Guard Sector San Diego- 2170 N. Harbor Drive, San Diego, CA 92101

Sample #	Sample Location	Item Sampled	Sample Type	Sample Date	Type and Analysis
071526-CGSD-Pb1	Bldg D, Berthing BR NW Floor	2" Ceramic wall Tile (white)	BULK	07/15/26	AA-Lead
071526-CGSD-Pb2	Bldg D, Berthing BR NW Wall	2" Ceramic floor Tile (grey)	BULK	07/15/26	AA-Lead
071526-CGSD-Pb3	Bldg D, Berthing BR North Wall	Beige paint on drywall	BULK	07/15/26	AA-Lead
071526-CGSD-Pb4	Bldg C, Main Rec Rm, SW corner wall	White paint on drywall	BULK	07/15/26	AA-Lead
071526-CGSD-Pb5	Bldg C, Rec Room, Janitor Closet floor	12" Ceramic floor tile (brown)	BULK	07/15/26	AA-Lead
071526-CGSD-Pb6	Bldg F, Kitchen East Wall	White paint on drywall	BULK	07/15/26	AA-Lead
071526-CGSD-Pb7	Bldg F, Kitchen South Wall	2"x4" ceramic wall tile (black),	BULK	07/15/26	AA-Lead
071526-CGSD-Pb8	Bldg F, Kitchen South Wall	2"x4" ceramic wall tile (white),	BULK	07/15/26	AA-Lead
071526-CGSD-Pb9	Bldg C-2, Rm C9/C10 bathroom South Wall	6" ceramic wall tile (white)	BULK	07/15/26	AA-Lead
071526-CGSD-Pb10	Bldg C-2, Rm C9/C10 bathroom East Wall	4" ceramic wall tile (white)	BULK	07/15/26	AA-Lead
071526-CGSD-Pb11	Bldg C-2, Rm C13/C14 bathroom Shower Wall	4" ceramic wall tile (white)	BULK	07/15/26	AA-Lead

Relinquished by Collector: Matt Bailey	**Date:** 07/15/26	**Time:** 15:00
Received by Lab:	**Date:**	**Time:**

Advantage Environmental & Safety Services
Page 1 of 1