

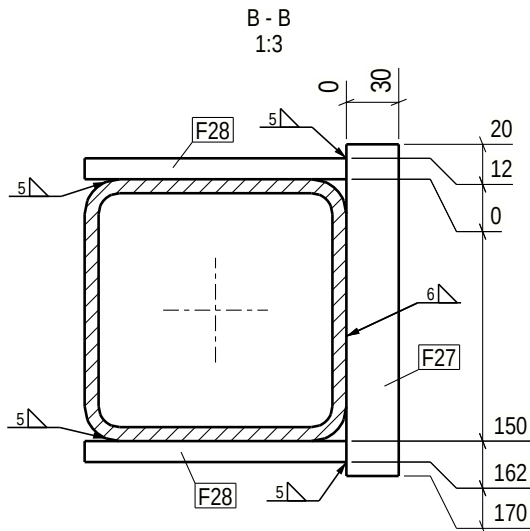
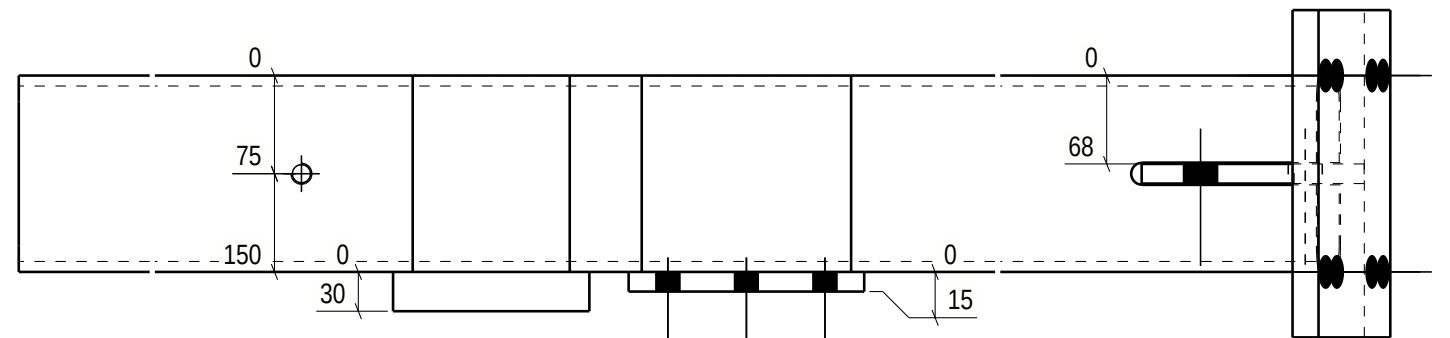


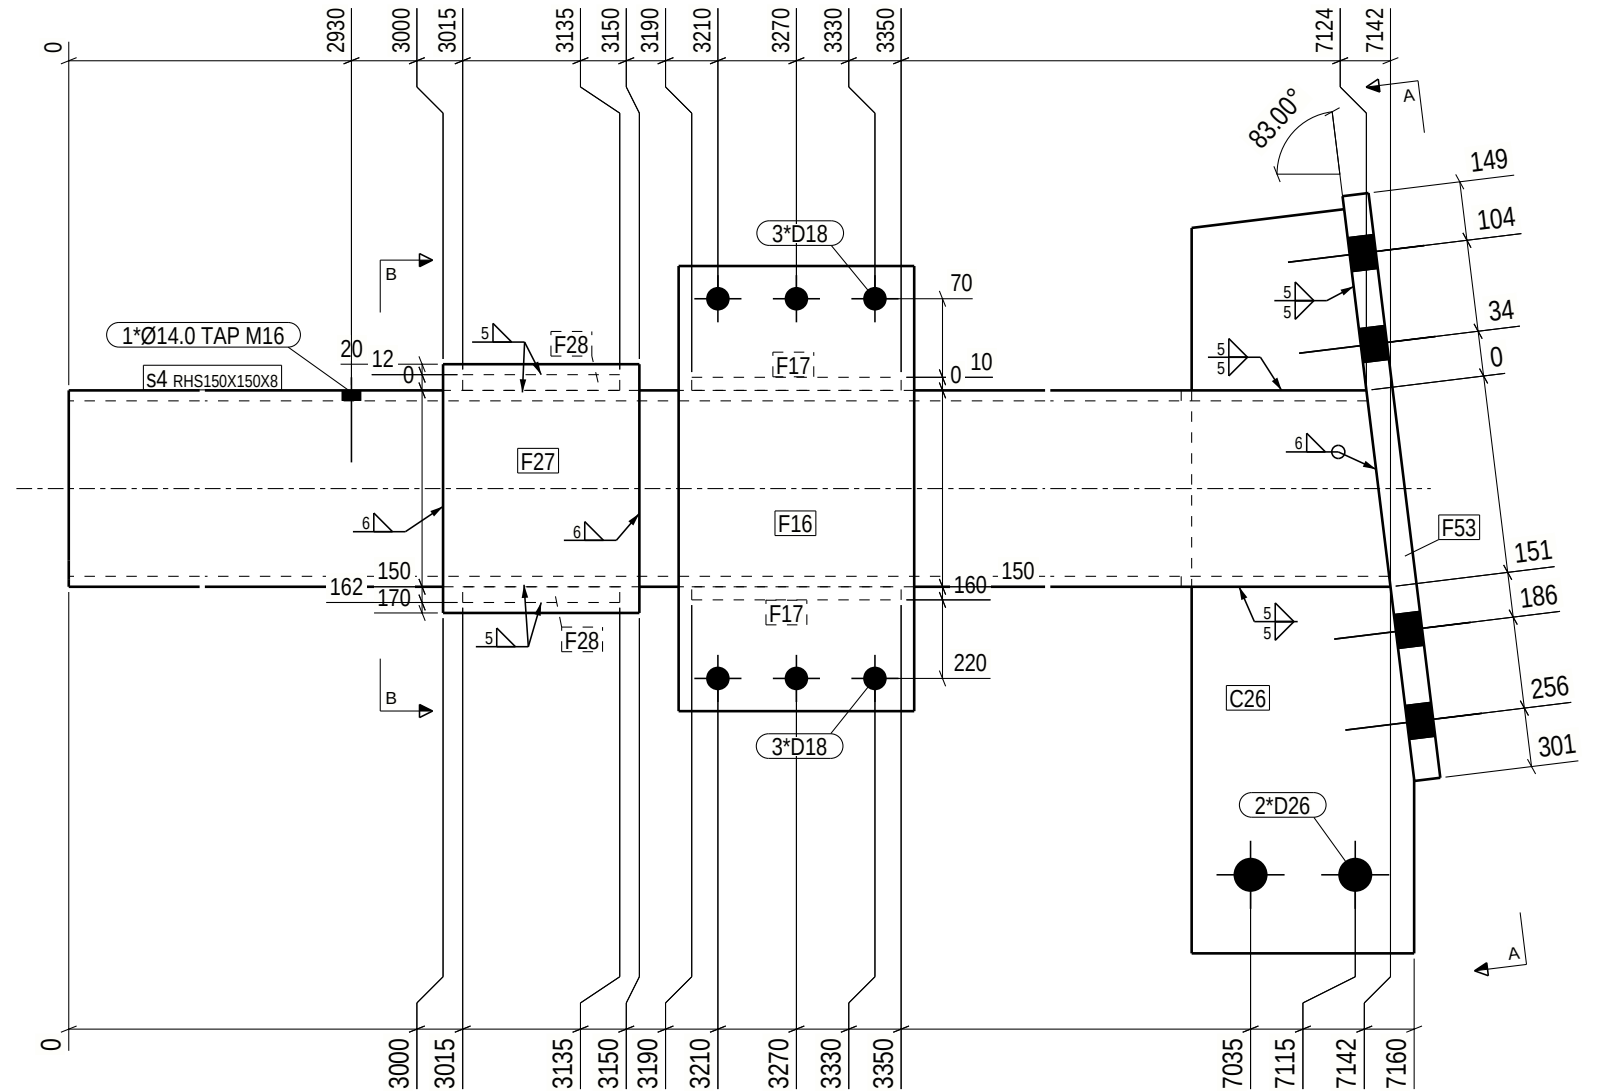

weld F53 and C26 before adding s4
(hidden edge to be welded)

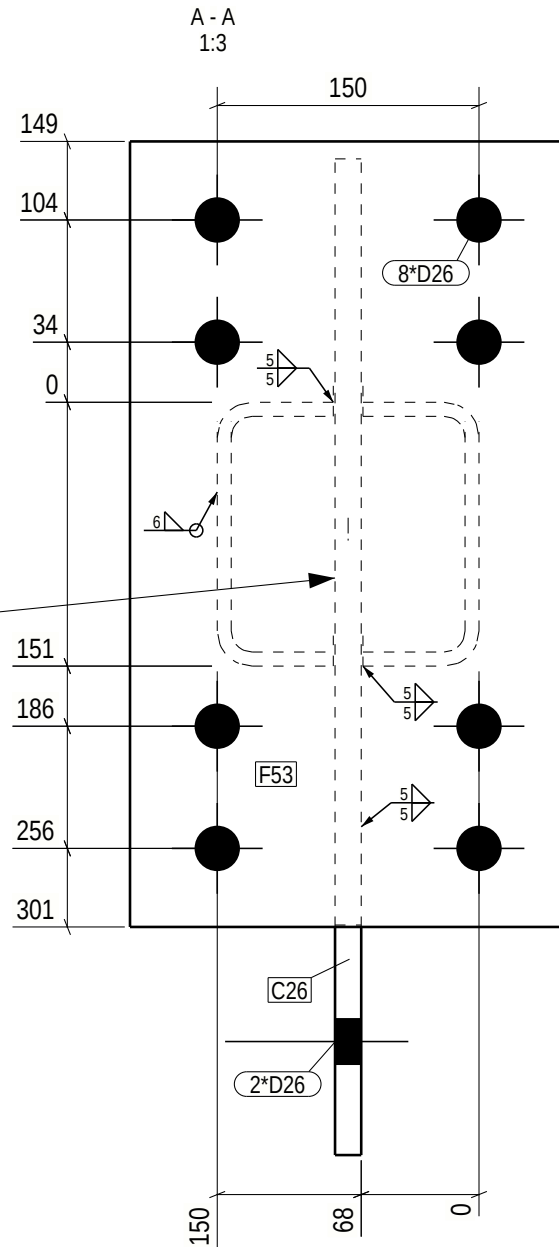

GENERAL NOTES: For your safety, check weight before handling:
0-5kg Light 5-15kg Normal 15+kg Heavy

ALL WELDS ARE 4 UNLESS NOTED ON DRAWING

MATERIAL LIST FOR ASSEMBLY MK'D S.4 1 No. Required

Mark	Profile	Material	No.	Length	Area	Weight
s4	RHS150X150X8	S355J2H	1	7142	4.1	240.7 !!
C26	PL15*170	S355J2	1	568	0.2	9.9
F16	FL15*180	S355J2	1	340	0.1	7.2
F17	FL10*150	S355J2	2	160	0.1	1.9
F27	FL30*150	S355J2	1	190	0.1	6.7
F28	FL12*120	S355J2	2	150	0.0	1.7
F53	FL20*250	S355J2	1	450	0.3	17.7 !!
Total				4.9	289.3	

Finish Class
Standard

Surface treatment info: Thickness/start point-> length No.

weld a = 4

PHASE QUANTITY
1 1

* o 3 0 4 8 0 - 1 * DS Stalkonstruktion * A s 4 *			
PROJECT	Akkasæter Lager- og vedlikeholdshall	EXEC. CLASS	EXC 2
MEMBER	Søyle	QUANTITY:	1 PROJECT No 30480-1
REVISION	ISSUED: 03.11.2025	DRAFTER: ZLL SST	DRAWING No. S.4