

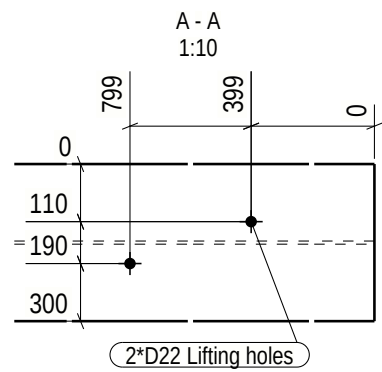
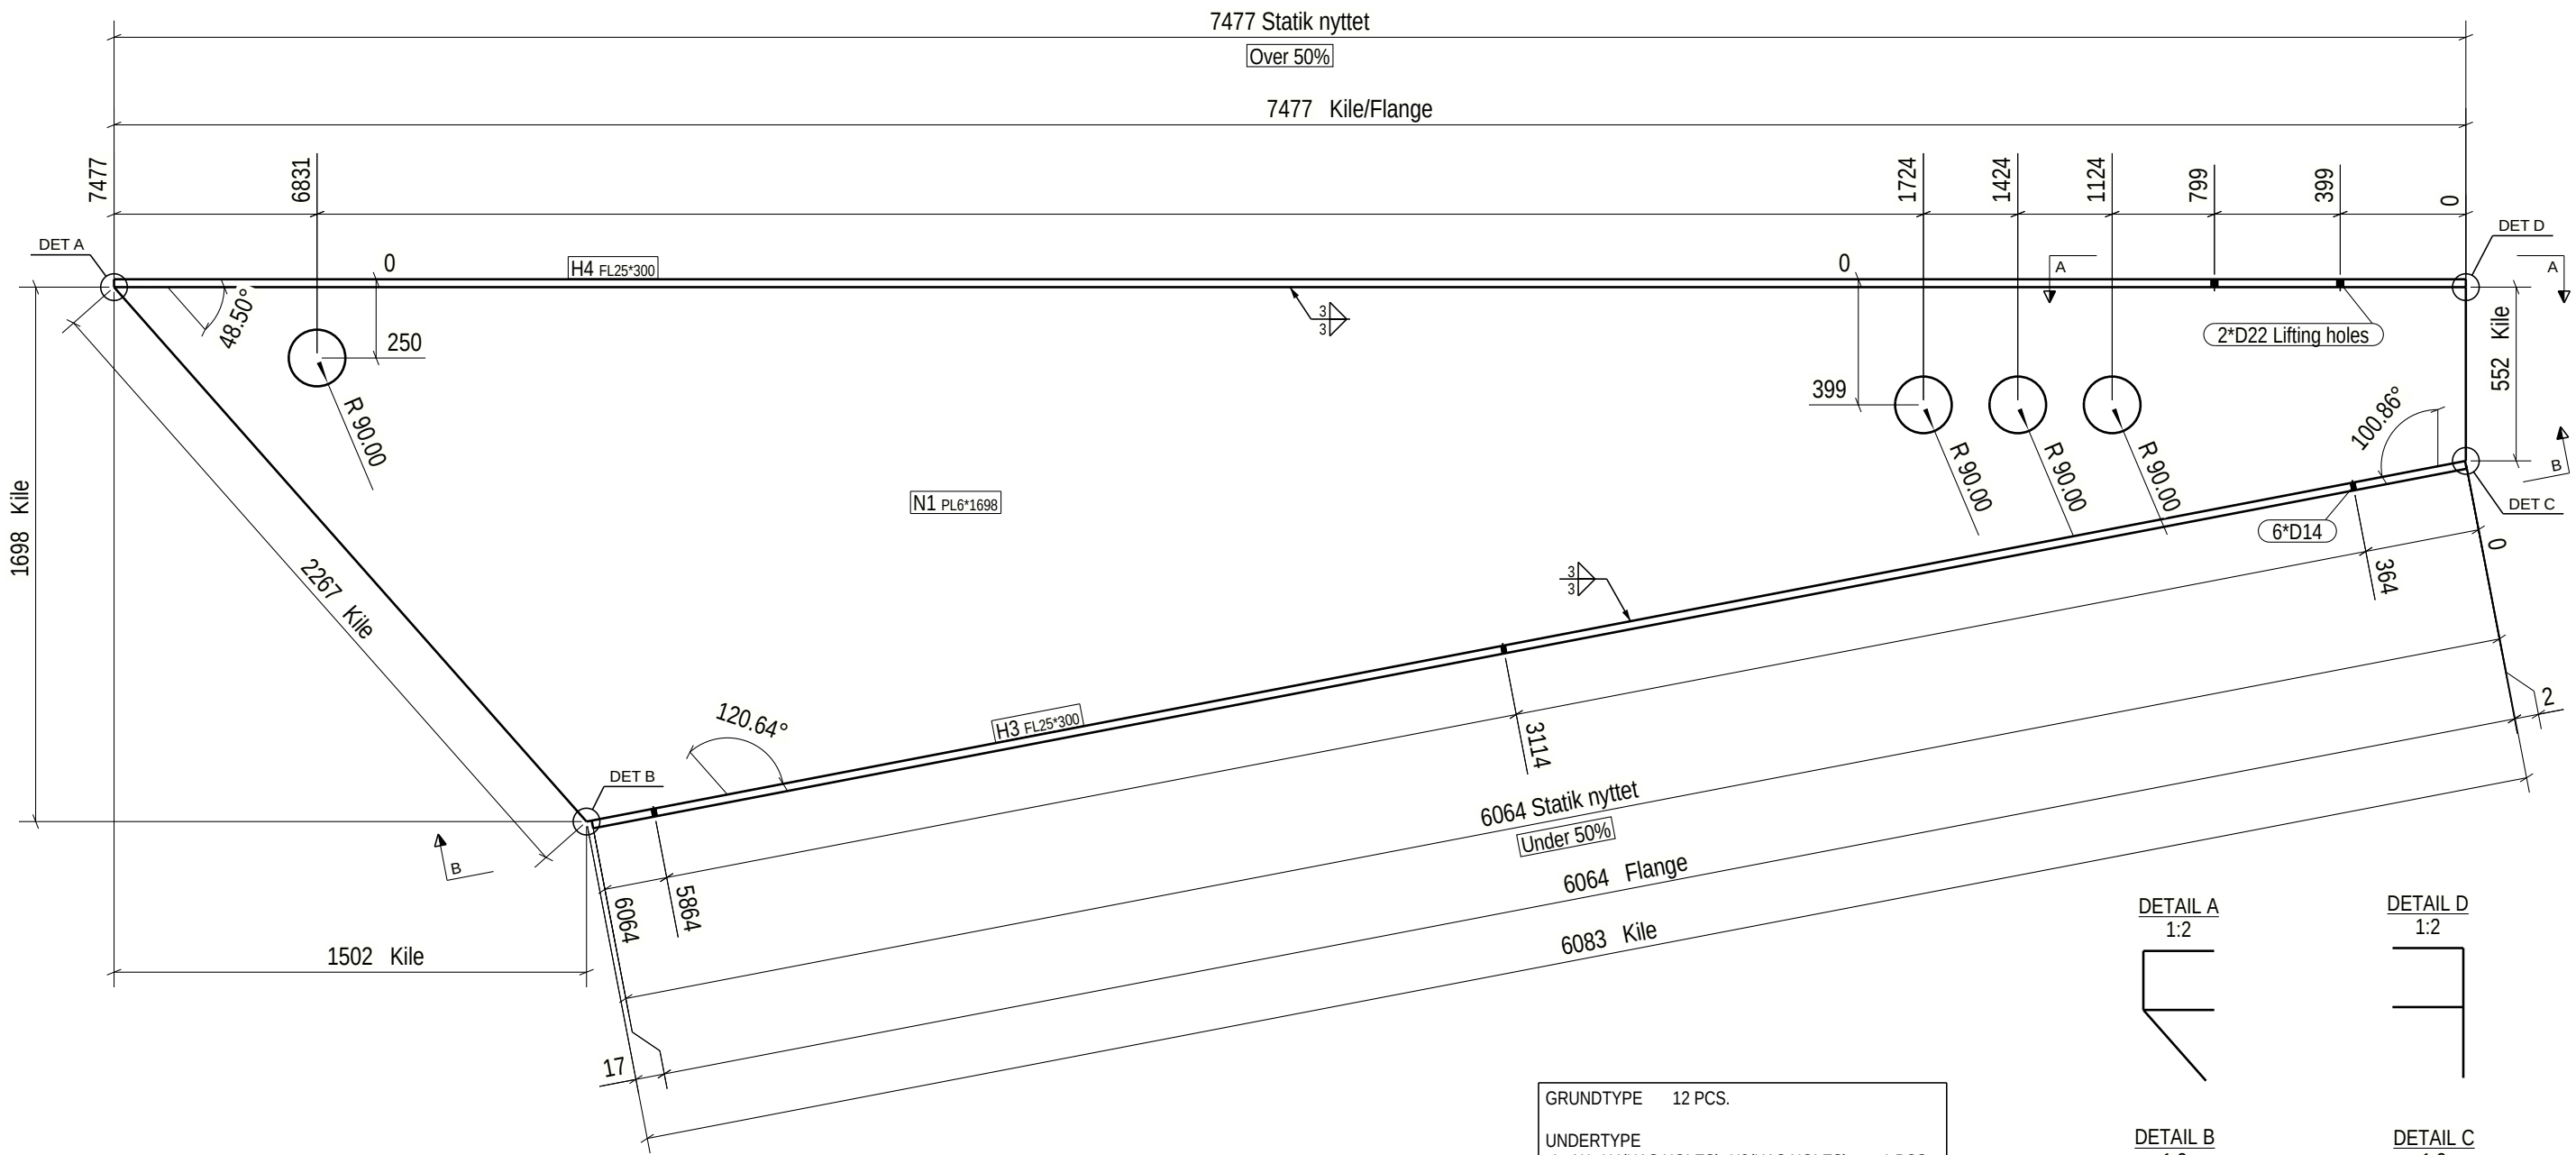


Execution class: EXC 2
No utilization on drawings = over 50%
V-SEAM
Utilization under 50%
EXC 2=> Acc. to process control
EXC 3=> 20% UT
Utilization over 50%
EXC 2=> 10% UT
EXC 3=> 20% UT

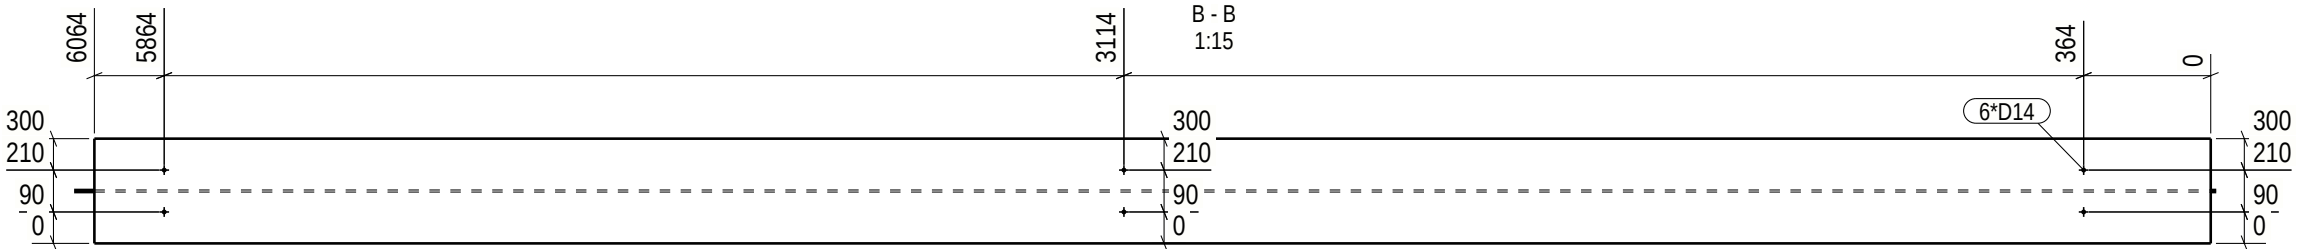

GRUNDTYPE	12 PCS.
UNDERTYPE	
r1 - N1+H4(HAS HOLES)+H3(HAS HOLES)	1 PCS.
r2 - N1+H4(HAS HOLES)+H3(HAS HOLES)	1 PCS.
r3 - N1+H4(HAS HOLES)+H3(HAS HOLES)	9 PCS.
r4 - N1+H4(HAS HOLES)+H3(HAS HOLES)	1 PCS.
SUM	12 PCS.

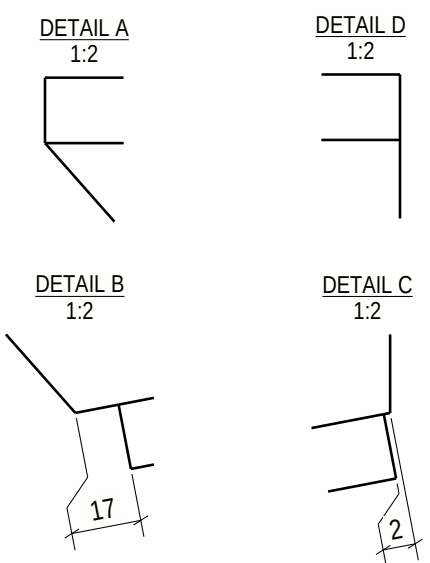

GENERAL NOTES: For your safety, check weight before handling:
0-5kg Light 5-15kg Normal 15+kg Heavy

ALL WELDS ARE 4 UNLESS NOTED ON DRAWING

MATERIAL LIST FOR ASSEMBLY MK'D r.4 - 1 (See table) No. Required

Mark	Profile	Material	No.	Length	Area	Weight
H3	FL25*300	S355J2	1	6064	4.0	357.0 !!
H4	FL25*300	S355J2	1	7477	4.9	440.2 !!
N1	PL6*1698	S355J2	1	7477	15.9	371.8 !!
Total					24.7	1169.0

Finish Class
Standard

weld a = 4

PHASE QUANTITY
See Undertype drawings

* o 3 0 4 8 0 - 2 * DS Skalkonstruktion * A r 4 *			
PROJECT	Akkasæter Lager- og vedlikeholdshall	EXEC. CLASS	EXC 2
MEMBER	Kiletegning	QUANTITY: (See table)	PROJECT No 30480-2
REVISION	ISSUED: 07.11.2025	DRAFTER: ZLL SST	DRAWING No. r.4 - 1