


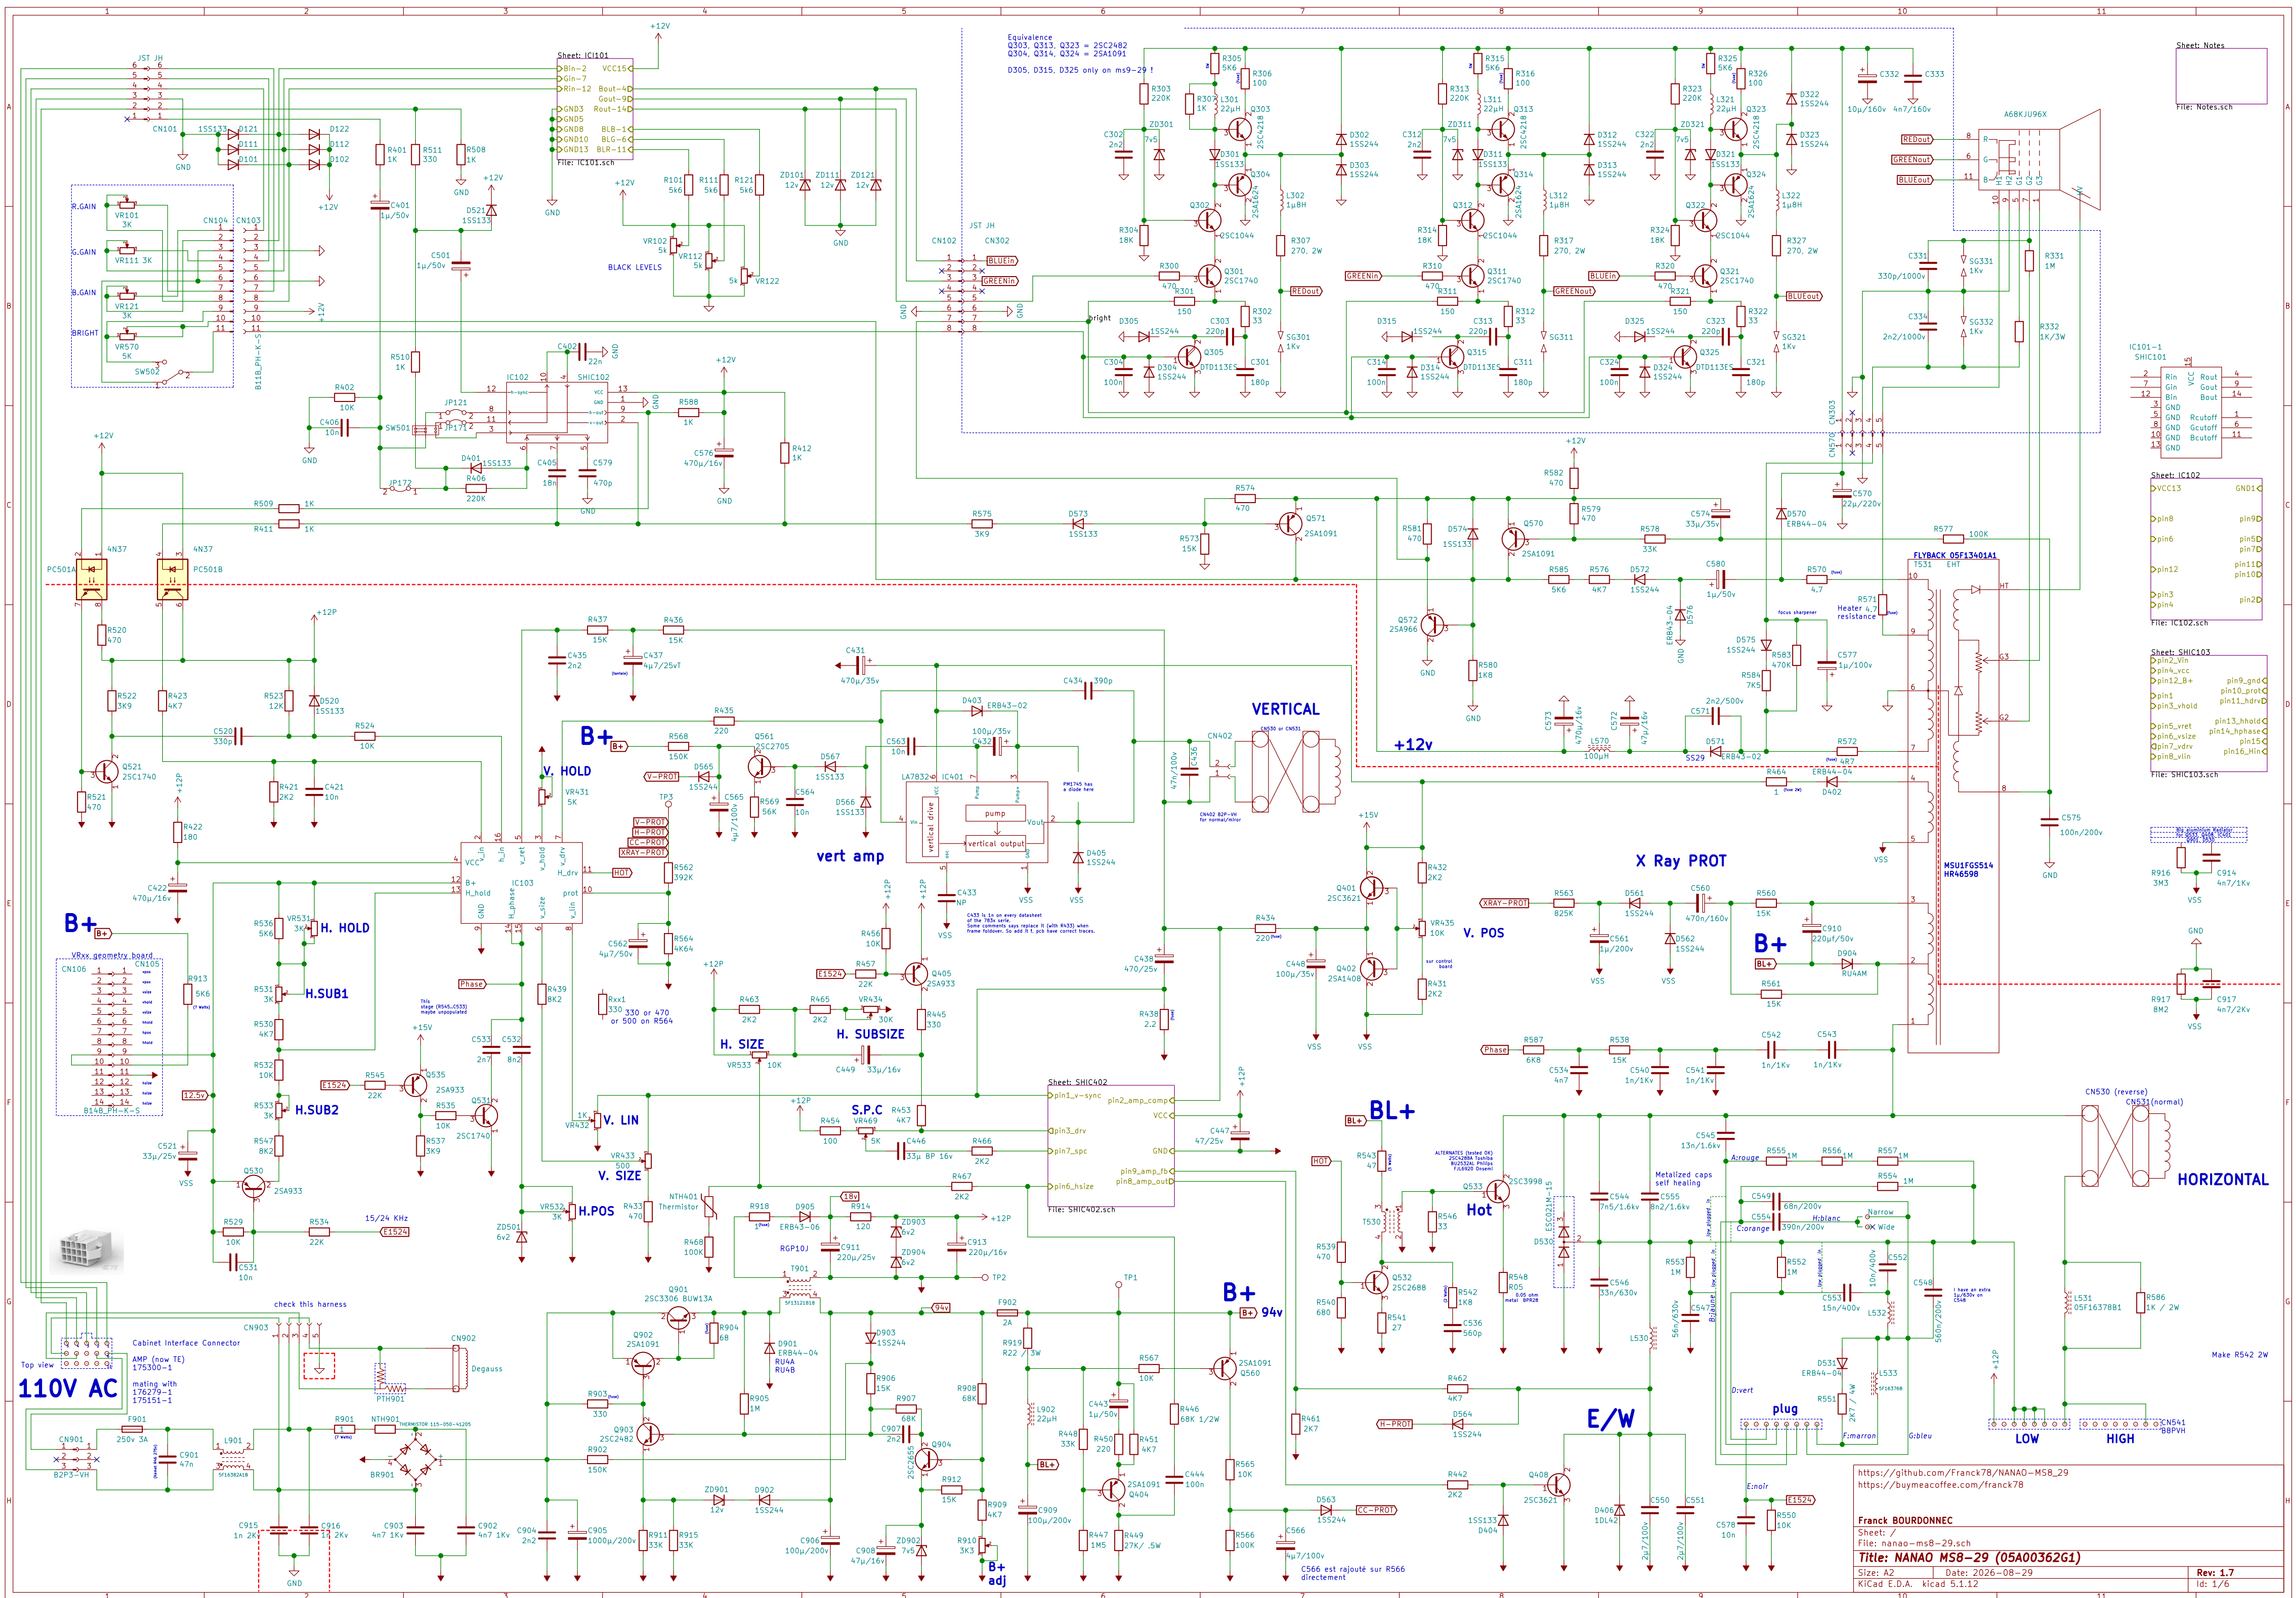

Sheet: Notes
File: Notes.sch

IC101-1 SHIC101

2	Rin	VCC	4
7	Gin	Gout	9
12	Bin	Bout	14
3	GND	Rcutoff	1
5	GND	Gcutoff	6
10	GND	Bcutoff	11
13	GND		

Sheet: IC102


Dpin8	pin9D
Dpin6	pin5D
Dpin12	pin11D
Dpin3	pin10D
Dpin4	pin2D

File: IC102.sch

Sheet: SHIC103


Dpin2_vin	pin9_gnd
Dpin4_vcc	pin10_prot
Dpin12_B+	pin11_hldrD
Dpin1	pin13_hold
Dpin5_vret	pin14_hphase
Dpin6_vsize	pin15C
Dpin7_vdrv	pin16_hin
Dpin8_vlin	

File: SHIC103.sch

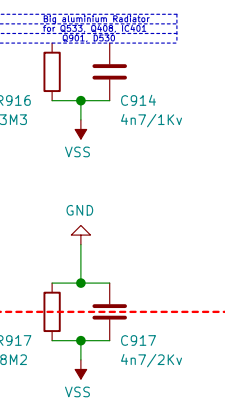

HORIZONTAL

Make R542 2W

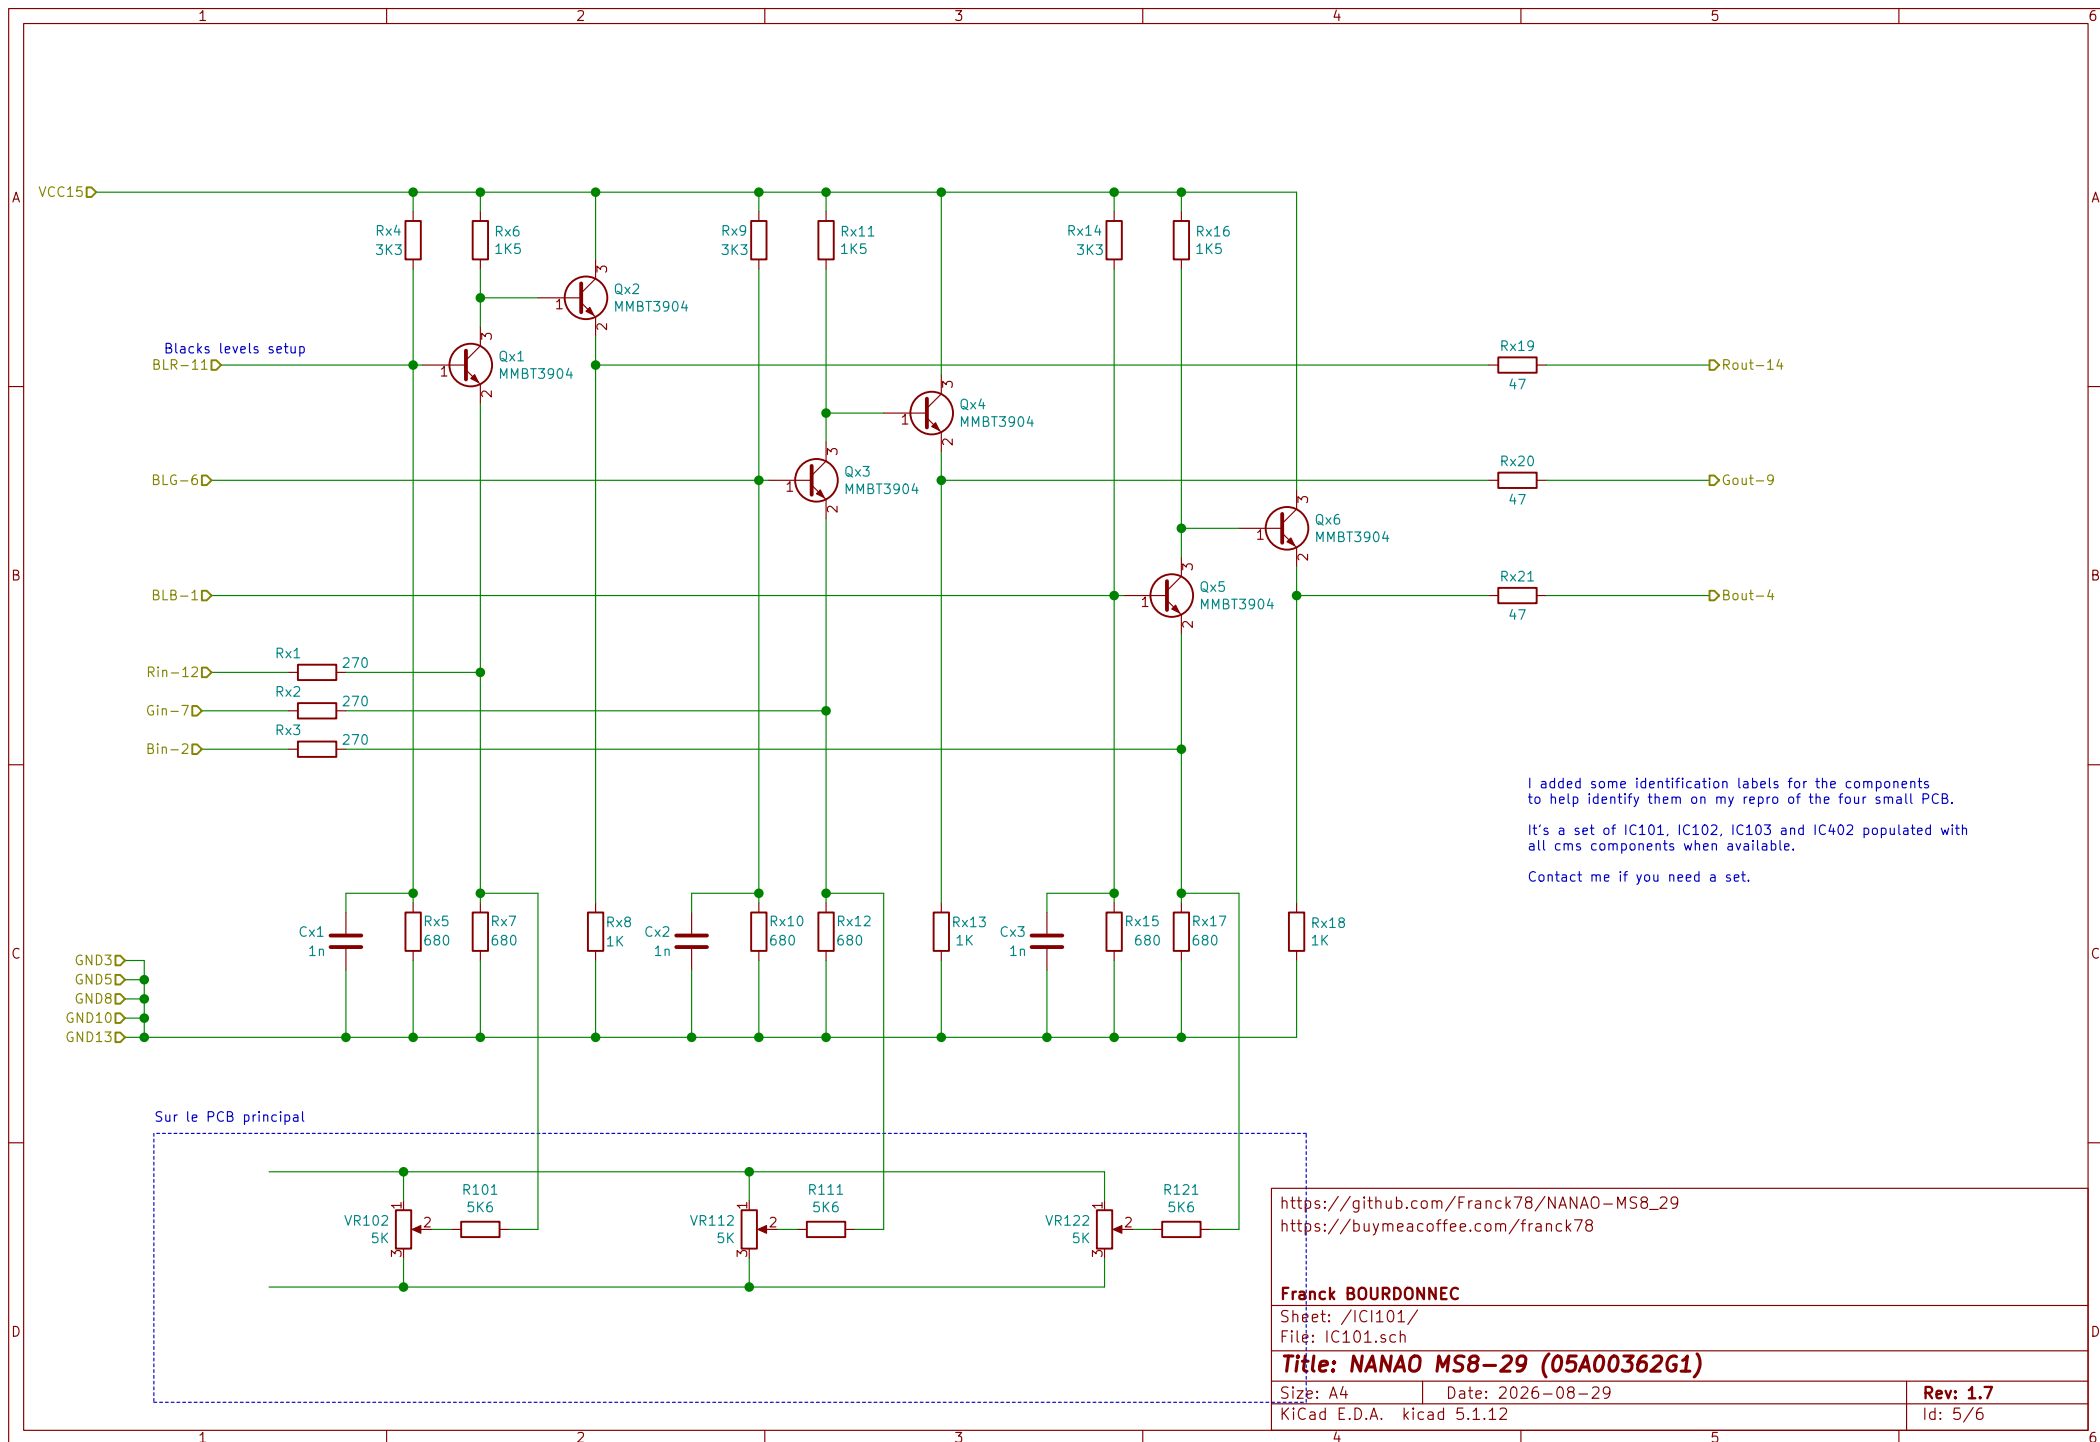

	1	2	3	4	5	6			
A	V1.5 update some values R303,R313,R323 from 62K to 220K R302,R312,R322 from 68 to 33 R307,R317,R327 from 1/2W to 2W L570 : from 22μH to 100μH L301,L311,L321 : from 10μH to 22μH L302,L312,L322 : from 1μH to 1.8μH (not really really sure of ring colors brown,grey,gold red, violet, gold) found 1K resistor on L301, named it R307 Sparkgap: 1Kv Add D305, D315, D325 pcb-crt bodge C446 bipolar 33μ/16v	V1.6 Rework IC102 V1.6a IC401 is LA7832 not LA7830 I installed a FJL6920. Works OK. https://www.arcadepartsandrepair.com/store/integrated-circuits/transistors/fjl6920-high-output-transistor/ V1.7 Measured caps on SHIC101 (1n) Add identification on ICxxx for making the 4 pcb. Added R467 around Hsize and redraw schematic. Added some equivalent (tested) TR ref, for neckboard. note on R545..C533 not always populated C447 is 47μ not 470μ							
B	TIPS: === No Hsync at 15KHz: C913 is draining down the 12v to 6v. This makes the HA11423 do 24KHz. If you put the plug to 24KHz, the HOT fries directly (36KHz). Whitout the HOT installed, there is not enough juice through TH901 to produce a correct 18v and 12v ! Problems with pincushion: reflow IC401 ON THE VERTICAL BOARD.								
C									
D					https://github.com/Franck78/NANAO-MS8_29 https://buymeacoffee.com/franck78 Franck BOURDONNEC Sheet: /Notes/ File: Notes.sch Title: NANAO MS8-29 (05A00362G1) Size: A4 Date: 2026-08-29 Rev: 1.7 KiCad E.D.A. kicad 5.1.12 Id: 6/6				
	1	2	3	4	5	6			