

EMPTY THE CORE TUBE

OBJECTIVE

The purpose of this procedure is to define safe and effective methods for emptying the core tube.

APPLICATION

This procedure applies to all employees of **MACHINES ROGER INTERNATIONAL**.

RESPONSIBILITIES

The worker is responsible for applying this procedure and the supervisor is responsible for ensuring the smooth running of operations and the quality of the work done.


NECESSARY MATERIAL	NECESSARY TOOLS
Core tube	Hammer
Core case	Core knocker
Steel ring	Tube wrench

MANDATORY PPES

Basic PPES mandatory on the site

PROCEDURE

1. Unscrew the backend using the 2 wrenches and store in a safe place

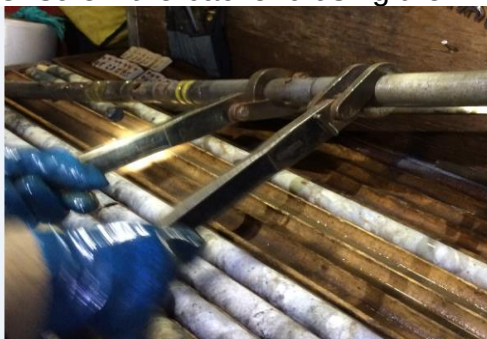

2. Empty the tube so that you never expose your hands in front of the core tube
Putting your hands in front of the tube when the rock comes out could cause serious injury.

EMPTY THE CORE TUBE

3. Place the core as you go (this avoids mixing them)



4. When the core is to be broken at the end of a row, put the core in the row and break it by striking with the hammer.




EMPTY THE CORE TUBE

Never hold the rock in your hands under the hammer, to break it.



5. If the tube is blocked, slide the ring over the tube and hit it with the hammer until the rock falls, start again if necessary. Do not hold the ring with your hands when you hit

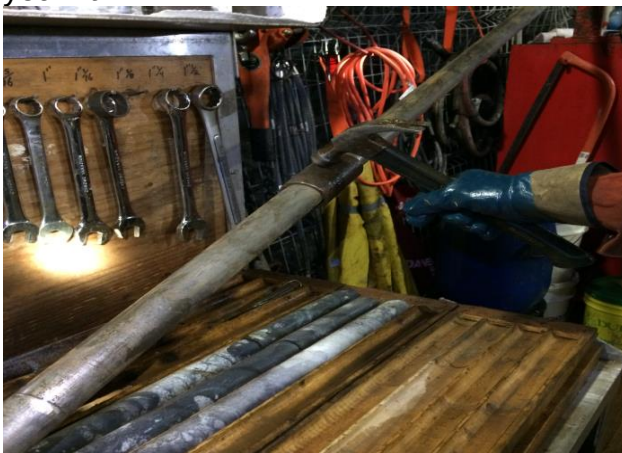

Never hit the tube directly with the hammer to avoid breakage

EMPTY THE CORE TUBE

6. When the core is stuck in the core case, insert the core knocker on the end of the core case and the tube. Hit the striker with the hammer or a small mass, this prevents rock chips



Never look into the tube to see if it is empty, instead insert a metal rod into the end and slide it into the tube.

Never do a back and forth movement with the core knocker to avoid pinching fingers between the core knocker and the tube

7. When the tube is blocked away from the end of the tube, insert a one foot steel rod into the tube, slide the ring over the tube and knock on it until it releases the core

It is forbidden to insert a long steel rod into the tube and to move the rod back and forth to strike the core

8. When the tube is empty, check that the core spring is working properly using a piece of core to see if it holds it well,
9. After verification it is important to grease the core spring and the core case to avoid premature wear.



EMPTY THE CORE TUBE

- 10.** Put the backend on the tube and make a good visual inspection, do not forget to grease it well to avoid premature wear.



- 11.** Store the tube in a safe place while waiting for its next use, never put the tubes on the floor or at face level.





EMPTY THE CORE TUBE

12. Before closing a full box, always make sure that the footage blocks are properly placed and initialized and that your box number is correctly entered

13. The driller must always check the boxes before they are closed.

Adds or modifications	Date	By
Point #6 Added the interdiction to do back and forth movements Point #7 : Added a safety method and interdictions when the core is blocked away from the end of the tube	6 mai 2021	S. Tremblay



Christian St-Amour
Operations manager