


Notes:

1. If the control signal comes from a 5V supply, R1 should be increased to 180 Ohms.
2. The power terminals at connector J1 can be interchanged.
3. When using a MOC3061M (600V), R2 should be changed to 360 Ohms.

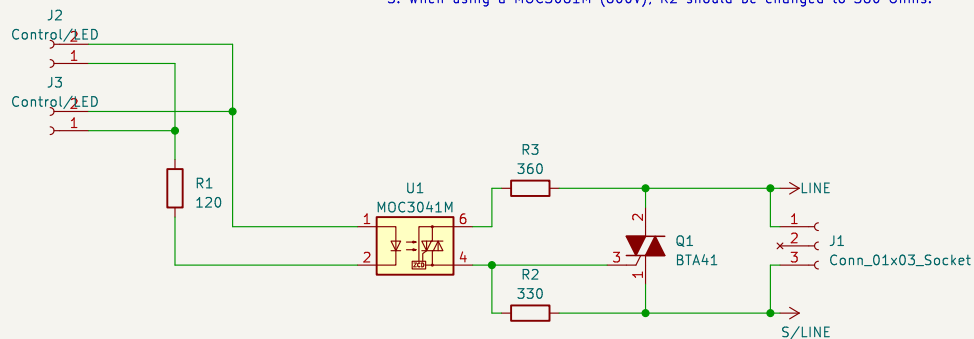

License: CERN-OHL-S v2

Zero-crossing switching – Mains-isolated control input

MOC3041M opto-triac – BTA41-600B power triac (41A / 600V)

Triac power output stage for Mk2 PV Router

Mk2PVRouter.com

Sheet: /

File: Output_stage.kicad_sch

Title: Output stage for Mk2PVRouter

Size: A5

Date: 2023-09-16

KiCad E.D.A. 9.0.8

Rev: 2.0

Id: 1/1