


Notes:

1. R1 = 220 Ohms for 3.3V supply (IF ~ 10 mA).
For 5V supply, use R1 = 390 Ohms.

2. The power terminals at connector J1 can
be interchanged.

3. When using a MOC3063M (600V, VDRM = 600V),
change R2 from 330 to 360 Ohms.

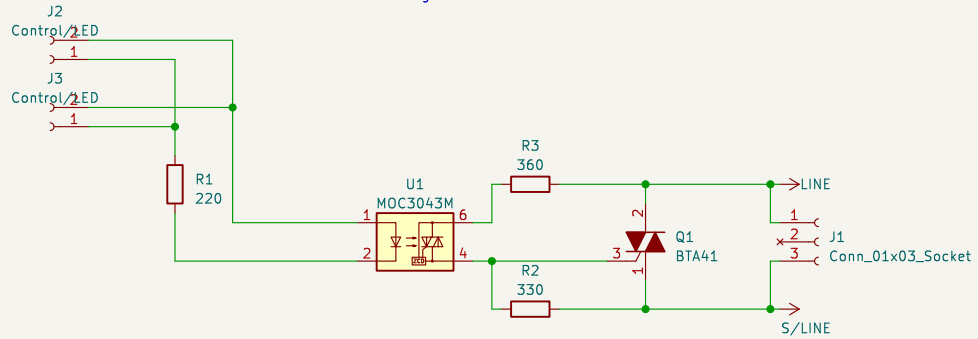

License: CERN-OHL-S v2

Zero-crossing switching – Mains-isolated control input

MOC3043M opto-triac – BTA41-600B power triac (41A / 600V)

Triac power output stage for Mk2 PV Router

Mk2PVRouter.com

Sheet: /

File: Output_stage.kicad_sch

Title: Output stage for Mk2PVRouter

Size: A5

Date: 2023-09-16

Rev: 2.0

KiCad E.D.A. 9.0.8

Id: 1/1