

- New station build

Maintenance sheet version 10 for ablation area (tripod, one level)

Station name	NUK_L_v3
People present	PHO and MACLV
Purpose	Maintenance / (installation) / take-down / quick visit / emergency
Date	07/06/2025 arrival: ~10.00am departure: (local time)

Notes: Install a new station


AWS to do list		Check after maintenance			
Part	Shipped (Y/N)	Replaced? (Y/N)	Number shipped/arrival	Number departure	
Radiometer	090114/202705	✓			Clean? Y / <u>N</u>
Ablation hose assembly	50278	50204			No air in hose and bladder half full? <u>Y</u> / N
Iridium modem IMEI number	Inside loggerbox	300534063814740			
Inclinometer/compass	Inside CNR4	✓	Attached to the radiometer? <u>Y</u> / N		
Satellite antenna	Y	Y			
Wind sensor	Y	Y	Black box pointing toward the radiometer (i.e., along the boom)? <u>Y</u> / N		
Temperature / humidity assembly	Y (take cable from NUK_P shipment)	Y	Fan spins? <u>Y</u> / N Sounds, OK? <u>Y</u> / N		
HygroClip T/hum assembly	N	NA	NB: Rotronics (Y / N) could have a 40 °C offset. New or old type? NB: Lufft sensor (Y / N)		
Sonic ranger on AWS	Y	Y	Old sensor with new membrane? Y / N Unknown. Came in this year's shipment		
Sonic ranger on stake(s)	Y	Y	Old sensor with new membrane? Y / N Unknown NB: make sure not being buried next winter Boom height = ~60cm		
Thermistor string	Y	Y			
Solar panel	Y	Y	Clean? <u>Y</u> / N NB: is not effective when partially covered		
GPS antenna	Inside loggerbox	Y	At top of logger enclosure? <u>Y</u> / N		
Logger box ID	T3B-13	T3B-13 →	CR1000 or <u>CR1000X</u> ? ID number:		
Multiplexer	N		Clicking during measurement cycle? Y / N		
Logger enclosure	Y	Y	Replaced (including everything inside)? <u>Y</u> / N New desiccant bags? <u>Y</u> / N		
Battery box	Y	Y	New box? <u>Y</u> / N New desiccant bags? Y / N		
Stakes	Y	Y	New one(s) drilled in? <u>Y</u> / N Length of new stake(s) 8 m? Y / N Bottom plugged to reduce melt-in? <u>Y</u> / N		
Tripod	Y	Y	New tripod? <u>Y</u> / N New sensor boom? <u>Y</u> / N		

Station name	NUK_L_v3
Date	0710612025

Metadata maintenance

	Arrival	Departure
Time difference between logger clock and UTC ($\pm$ mm:ss)		10ger box is +00:02 secs behind UTC
Download data and/or change CF/SD Card (wait for green light)	Y / N	SD card attached (new box) Y / N
Name of logger program	PROMICEv3_Rewired	1-5.CR1X
Screen dump of values in fast scan mode	Y / N	Y / N
Photos of tripod, sensors, logger box wiring etc. (more is better)	Y / N	Y / N
Mast tilt towards radiometer (- if tilting towards anemometer)	°	0 °
Mast tilt across boom looking from radiometer (- if clockwise)	°	3 °
Boom direction relative to north	° true/magn.	352 (8° off) ° true/magn.
Box on wind sensor exactly towards mast? If not, measure.	Y / N	Y / N
Radiometer exactly aligned with inclinometer? If not, measure.	Y / N	NA Y / N
Temperature / humidity height (bottom of casing – surface)	cm	270 cm
Stake assembly standing?	Y / N / sort of	Y / N / sort of
Free length of stake (if 3: outer, holding boom with sonic ranger)	cm	cm
Free length of stake 2 (if 3: middle)	See below	cm
Free length of stake 3 (if 3: outer, without sonic ranger)	cm	cm
Height of ablation bladder fluid level above the ice surface	cm	141.1 cm
Vertical difference in surface height (at station – at hose) (approx.)	cm	~10 cm
Length of thermistor string on surface from surface marking	cm	96.2 cm
Apparent damage to sensors? If yes, which?	Y / N	Y / N

Notes:

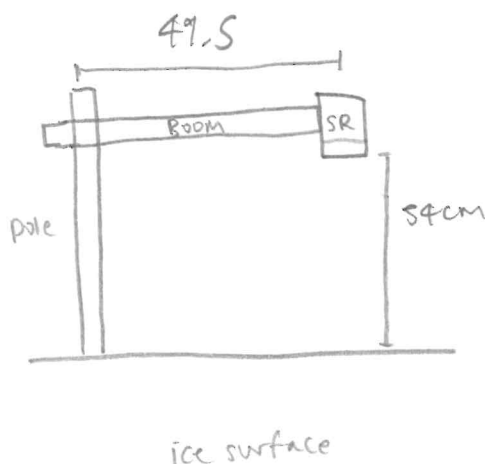

Must-do at next visit: