

Maintenance sheet version 10 for ablation area (tripod, one level)

Station name	NUK_U_v3
People present	MACLV / PHO
Purpose	Maintenance / installation / take-down / quick visit / emergency
Date	07/06/2025 arrival: 15.00

Notes:

- Drill new stake, PTA and thermistor
- Change Luft, SR50, dessicant
- Download data



AWS to do list		Check after maintenance			
Part	Shipped (Y/N)	Replaced? (Y/N)	Number shipped/arrival	Number departure	
Radiometer	N	Y		213257	Clean? Y / N
Ablation hose assembly	N	Y		50278	No air in hose and bladder half full? Y / N <i>6Y</i>
Iridium modem IMEI number	N	N	30053406	3817730	<i>6N. Less than half due to leaking</i>
Inclinometer/compass	N	Y	Attached to the radiometer? Y / N		
Satellite antenna	N	N			
Wind sensor	N	N	Black box pointing toward the radiometer (i.e., along the boom)? Y / N		
Temperature / humidity assembly	N	Y	Fan spins? Y / N Sounds, OK? Y / N		
HygroClip T/hum assembly	N	NA	NB: Rotronics (Y / N) could have a 40 °C offset. New or old type? NB: Luft sensor (Y / N)		
Sonic ranger on AWS	Y	Y	Old sensor with new membrane? Y / N		
Sonic ranger on stake(s)	Y	Y	Old sensor with new membrane? Y / N NB: make sure not being buried next winter		
Thermistor string	N	Y			
Solar panel	N	N	Clean? Y / N NB: is not effective when partially covered		
GPS antenna	N	N	At top of logger enclosure? Y / N		
Logger box ID	N	N	CR1000 or CR1000X? <i>CR1000X</i> ID number: <i>SN: 41256</i>		
Multiplexer	N	N	Clicking during measurement cycle? Y / N		
Logger enclosure	N	N	Replaced (including everything inside)? Y / N New desiccant bags? Y / N		
Battery box	N	N	New box? Y / N New desiccant bags? Y / N		
Stakes	Y	N	New one(s) drilled in? Y / N Length of new stake(s) 8 m? Y / N <i>6.5m, used old one.</i> Bottom plugged to reduce melt-in? Y / N <i>NA</i>		
Tripod	N	N	New tripod? Y / N New sensor boom? Y / N		

Station name	NUK_U_v3
Date	07/06/2025

Metadata maintenance

	Arrival	Departure
Time difference between logger clock and UTC ($\pm$ mm:ss)	+00.26s ahead of UTC.	+00.26s ahead of UTC.
Download data and/or change CF/SD Card (wait for green light)	Y /N	Y /N
Name of logger program	PROMICE v3_Revired_1-4	PROMICE v3_Revired_1-5
Screen dump of values in fast scan mode	Y/N	Y/N
Photos of tripod, sensors, logger box wiring etc. (more is better)	Y/N	Y/N
Mast tilt towards radiometer (- if tilting towards anemometer)	+2 °	0 °
Mast tilt across boom looking from radiometer (- if clockwise)	+11 °	-3 °
Boom direction relative to north	22 ° true/magn.	0 ° true/magn.
Box on wind sensor exactly towards mast? If not, measure.	Y/N	Y/N
Radiometer exactly aligned with inclinometer? If not, measure.	NA Y/N	NA Y/N
Temperature / humidity height (bottom of casing – surface)	223.5 cm	240 cm
Stake assembly standing?	Y/N / sort of	Y/N / sort of
Free length of stake (if 3: outer, holding boom with sonic ranger)	cm	cm
Free length of stake 2 (if 3: middle)	cm	cm
Free length of stake 3 (if 3: outer, without sonic ranger)	cm	cm
Height of ablation bladder fluid level above the ice surface	125 cm	130 cm
Vertical difference in surface height (at station – at hose) (approx.)	0 cm	0 cm
Length of thermistor string on surface from surface marking	0 * cm	59 cm
Apparent damage to sensors? If yes, which?	Y/N	Y/N

Notes:

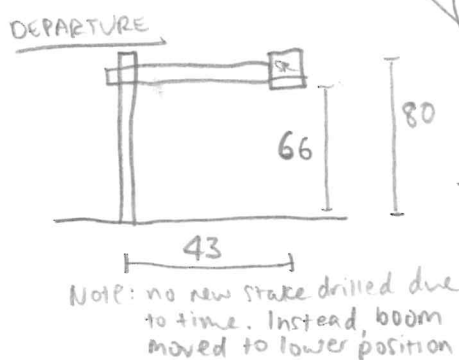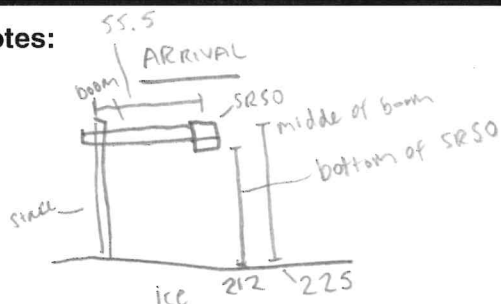

likely to be superficially frozen in.

- No damage to sensors, but tripod tensioner is not on the wire. It is lost.

- Radiometer plug #1 was unplugged

Must-do at next visit:

- New SD card (8GB) put in station. Please note that old NUK_P files exist on this. We could not remove them using Campbell software so left them on.

- New PTA needed as current one has leaked

- New tripod tensioner needed