F 03-09

sanas South African National Accreditation System

NON-CONFORMANCE, CORRECTIVE ACTION AND CLEARANCE REPORT

SANAS No.: T119

Organisation Name: Azure Sky PTY LTD

NC Report Number: NC01

Area/Scope Assessed: Coal Testing

Assessor / Inspector / Expert: N Chiliza

PART 1: DETAILED OBSERVATION

At the time of assessment there was no evidence that the sieves used for crusher efficiency were verified.

(1) Though the Calibrated Vinier was available, the adress on the Calibrate Certificate was from another Lab

Signed (Representative):

Signed (Team Leader / Inspector):

MAJOR: [X] MINOR: [ ]

Reference No. of relevant Guide / Standard / Requirement: ISO/IEC 17025 7.4

Date: 01/04/26

PART 2: ROOT CAUSE ANALYSIS

(Provide an analysis of the extent and cause of the nonconformity)

The laboratory correctly applied the intent of clause 6.4.2 but failed to document the verification of the use of external equipment in the facility, leading to a break in the traceability. System documentation was not available given the verification of sieves not available.

PART 3: CORRECTIVE ACTION TAKEN

(Clearly indicate what corrective action was taken, and attach supporting evidence of implementation)

> Interim control & Procedure update (Equipment procedure 6.4)
> Verification of sieves performed using spreadsheet PSD014
> Permanent Solution of the purchase of a vernier ~~calibra~~ caliber, now sent for calibration. TMS

Date: 24/04/2026

Signed (Representative): apongo

PART 4: CORRECTIVE ACTION VERIFIED AND CLEARED

(Comment on whether the corrective action is sufficient and appropriate)

SB

Date:

Signed: Assessor / Inspector/Expert:

PART 5: FOLLOW-UP AT NEXT ASSESSMENT

(Comment on the implementation of the corrective actions)

Date:

Signed: Assessor / Inspector/Expert:

©SANAS

AS004MF 07/25

BRAINSTORMING FORM

IRQ no: NC05

Brainstorming team

Thepo Maponya
Sizi so Nyanubi
Nosipho Mlongwane
Keitumetse Maleka

What went wrong?

No evidence of sieve verification was initially found, and the interim solution (borrowed caliper) was rejected due to an address that is not of the organization

- Why was the borrowed caliper's certificate rejected?

The laboratory failed to provide a record showing that the equipment though calibrated for another site, was formally 'verified' and 'accepted' for use at our facility per clause 6.4.2.

- Why was there no acceptance record?

The lab believed the valid calibration certificate was the only document required to satisfy clause 6.4.2.

- Why was the address difference not addressed?

The laboratory did not have a 'verification of external equipment' form or any mention of use of external equipment documented which would link the borrowed asset's to our specific project/location for the duration of it being used in the organization.

- Why was this process not formalized?

The QMS lacked documentation of such equipment which would include a check on all necessary documents and evaluation prior to introducing it into the system.

Reason: The laboratory correctly applied the intent of clause 6.4.2 but failed to document the verification of the use of external equipment in the facility, leading to a break in the traceability chain.

Supervisor: Maponya


AS001MF

07/25

ROOT CAUSE ANALYSIS FORM

IRQ NO: NC05

At the time of assessment there was no evidence that the sieves used for crusher efficiency were verified. Though the calibrated vernier was available, the address on the calibration certificate was from another lab

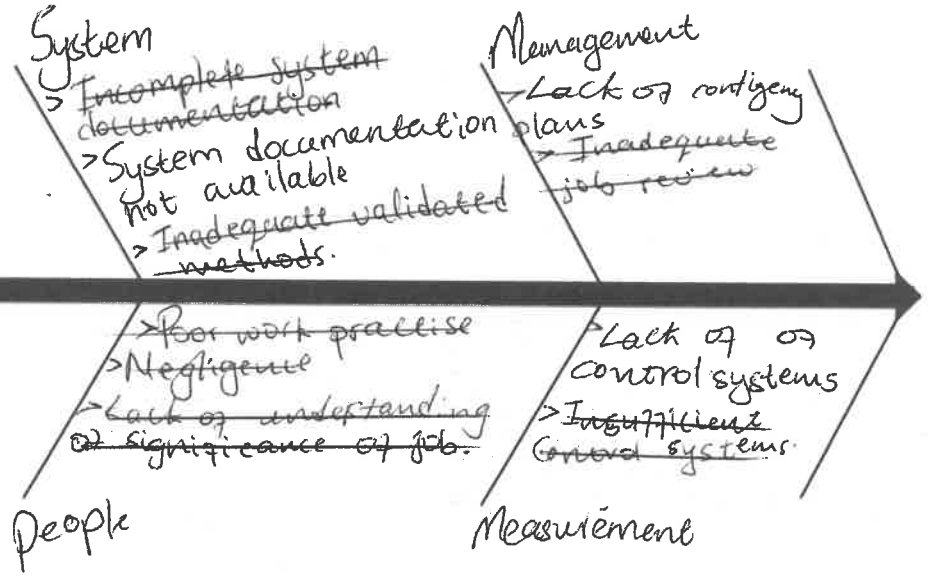

Apoya

SUPERVISOR

AS009MF 04/26

Additional Space for NC's

IRQ no: NC 05

Interim control & Procedure update

- To fullfill the requirements of clause 6.4.2, the CAB has updated its equipment procedure 6.4 to include a section that handles the use of external equipment in the organization, together with the checklist "External Equipment Checklist" ASMF 6.4.2 for compliance. The vernier caliper underwent this process and was deemed fit for use in the laboratory.

Verification of Sieves

- The laboratory has performed a retrospective external equipment checklist on the borrowed vernier caliper which confirmed its validity & be used as per the checklist requirements. The sieve verification results are now validated, following this procedure & checklist. Doc PSD014 (Excel spreadsheet) attached with verification of sieves done.

Permanent Solution

- Anew vernier caliper has been purchased and is currently undergoing calibration. Attached is the job receipt. Once returned, this caliper will be the primary tool, and the borrowed caliper will be retired from the system.

Supervisor: Mafonya

Linberts Calibration Services cc

SANAS ACCREDITED LABORATORY

ACCREDITATION NO. CAL 017-00-00

CAL 017-00-00

CERTIFICATE OF CALIBRATION

CERTIFICATE NO. S26-1224 PAGE 1 of 1

ISSUE DATE: 28-04-2026

CALIBRATION DATE : 28-04-2026 DATE DUE: APRIL 2028

DESCRIPTION	VERNIER CALIPER 0 - 150 mm	TRACEABLE EQUIPMENT / STANDARDS USED
CUSTOMER	AZURESKY (PTY) LTD	GAUGE BLOCKS SERIAL NO.5561
ADDRESS	17 MAKRIEL ROAD	LENGTH BARS SERIAL NO.12878,2
ADDRESS	WADEVILLE, GERMISTON, 1423	EXTERNAL MICROMETER SERIAL NO.9012229
MANUFACTURER	TORK CRAFT	ALL MEASUREMENTS AND EQUIPMENT ARE TRACEABLE
SERIAL NO.	SDK 39250808825	TO NATIONAL / INTERNATIONAL STANDARDS
TEMPERATURE °C	20°C ± 1°C	REFERENCE PUBLICATION : BS.887 & BS EN ISO 13385-1 : 2011
HUMIDITY % RH	50% RH ± 10% RH	CALIBRATION PROCEDURE : LIN/CP/12

NOTE : ALL RESULTS ARE STATED IN MILLIMETERS (mm).

MEASUREMENT UNCERTAINTY ± 0,029mm

FEATURE	SPECIFICATION	ACTUAL
Parallelism of external measuring faces	0,008	0,020 *
Parallelism of internal measuring faces	0,010	0,010
	NOMINAL	
Accuracy of reading	0,00	0,00
	10,00	10,00
	25,00	25,00
	50,00	50,00
	75,00	75,00
	100,00	100,00
	150,00	150,00
Maximum Permissible error	0,02	0,00
Depth Rod:		0,00

Note : All measurements were taken at the back of the jaws.

: * Denotes out of specification for BS.887 & BS EN ISO 13385-1 : 2011.

: The results stated on the certificate only relate to the item calibrated on this certificate.

Actom Electrical Machines (Factory), Cor. Van Dyk & Aberdeen Rd's, Benoni Industrial, Private Bag 1026, Benoni, 1500

Tel : (011) 899-1073, Fax : (011) 899-1032, e-mail : linberts@mweb.co.za (NOTE : TERMS AND CONDITIONS ON REVERSE PAGE.)

Calibrated by : B.J Jacobs APPROVED BY : TECHNICAL SIGNATORY :

	AzureSky	
AzurESky "ensure quality at last"	**External Equipment Checklist**	**Document no: ASMF 6.4.2**

Compiled by:	**Sifiso Nyambi - Laboratory Manager**	
Approved by:	**Nonhlanhla Msibi - Operations Manager**	

Scope: To be completed whenever equipment outside the permanent control of Azuresky is utilized for accredited testing or verification activities.

Section 1: Equipment Identity

Item Description: Mac Artic Vernier Caliper

Manufacturer/model: VD01

Serial Number: VD01

Owner/Lending Organization: Vitrovian Analytical Services

Section 2: Calibration & Traceability Check

Check Item	Requirement	Yes/No
Calibration Certificate	Is a valid certificate available?	YES
Accreditation Body	Does it bear the SANAS (or equivalent) logo and accreditation number?	YES
Calibration Status	Is the equipment currently within its calibration period?	YES
Traceability	Does the certificate confirm traceability to national standards?	YES
Scope Suitability	Does the calibration range cover the intended test range?	YES

Section 3: Physical & Technical Verification

Check Item	Requirement	Result/Value
Visual Inspection	No visible damage, rust, or worn measuring surfaces?	YES
Functional Check	Tool Operates smoothly; zero-point/blank point is stable?	YES

	AzureSky	
AzurESky	External Equipment Checklist	Document no: ASMF 6.4.2
	Compiled by: **Sifiso Nyambi - Laboratory Manager**	
	Approved by: **Nonhlanhla Msibi - Operations Manager**	

Acclimatization	Equipment stabilized at laboratory temperature for > 2 hour prior to use?	Yes
Intermediate check	Result when measured against internal reference/standard where possible?	Value: N/A (Measurements repeatable using the tool)
Reference ID	Identity of the internal reference used for check	ID: N/A (Sieves)

Section 4: Authorization

Technical Justification for use: Verification of sieves biannually have to be met, however the lab does not have the tool to measure sieves. External equipment is verified and deemed fit for use.

Statement of acceptance: I have reviewed the documentation and performed the physical checks listed above. The equipment is deemed suitable for use and complies with the requirements of ISO 17025 Clause 6.4.2.

Verified By: Ishep Maponya

Signature: 

Date: 17/04/2026

Authorized By: Sifiso Nyambi

Signature: 

Date: 24/04/2026

Effective date	Rev status	Next review date
04/2026	00	04/2029

DJN Metgauge cc
P.O Box 6646
Westgate
1734
Tel: (011) 768 3325
(011) 768 4270
Fax: (011) 768 3653
Email: info@metgauge.co.za

METGAUGE
Calibration Laboratory
Since 1987

Medgate Centre, Shop No.8, Kingfisher Street, Horizon, Roodepoort

sanas
Calibration Laboratory
CAL-110-00-00

Calibration Certificate

Certificate No: **DB 14965**

Cal. Date: 02 February 2026
Due Date: February 2027

Customer: Vitrovian Analytical Services
35 4th Street
Delmas
2210

Description: 0-150mm Digital Caliper

Serial: VD01
Manufacturer: Mac Afric
Uncertainty Of Measurement: See Overleaf
Reference Publication: B.S 887: 2008
Calibration Procedure No: P-010-008-05
Environment: **Temperature** 20° C ± 1° C **Humidity** 20 To 70%
Traceable Standard Used: Vernier Gauge Blocks
Serial# 3034 Cert# NMISA-LEN-2023-4220

Equipment Used:
Vernier Gauge Blocks Serial No. MG 10

Error In Units Of mm
Temperature 20° C ± 1°C

Calibration Points		Permissible Error	Actual Error
Parallelism			
Internal Jaw		0.010mm	0.010
External Jaw		0.008mm	0.02
External Measuring			
Scale Error	**0.00**	± 0.020mm	0.000
	10.00	± 0.020mm	0.000
	20.00	± 0.020mm	0.000
	41.20	± 0.020mm	-0.010
	51.20	± 0.020mm	0.000
	81.50	± 0.020mm	0.000
	101.20	± 0.020mm	0.000
	121.80	± 0.020mm	0.000
	150.00	± 0.020mm	0.000
Internal Measuring			
Jaw at 20mm		± 0.020mm	-0.010
Depth Measuring		± 0.020mm	0.000

Note: Permissible error taken from B.S 887: 2008

Uncertainty of Measurement: ± 0.015mm

02 February 2026
Date

Calibrated By
D Bruwer

Technical Signatory
D. Bruwer

AzurESky

Doc No: PSD014
Compiled By: TMJ Maponya
Approved By: SB Nyambi
Effective Date: 15 April 2026

3. Overall Sieve Verification Log

Sieve ID	Nominal Size	Date	Average	Max Found	Status (Pass/Fail)	Verified By
500401	1mm	2026/04/17	1,0035	1,03	PASS	Tshepo Maponya
500623	3mm	2026/04/17	3,0015	3,05	PASS	Tshepo Maponya
500628	4,75mm	2026/04/17	4,751	4,81	PASS	Tshepo Maponya
500847	6mm	2026/04/17	6,005	6,06	PASS	Tshepo Maponya
600311	10mm	2026/04/17	12,001	12,2	PASS	Tshepo Maponya
600519	25mm	2026/04/17	25,02	25,3	PASS	Tshepo Maponya
610209	22.4mm	2026/04/17	22,2235	22,5	PASS	Tshepo Maponya
500697	50mm	2026/04/17	50,035	50,4	PASS	Tshepo Maponya

Vernier Caliper Used : 0-150 Digital Caliper
Certificate Number: DB-14965
UoM: ±0,015mm
Serial Number: VD01

AzurESky	**Document No.** AS008MF	**Page 1 of 1**
	Effective Date	**April 2026**
	Revision Date	**April 2029**
Title:	Memorandum	
Document by:	Azuresky Pty Ltd	**Revision No**
Compiled by:	Sifiso Nyambi & Tshepo Maponya	**00**
Authorizing Officer: N Msibi	**Signature:**	

Department: Laboratory

Memorandum no: 008

Position: Lab Supervisor

Date: 24/04/2026

Title: Awareness of use of external equipment in the lab

Kindly note that the use of external equipment will primarily undergo section of equipment procedure. This section informs personnel of a compliance checklist that external equipment has to go through prior to it being introduced into the system. The checklist has all primary criterias that makes sure the lab correctly applies clause 6.4.2 of ISO 17025.

AFTER

5. Calibration and Maintenance

- **Calibration Program:** The lab follows a schedule as defined in the **Equipment Register (ASMF 6.3 Equipment Register)**.
- **Service Providers:** Calibration is performed by accredited facilities (refer to **ASMF 6.2** for subcontracting/service provider assessment).
- **Intermediate Checks:** Where necessary (e.g., pH meters or scales), "intermediate checks" are performed between calibrations to maintain confidence in the equipment's status.

6. Non-Conforming Equipment

If equipment has been subjected to overloading, mishandling, gives suspect results, or is shown to be defective:

- **Isolate:** It must be taken out of service immediately.
- **Label:** A clear **"OUT OF SERVICE"** or **"DO NOT USE"** tag must be attached.
- **Investigate:** The lab must evaluate the impact of this defect on previous test results and initiate the Non-Conformance procedure if necessary.

7. Safeguarding

Equipment hardware and software shall be safeguarded from adjustments that would invalidate the test results. This includes password protection for software and physical seals on calibration-sensitive screws or knobs.

8. Use of external Equipment

The use of external equipment(borrowed/rented) shall be done in accordance with clause 6.4.2 of ISO 17025. Checklist ASMF 6.4.2 External Equipment Checklist shall be used to evaluate such equipment to make sure they adhere to the said clause (6.4.2) prior to them being introduced into the system. The records of the use of such equipment shall be kept and made available during internal/external assessments to ensure compliance.

9. Revision

Revision no	Content changed	Reason for revision
01	Added section 8, which controls the use of external equipment.	Ensure compliance to clause 6.4.2 of ISO 17025

AzurESky	ATTENDANCE REGISTER		
	Document no:	Version:	Page:
	ASMF 17043-8.4.1	0	1
	Compiled by:	Sifiso Nyambi - Laboratory Manager	
	Approved by:	Nonhlanhla Msibi - Operations Manager	
Date:	24/04/2026		
Chair:	TMJ Maponya	**Scribe**	
Subject:	Update of procedure 6.4 Equipment & introduction of checklist 6.4.2		
Absent:			

Present	Cell Number	Designation	Signature	Email address
TMJ Maponya	076 455 0692	Lab Supervisor	TMJ Maponya	tshapo@azuresky.it.com
SB Nyambi	0721741852	Lab Manager		sifiso@azuresky.it.com
A Janda	060 611 1584	Lab analyst		abenathi@azuresky.it.com
N. Msibi	0839788749	Ops Manager		nonhlanhla@azuresky.it.com
K. Maleka	071 724 9031	Lab analyst	kmaleka	keitumetse@azuresky.it.com