
STANDARD OPERATING PROCEDURE OF MARTINDALE ABRASION VF-C04


Lab /SOP/ 16



Martindale abrasion machine
2.5kg disc weight
Distilled Water
Immersion dish.

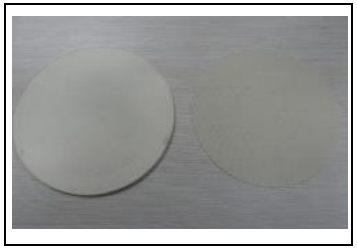


Fabric abradant 165mm in diameter
Felt backing material 165mm in diameter

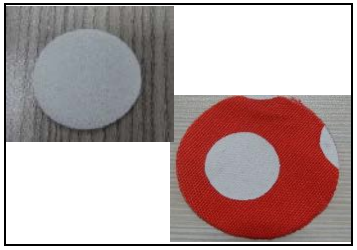

PU foam with a thickness of 3±1 mm, density of 30±1 kg/m3, white or pastel color.
Test two (2) “dry” samples and two (2) “wet” samples per material



Position the test sample into the bottom of the test sample holder such that it is centered and the outer (test) surface faces the hole.
thickness of the test specimen is below 2.5 mm add a PU foam backer.
test sample is above 2.5 mm, no need for the foam backer.

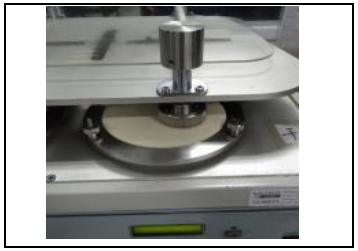


Place the assembled sample holder face down onto the fabric abradant test station.
Insert the spindle /weight through the opening in the top plate and into the opening in the sample holder, a loading of 12 kPa is always used.



Set the counter to zero, set the pre-set counter to the desired number of cycles, and start the machine.
Examine the samples at least every 2,000 cycles.



Wet abrasion:
Soak the wool fabric abradant and felt by submerging it in room temperature water for 5-10 minutes.
Position the fabric abradant and felt backer without excess water to drip offon the test station
After 6,500 cycles stop the test and re-wet the fabric abradant and felt backer add 30 grams of distilled water.

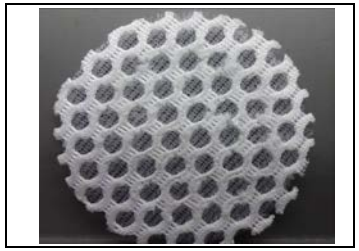

Discontinue the test when the first yarn has been completely worn through.
The lower number of cycles which were required to produce failure of a test sample.

Prepared by	Approved by	REVISION		DATE	