STANDARD OPERATING PROCEDURE OF TABER ABRASION VF-C05

Lab /SOP/ 17



Taber abrasion machine

Soft bristle brush.



S-11,150 grade sandpaper B

For cleaning wheels




CS-17/H-18/H-22 abrasive wheels

The abrasive wheels must be re-surfaced every 10-15 tests or when the surface becomes uneven or excessively clogged with debris.

The wheels must be discarded when the diameter of the wheel is less than 4.6cm.



S-36 cardboard backer A, 0.8 +/-0.2mm thick and 103 +/-3mm in diameter.

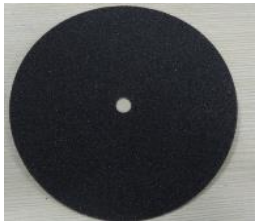


Sample size : diameter of 103+/-3mm with a 7+/-1 mm hole in the center .

Place a new piece of 150 grade sandpaper on the turntable.run the machine for 25 cycles

Raise the abrasive wheels from the turntable, remove the sandpaper and discard it.

Clean the wheels, using a soft bristle brush.

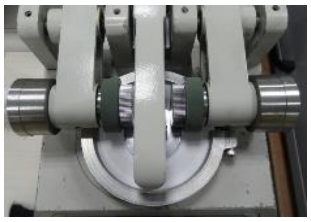

Place the test sample with carboard baker on the turntable.

Lower the abrasive wheels onto the test sample and turn on the machine.



During the first 25 cycles of the test, inspect the condition of the sample, then at 50 cycles, then at 250 cycles.

After 250n cycles check at 250 cycle intervals until failure or the maximum number of required cycles.



Failure is defined as the number of Taber cycles required to wear through the finish for a linear. distance of 2.0mm, or significant color change to the sample.

The lower of the two failure points for a given test material to the nearest five (5) cycles.

Prepared by	Approved by	REVISION		DATE	