STANDARD OPERATING PROCEDURE OF BALLY FLEX VF-D01


Lab /SOP/ 19




Bally flexometer
Immersion dish
Distilled water
Hydrolysis machine for sample to be tested after hydrolysis
Freezing chamber capable of maintaining temperature @ - 20 ±1oC




Test four (4) samples (two in each direction) per material per testing condition
Sample size is 70mmX45mm
Test after hydrolysis,Place the test materials in an oven at 70+/-2oC for 7 days at 95 % relative humidity first.

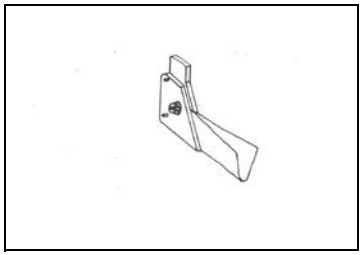

Bring the upper clamp of the bally flexometer to its maximum forward position.
Hold the test sample such that the outer surface is facing upward.
Place the folded sample into the top clamp of the bally flexometer.

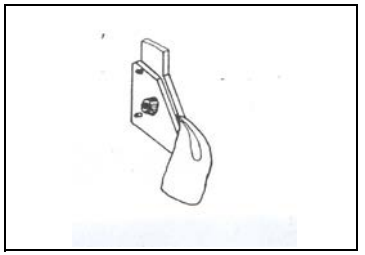

The portion of the test sample which is projecting from the top clamp is then folded downwards over the top clamp so that the fold is directed vertically downwards.

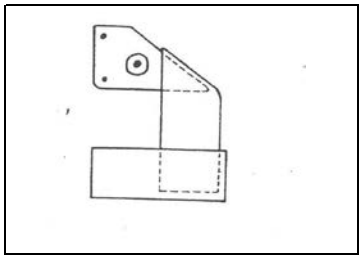

Insert the free end of the test sample into the bottom clamp such that the front edge of the test sample is perfectly vertical.
Lightly pinch the portion of the test sample which is located on the upper jaw.



Allow the lower portion of the free end to hang freely in the bottom clamp, and secure the sample by firmly tightening the screw on the bottom clamp.



Set the “shut-off “counter to the desired number of cycles, and zero the “sample” counter.
Initiate testing and inspect the samples after every 5000 cycles during the first 25000 cycles, after 25000 cycles inspect the samples every 10000 cycles.
Remove failed samples at their point of failure



Wet test:Immerse the test samples in distilled water at 23±2 oC for 120±5 minutes
Remove the samples and wipe off any excess surface moisture.Insert the samples to bally flexometer.
Samples should be evaluated every 2000 cycles

Prepared by	Approved by	REVISION		DATE	