
STANDARD OPERATING PROCEDURE OF HEAT AGING VF-E04

Lab /SOP/ 46



Air-circulating oven, capable of maintaining 70+/-2oC

AATCC Chromatic Transference Scale

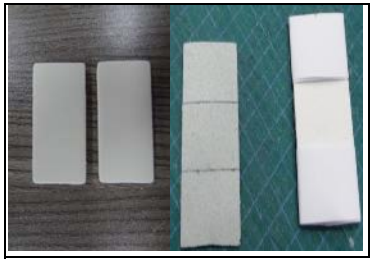

Mask the first and last 2cm of the test sample with a piece of Non transparent masking tape this will leave the center 2cm unmasked. For assembled shoes, place the one pair of whole shoes in an oven.



Place the test materials in an oven at 70+/-2oC for 4 hours, 1 day,3 days, and 7 days

Place shoes in an oven at 70.0+/-1.0oC for 3 days. For color migration , testing should be for 7 days at 70 +/-1.0oC



After removing the shoes from the oven, allow them to condition for 2 days at standard conditions.



Check change of appearance – shrinkage, blooming, color change, ink migration,



Check delamination of components.



Check the corrosion of metal parts.



Compare the color of the darkest portion of the uncovered area of the test sample to the AATCC Chromatic Transference Scale and rate to the nearest 0.5.

Chromatic Transference Scales must be replaced at least every 24 months.

Light bulb must be replaced at least every 1000 hours actual usage.

Prepared by	Approved by	REVISION		DATE	