
STANDARD OPERATING PROCEDURE OF COLORFASTNESS TO Perspiration VF-E16

Lab /SOP/ 25




Multi-fiber fabric A
Immersion dish
Artificial Perspiration Solution for pH 4.3 ±0.2
Paper towel
Oven capable of maintaining a temperature of 38+/-1oC.
AATCC Chromatic Transference Scale.

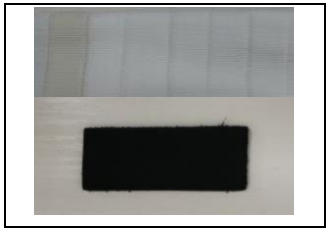


Test one (1) sample per material.
Fabric = Top side/finished surface only
Leather = Both sides
Synthetic = Both sides
multi-fiber fabric minimum of 2 cm X 5 cm
Material size minimum 2 cm X 5 cm




Prepare one liter of artificial perspiration PH 4.3.
Immerse the test material and multi-fiber fabric lay-up in artificial perspiration test solution at 23+/-2 o C. Insure that the test material and multi-fiber fabric remain in contact and are fully sub-merged in the artificial perspiration test solution.

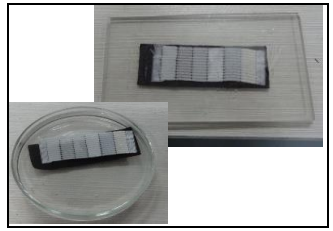

Remove the test sample lay-up from the artificial perspiration test solution after 15 minutes.
Remove excess solution from the test sample lay-up by lightly wiping the surface with a paper towel or tissue.

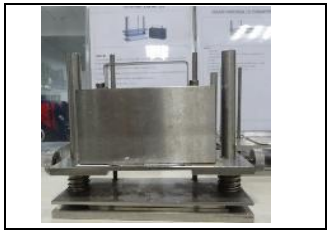

Immediately place the test material and multi-fiber fabric lay-up between two of the plastic plates from the perspiration tester.
Insert the plastic plates into the perspiration tester, and place the metal compensating plate and a 10.0 pound (4.54kg) weight on top of the plastic plates.

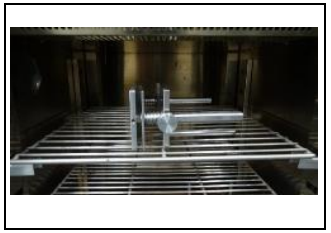

Place the perspiration tester in an oven at 38+/-1 o C for 6 hours.



Separate the test material from the multi-fiber fabric and completely dry at a temperature no greater than 60 o C.



Evaluate colorfastness by rating the color of each of the multi-fiber test fabrics in comparison to the AATCC Chromatic Transference Scale. The evaluation must be performed under normal daylight.
Chromatic Transference Scales must be replaced at least every 24 months.
Light bulb must be replaced at least every 1000 hours actual usage.

Prepared by	Approved by	REVISION		DATE	