STANDARD OPERATING PROCEDURE OF Rubbing Fastness - GB Standard VF-E24

Lab /SOP/ 24



Rubbing Fastness Tester
White or black wool felt
Light box AATCC
Grey Scale
Container (with graduation)




Wool Felt : White or Black
Dimension: 15 mm X 15 mm; thickness 5.5 mm ± 0.5 mm
Mass per unit area 1750 g/m2 ±100 g/m2




Sample size: 12X12cm
Test 3 samples




Immerse a new felt in cool distilled water, heat to boiling and allow to boil gently until the felt sink. Then decant off the hot water and replace with cold distilled water. Allow to stand until the wetted felt has reached room temperature. Take the felt from the water just before use and squeeze or wipe it in order to reduce its water uptake to approximately 1 g.

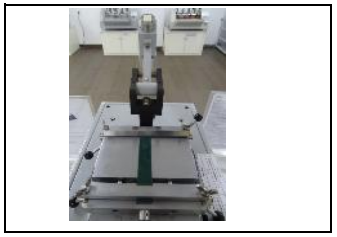

Clamp the specimen with the test surface upwards on the workbench and allow the specimen under the center of the rubbing finger.
Attach a new felt to the undersurface of the rubbing finger.

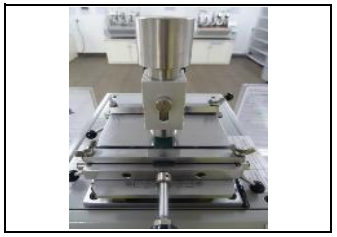

Set the number of cycles according to the test requirements and press the start button. Check the rubbing distance at 35 mm and rubbing speed at 40 ± 2 r/min

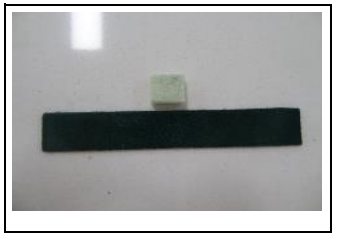

At the end of required cycles, lift the abrasion device and allow it to lean against the fixed rod and then remove the felt.
Remove the specimen and wool felt and place on a clean desk or white paper.



Evaluate the colorfastness to dry crocking by comparing the darkest portion of the test cloth to the AATCC Chromatic Transference Scale .The evaluation must be performed under normal day light.
Chromatic Transference Scales must be replaced at least every 24 months.

Prepared by	Approved by	REVISION		DATE	