
STANDARD OPERATING PROCEDURE OF LAMINAR PEEL STRENGTH VF-F04


Lab /SOP/ 10



1. Tensile testing machine with chart recorder
2. Clamps
3. Steel scale or calipers

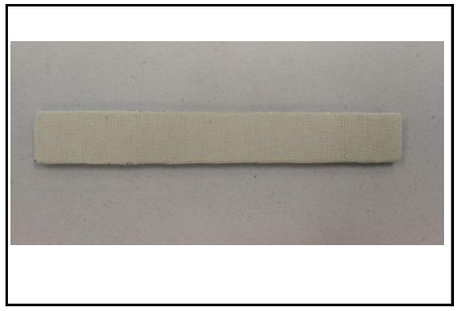


Prepare three (3) bond samples per adhesive or material combination.
Sample size:2.5+/-0.1cm in width by approximately 15cm in length.

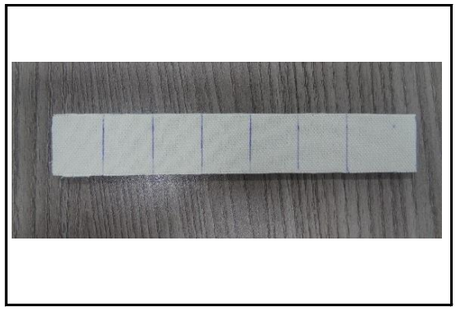


Put a mark on the testing sample approximately every 2cm and number these locations starting at the initiation point in ascending order.
Measure the width of the test sample to the nearest 0.05cm at every 2 cm marked.




Zero and calibrate the tensile testing machine, Set the crosshead speed to 100mm/minute, the jaw gap to approximately 3 cm.

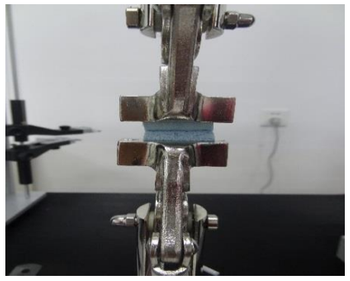


Start testing until the bond sample has been completely separated.

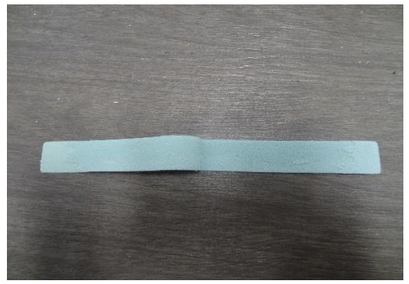

Calculate the force required to pull the test specimen apart at every 2 cm marked by dividing the force by the measured width of the test specimen.

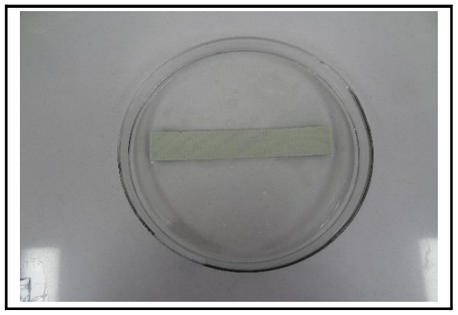

Wet Test
Soak the prepared test samples in distilled water at 23.0+/-1.0 o C for 2 hours.
Remove the samples from the water, and test immediately following the directions outlined in “Dry test” above.

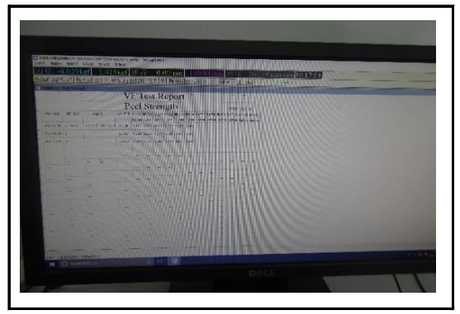

Laminar Peel Strength (kgf/cm) = L / W

Prepared by	Approved by	REVISION		DATE	