STANDARD OPERATING PROCEDURE OF INK ADHESION ON SUBSTRATE VF-F05

Lab /SOP/ 54




1.Scotch tape 3M # 600 or 3M # 810 (TBL requirement)
2. Hand press-roller or 1-2 kg load
3.Cutting devise such as a sharp knife or scissors
4.Distilled water
5.Immersion dish




Prepare three (3) samples with coating and print
Cut specimen with at least 2 cm width,
bigger sample is more ideal



A. Dry Test :
1.Lay the sample flat on the table.
2.Remove any dust or loose contaminants
that may affect the surface contact between
the printed sample and the scotch tape.

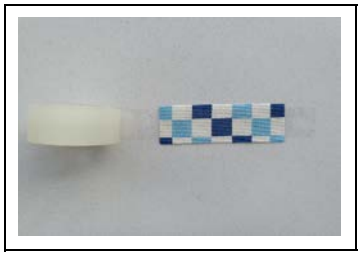


3.Press a strip of scotch tape 3M # 600 firmly
on the printed surface of the sample and making
sure the tape completely covered the required
area , keeping one end of the tape free
(not adhered to the surface).

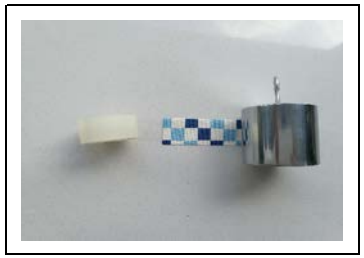

4.Roll the hand press on top of the scotch
tape to ensure that the adhesion of the
scotch tape is good, and wrinkle - free.
5.Hold the free end of the tape at a 90 degree
angle to the sample and separate with one
quick pulling motion.



B. Wet Test – Distilled Water
1.Soak the prepared test samples in distilled
water at 23.0+/-1.0 o C for 2 hours.
2.Remove the sample from the water, and test
immediately following the directions outlined
in"(A) Dry test "above.

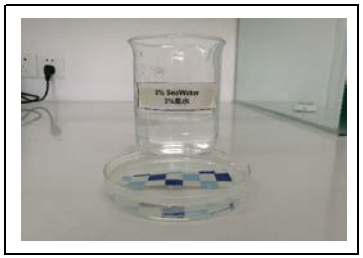

C. Wet Test – Artificial Sea Water Solution
1.Soak the prepared test samples in artificial
sea water solution at 23.0+/-1.0 oC for 2 hours.
2.Remove the sample from the artificial sea
water solution, and test immediately following
the directions outlined in "(A) Dry test "above.



Rate thematerial on a scale of 1 to 3 as follows:
1.No visible finish (ink/paint) removal
2.Slight finish (ink/paint) removal that is restored
when rubbed with finger
3.Permanent finish (ink/paint) removal that is not
restored when rubbed with finger
Report: Rating at the scale 1-3.

Prepared by	Approved by	REVISION		DATE	