STANDARD OPERATING PROCEDURE OF GB FLEX VF-G05

Lab /SOP/ 43



Flexing resistance machine –China (GB) Standard
Folding last - different sizes
Chisel or piercing tool
Vernier caliper (graduated to 0.02 mm)



Place the folding last to the shoe (sandal or outsole). The forepart of the folding last should notfit against the upper of the footwear. The folding last is shorter by 5 mm or half size.
If thefitting is still too tight, use folding last which is 1 size lower



Check the folding area of the last and draw a line across the outsole .This line is regarded as the flexing line of the sample.
Check the width of the line and mark the medial point. Position the test sample to the medial point such that the chisel tip is located on the marked line.




Push the chisel tip just far enough into the test sample so that a 5mm wide slit is produced throughout the entire thickness of the sample.
Mark with regular color pen on 5mm wide slit.



Lace and tie the footwear or outsole in a normal manner.
Position the shoe on the machine.



Set the number of flexes and test frequency on the control panel in accordance with the test requirements.
Initiate testing.

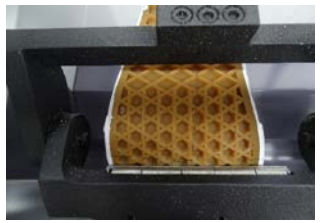

Check the footwear or outsole at least every 5,000 cycles over the first 25,000 cycles, after 25,000 cycles, check the shoes at least every 10,000 cycles.



At the end of the desired cycles, measure the crack length.
In the report include other failures such as delamination between midsole to outsole, delamination in the flexed area, cracking of components, etc.

Prepared by	Approved by	REVISION		DATE	