VF Asia Footwear Laboratory Testing Manual

Test Method for transfer of dye with solvent spot	Test method # VF-I04 Page 1 of 3
Date Issued : November , 2013 Revision # :	Created by : Nila Babia Erazo

PURPOSE AND SCOPE: To check the transfer of dye use in fabric, leather (Natural and Synthetic) , laces and webbing with chemical solvent.

REFERENCES: M-GW-015 GW Method

EQUIPMENT:

1) Micro pipette for 0.1ml - 1 tube
Micro pipette chip - 1 tube
Solvent - Grade ethyl alcohol
Wire mesh at least 90 mm in diameter - 3 sheets,
Filter paper (qualitative grade) : About 70mm in diameter
Grey scale and chromatic transference scale :

MATERIALS: Fabric (all types) , Leather (natural and synthetic), lace and webbing

SAMPLE PREPARATIONS:

1. Upper material :
   - Get sample approximately 1 cm x 1 cm = 3 pieces
2. Lace / webbing :
   - Cut 2-3 pieces, approx . 30 mm long

REPETITIONS: Test two (2) samples per material**.**

TEST PROCEDURES:

1. Put filter paper on wire mesh, and put the test sample on the filter paper. Correct side facing down.

2. Drop 0.1ml solvent on the material by micro pipette. Sample of micro pipette see figure 1

3. Ensure that the solvent able to cover all the sample and penetrates on the filter paper. If after 5 seconds later this doesn't happened, add another drop 0.1 ml solvent. See figure 2 and 3

4. Dry naturally. See figure 4

Test Method for transfer of dye with solvent spot	Test method # VF-I04 Page 2 of 3
Date Issued : November 2013 Revision # :	Created by : Nila Babia Erazo

Judgment and Report for test:

Color migration on the filter paper. Grading base on AATCC scale

Figure 1



Figure 2


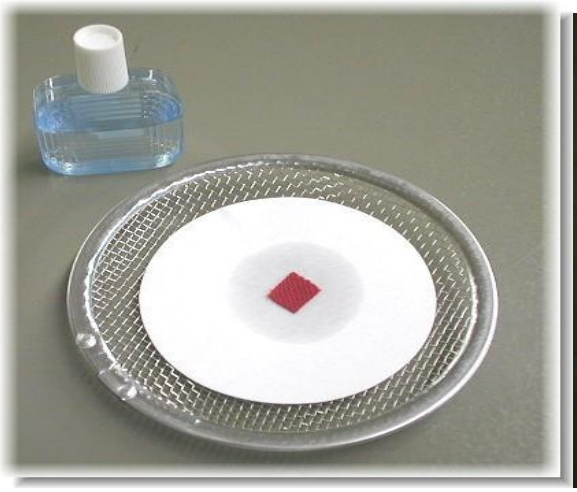


Figure 3



Test Method for transfer of dye with solvent spot	Test method # VF-I04 Page 3 of 3
Date Issued : November 2013 Revision # :	Created by : Nila Babia Erazo Chris Adam

Figure 4.

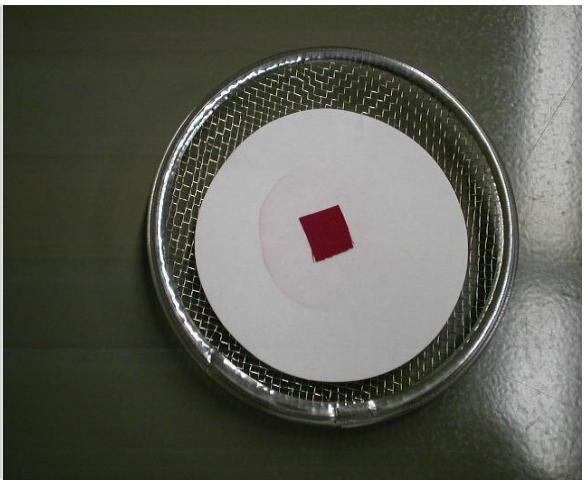