



Ground is Shared W EVERYTHING

Pins can be trimmed (If too tall)

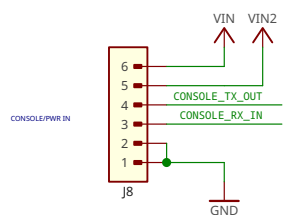


Unused Connector
(Used to tap voltages/Test voltages)

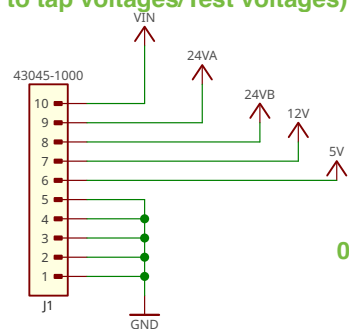


- Mounting_Hole_4_40_Plated
- M1
- Mounting_Hole_4_40_Plated
- M2
- Mounting_Hole_4_40_Plated
- M3
- Mounting_Hole_4_40_Plated
- M4
- Mounting_Hole_4_40_Plated
- M5
- Mounting_Hole_4_40_Plated
- M6

Power Voltage conversion for RGA AND Turbo

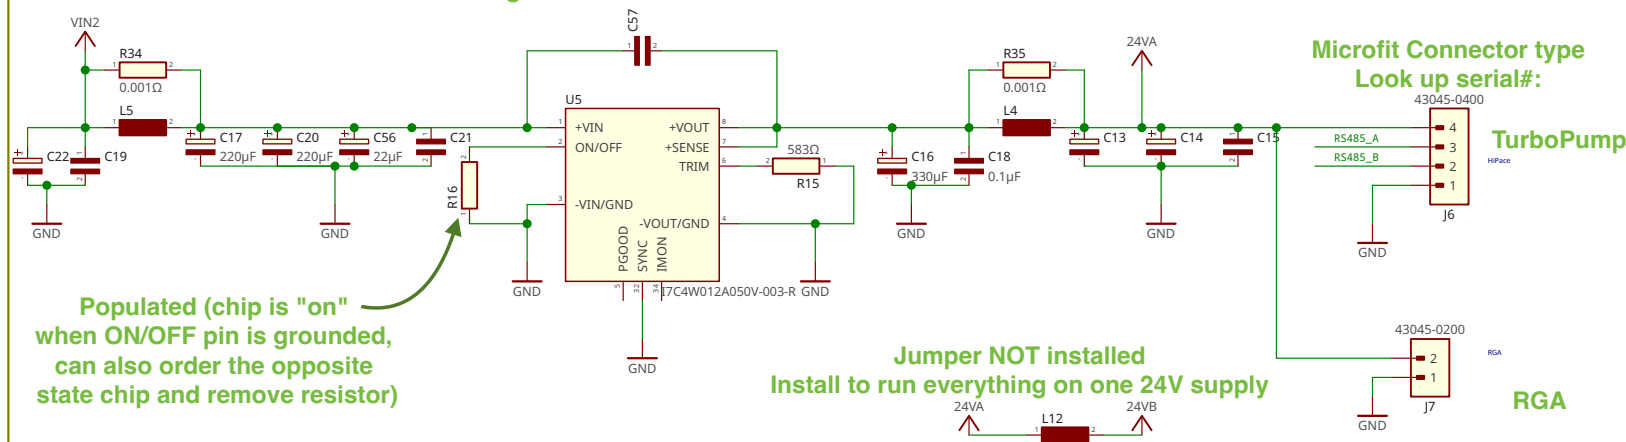

0MH means an inductor
can be used to
to change PI filter
If NOISE is Present/An Issue

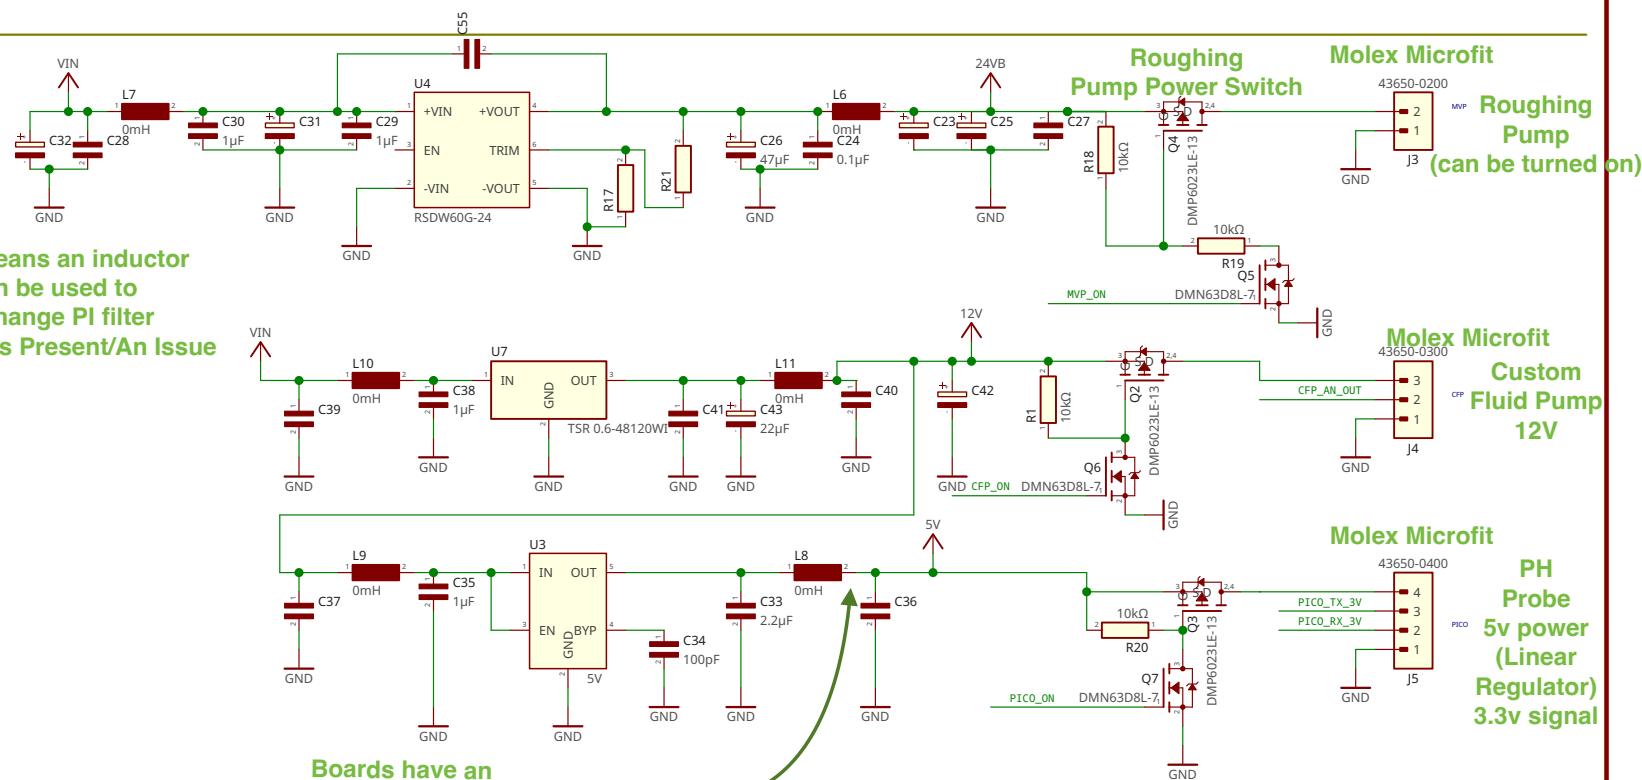

Boards have an
Un-shown 3.3v power supply about Here - Fits in as
a retrofitTo supply 3.3V buffers for the pico below

Power


100818


v1.0.1


2024-09-10

sam

Page 1 of 4

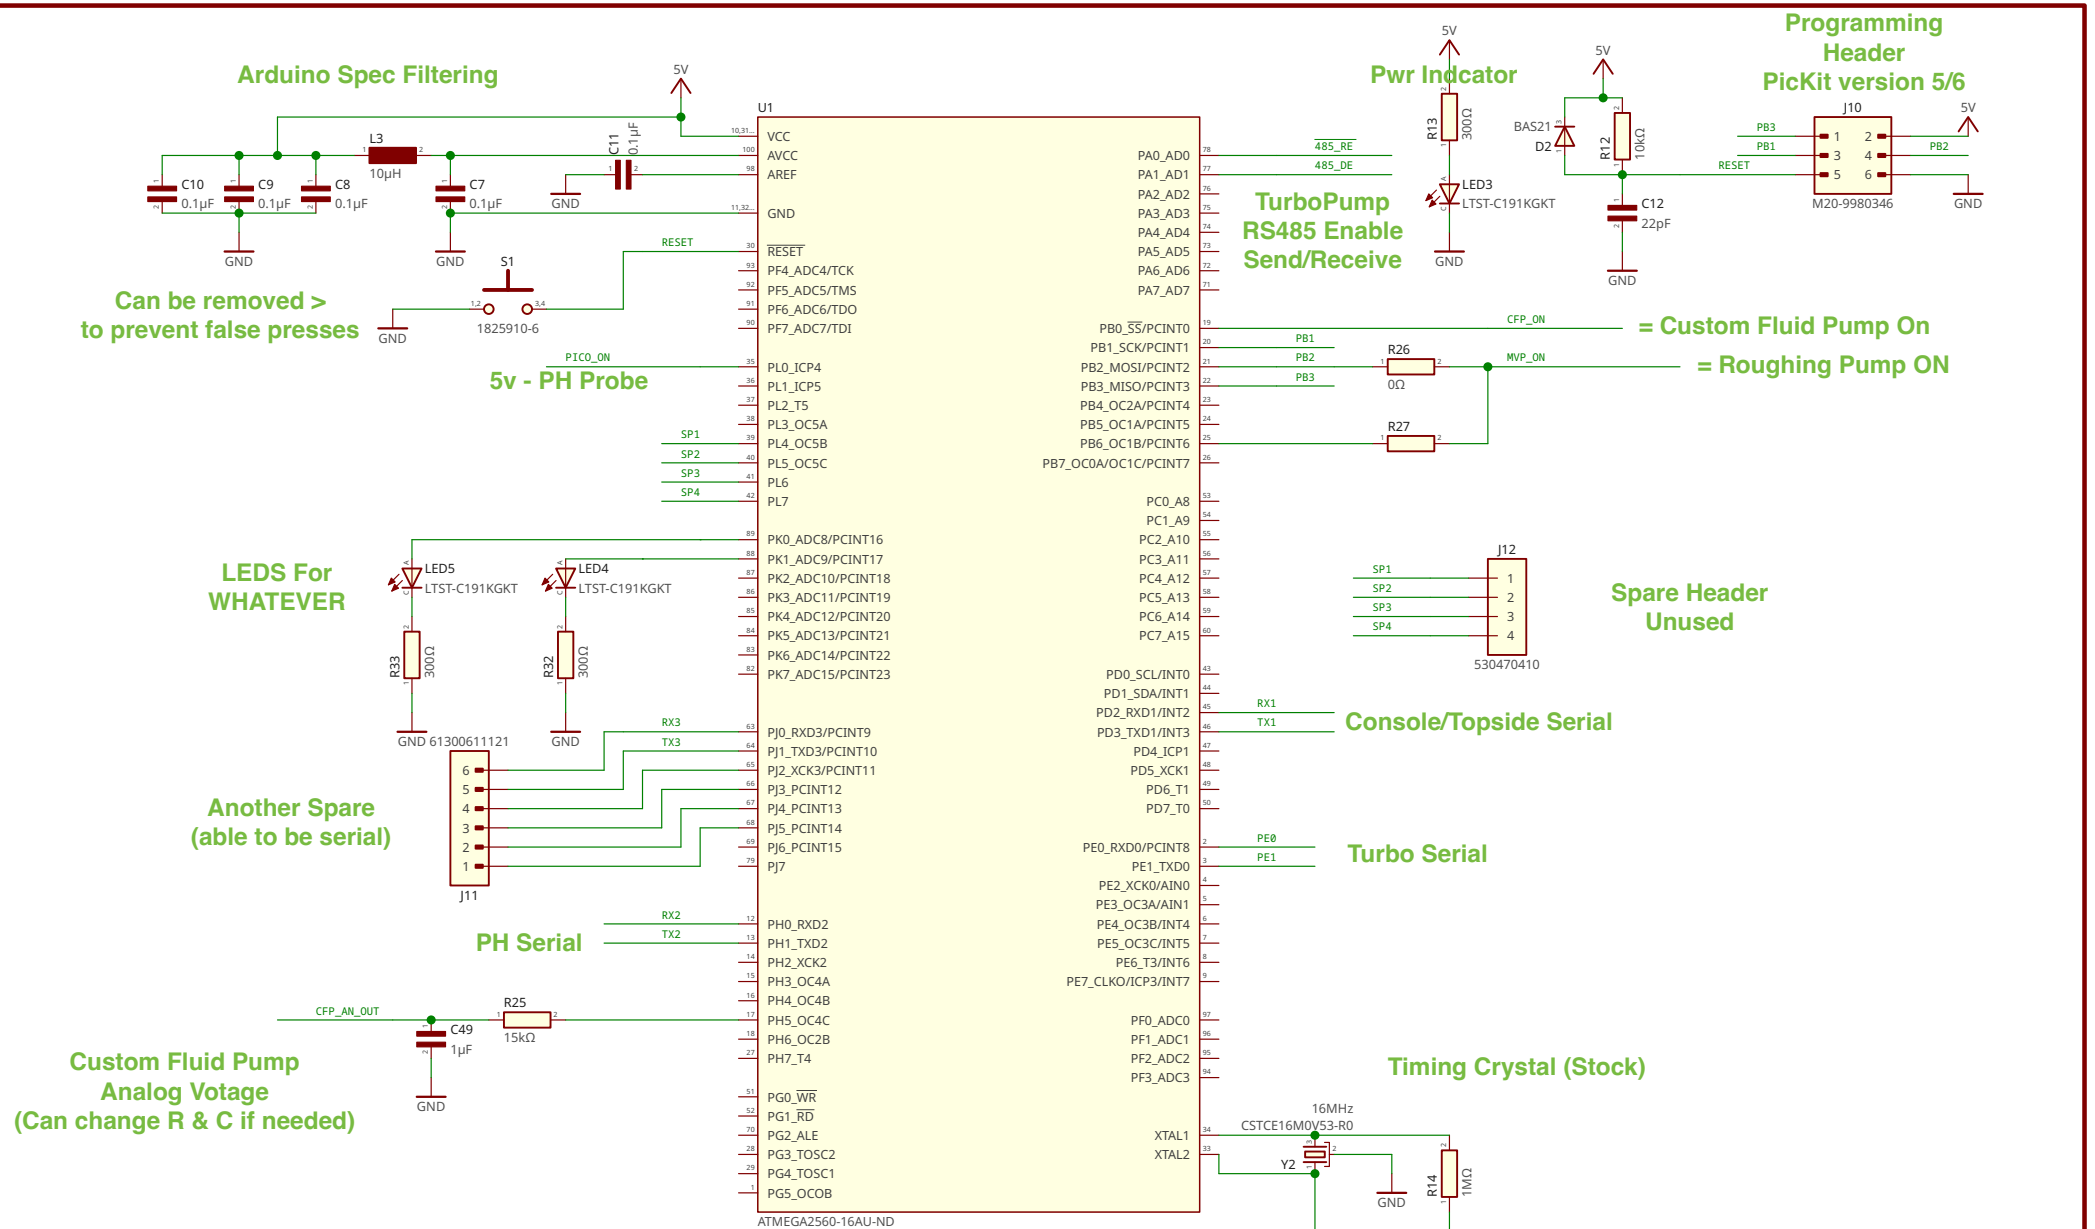

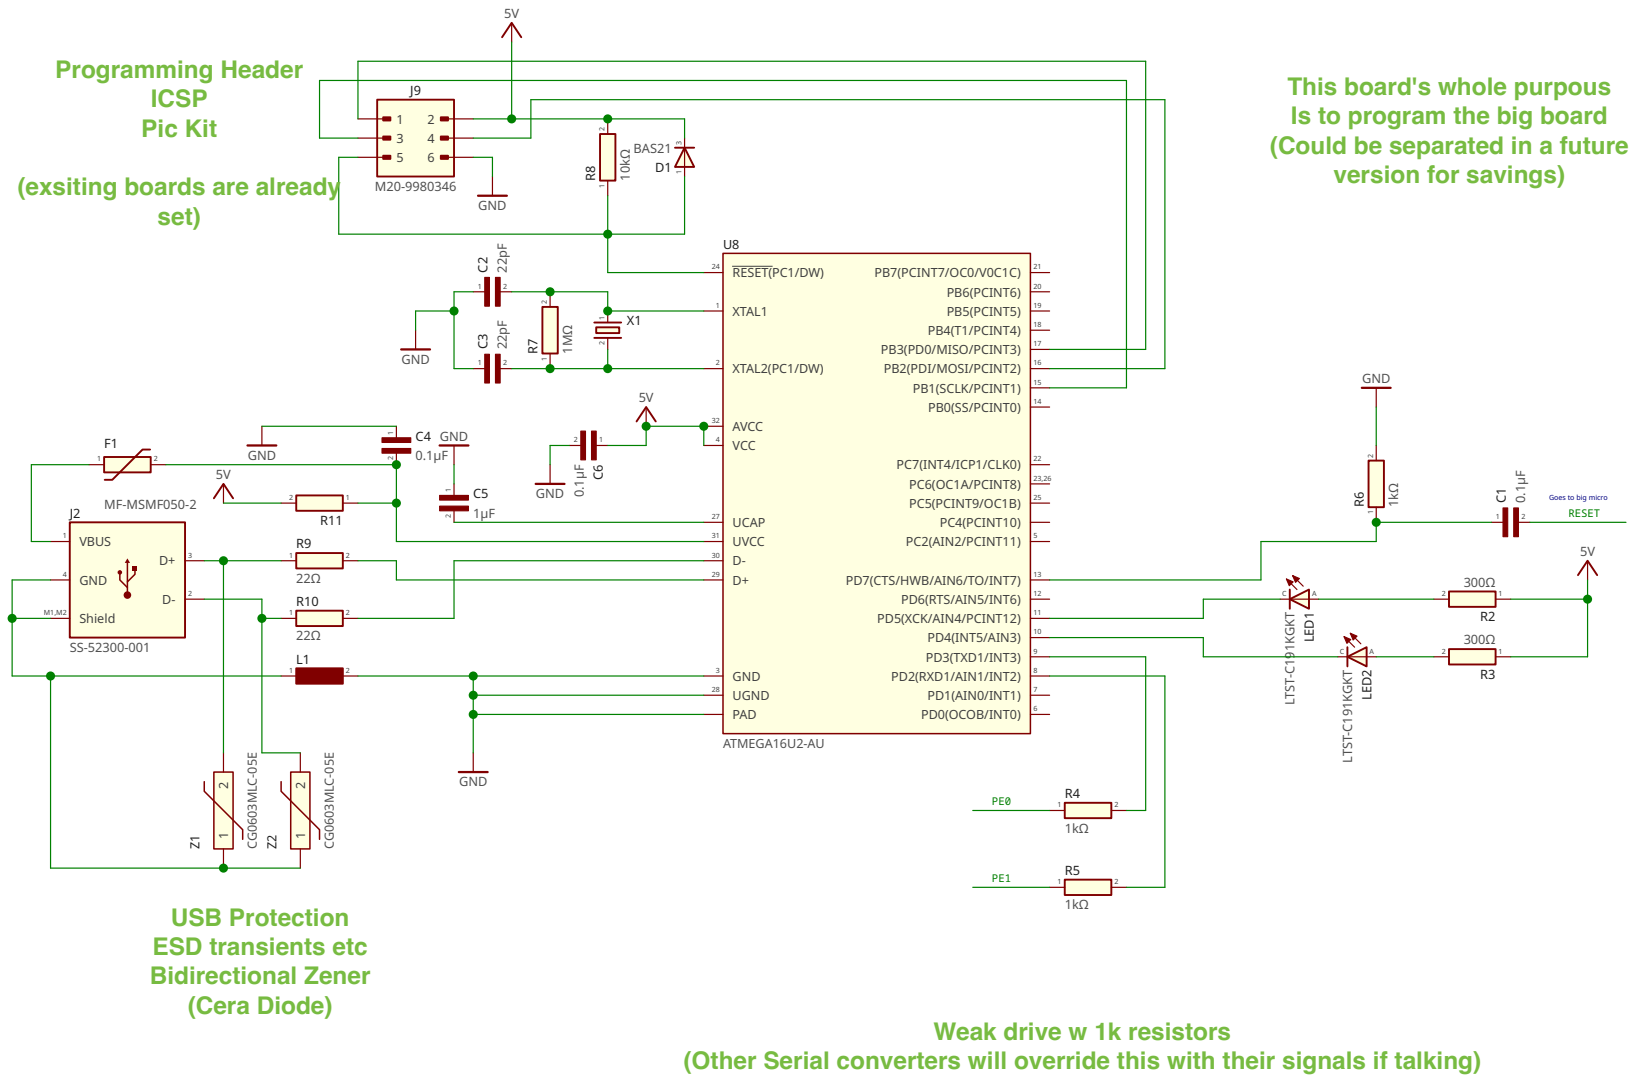

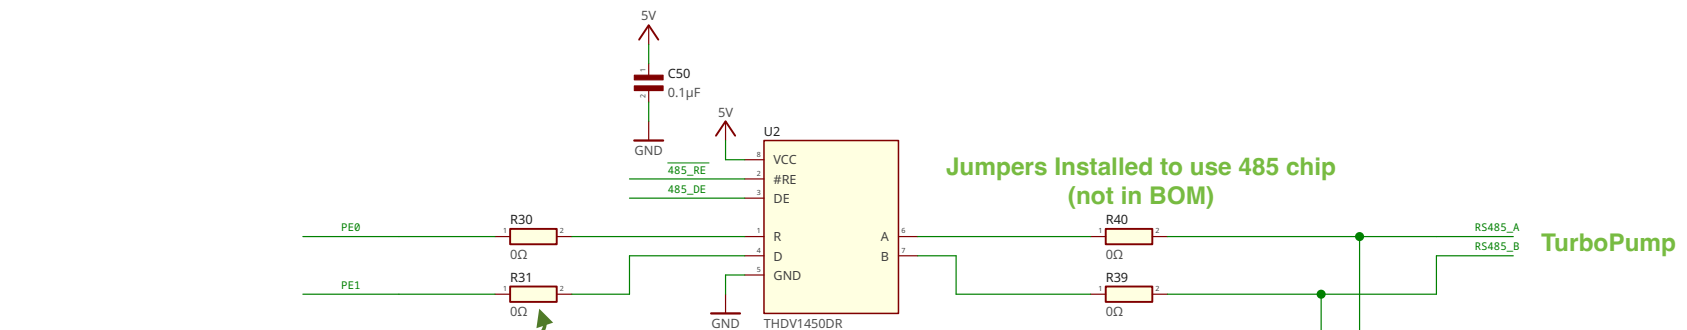

Jumpers Installed
Same Lines as used for Programming
Board - Ok with this chip because it doesn't pull
the lines down when not actively talking

Jumpers Installed to use 485 chip
(not in BOM)

TurboPump

Console In/Out (12V Signals)

Jumpers NOT Installed
Option to use RS232


Console (ttl = 5v)

Jumpers NOT Installed
Same Lines as Programming
Will not go high Impedance when low
So will mess with programming duinos

Jumpers NOT Installed
Option to use RS232

Boards have an
Unshown 3.3v power supply Here - Fits in as a retrofit
To supply 3.3V buffers

PH probe uses 3.3v serial signalling

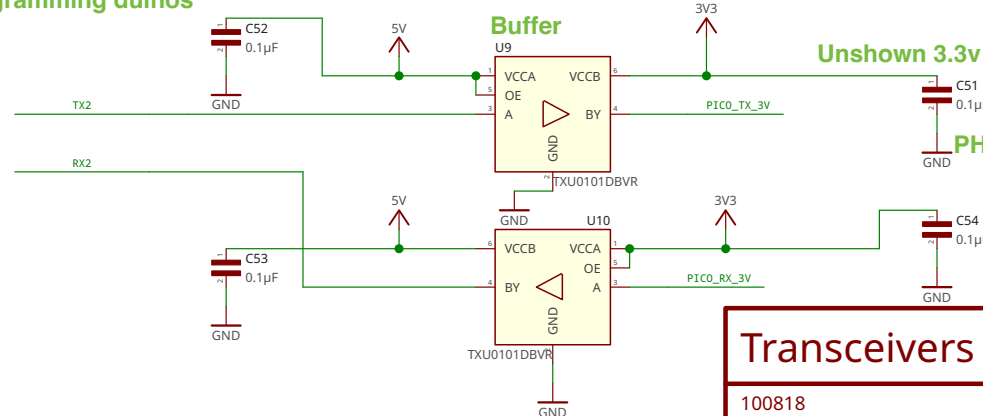

Transceivers		2024-09-10
		sam
100818	v1.0.1	Page 4 of 4