

$$d_1 = 845 \text{ кол.}$$

$$m = 0,25$$

$$d_{a1} = m_1 z_1 + 2m_1 = 22$$

$$0,25(z_1 + 2) = 22$$

$$z_1 = \frac{22}{0,25} - 2 = 86 \quad (85, \text{ из пред. ряда})$$

1-й ряд, предпочтительный
0,05; 0,06; 0,08; 0,1; 0,12;
[0,125]*; 0,15; [0,16]*; [0,2];
[0,25]; 0,3; [0,315]*; [0,4];
[0,5]; 0,6; [0,63]*; [0,8];
[1]; [1,25]; 1,5; [1,6]*; [2]



1-й ряд предпочтительный
14-22, 24-26, 28, 30, 32, 34,
36, 38, 40, 42, 45, 48, 50,
53, 60, 63, 67, 70, 71, 75,
80, 85, 90, 95, 100, 108, 112,
118, 125, 132, 140, 150, 160,
170, 180, 190, 200

$$\psi_m = 8$$

$$b_1 = \psi_m \cdot m_1 = 8 \cdot 0,25 = 2 \text{ мм}$$

$$d_{gen} = m_1 z_1 = 0,25 \cdot 85 = 21,25 \text{ мм}$$

$$d_{f1} = m_1 z_1 - 2m(h_a^* + c^*) = 0,25 \cdot 85 - 2 \cdot 0,25(1 + 0,25) = 20,625$$

Шестерня

$$d_{a2} = 10 \text{ мм}$$

$$m = 0,25$$

$$m z_2 + 2m = 10$$

$$0,25 z_2 + 0,5 = 10$$

$$z_2 = \frac{10 - 0,5}{0,25} = 38$$

$$d_{gen2} = m z_2 = 38 \cdot 0,25 = 9,5$$

$$d_{f2} = m z_2 - 2m(h_a^* + c^*) = 9,5 - 2 \cdot 0,25 \cdot 1,25 = 8,875$$

$$\psi_b = 8$$

$$b_2 = \psi_b m + 1,5 \cdot m = 2 + 1,5 \cdot 0,25 = 2,375 \text{ мм}$$


ШН 1000084

$$d = 4 \quad B = 2,5$$

$$D = 9 \quad r = 0,3$$

$$\alpha = 4 \quad D = 2,5$$

$$D = 9 \quad r = 0,3$$

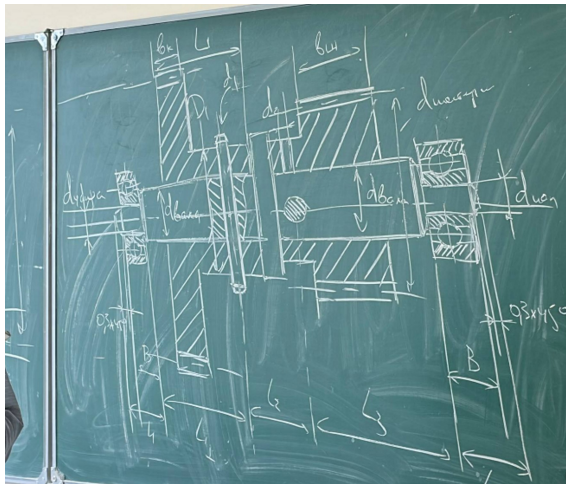

№ вар	№ схемы	M_{20} Н*мм	φ град.	n об/мин	L_2 часов	d_1 мм	d_2 мм	β_1 град.	β_2 град.	L_1 мм	L_2 мм	L_3 мм	Тип креп. З.К.	Тип креп. З.Ш.
28	2a	800	180	300	2500	10	22	0	12	10	30	10	штифт.	штифт.